

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Insured: [REDACTED]
Property: [REDACTED]
[REDACTED]

Home: 

Contractor: [REDACTED]
Company: JDR Restoration & Remodeling
Business: [REDACTED]
[REDACTED]

Business: (972) 584-7961
E-mail: info@jdrremodeling.com

Claim Number:**Policy Number:**

Type of Loss: Water Damage

Date of Loss: _____
Date Inspected: 7/2/2024 12:00 PM

Date Received:
Date Entered: 7/5/2024 8:25 AM

Price List: TXDF8X_JUL24
Restoration/Service/Remodel
Estimate: 


Main Level

Main Level

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
Job setup, safety and administration							
1. Residential Supervision / Project Management - per hour	20.00 HR		0.00	72.29	0.00	289.16	1,734.96
Estimated 2 hrs/day, 5 days/wk, for 2 weeks. Supervisor is responsible for budget creating and management, trade scheduling, ordering materials, working with named insured to select finishes, ensuring timely completion of project, and overall job quality.							
From Xactimate: Includes: Hourly labor rate for residential supervision/project management. Note: This is for a Superintendent/Proj. Manager used to manage residential jobs where formal Supervision/Proj. Management is needed to coordinate the work of subcontractors, or to perform other project management duties. This item should not be used for a working crew leader. The GC, estimator and/or parties involved will determine whether or not the use of a formal Superintendent/Proj. Manager is warranted, as well as the number of hours required to perform these tasks. A Superintendent/Proj. Manager generally manages multiple jobs at once. Generally, a typical single-family detached rebuild or new build would have a minimal amount of hours per weekday. In some cases, such as large multi-family/multi-unit/multi-bldg projects a full-time formal supervisor may be warranted. A Superintendent/Proj. Manager may complete tasks such as, but not limited to, creating/maintaining project schedules, coordinating/meeting trades, ordering materials, inspecting job sites, obtaining permits, meeting with inspectors, etc.							
2. Megohmmeter check electrical circuits - average residence	1.00 EA		0.00	973.87	0.00	194.78	1,168.65
Necessary to check electrical system to insure it is safe for occupants							
3. Respirator - Half face - multi-purpose resp. (per day)	2.00 DA		0.00	1.67	0.00	0.66	4.00
2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming							
4. Respirator cartridge - HEPA only (per pair)	2.00 EA		0.00	16.92	2.79	7.32	43.95
2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming							
5. Add for HEPA filter (for canister/backpack vacuums)	1.00 EA		0.00	89.91	6.02	19.18	115.11
Total: Main Level					8.81	511.10	3,066.67

Bathroom

Height: 9'

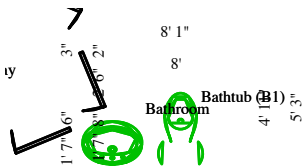

150.50 SF Walls
189.83 SF Walls & Ceiling
2.48 SY Flooring
25.83 LF Ceil. Perimeter

39.33 SF Ceiling
22.28 SF Floor
11.50 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
6. Batt insulation replacement per LF - 4" - up to 2' tall	5.42 LF		0.00	3.30	0.93	3.76	22.58
Allowance to replace insulation on exterior-facing walls							

CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
7. 1/2" - drywall per LF - up to 2' tall	11.50 LF		0.00	12.79	1.40	29.70	178.19
8. R&R 1/2" drywall - hung, taped, floated, ready for paint	8.00 SF		0.46	3.14	0.44	5.84	35.08
Replace drywall that was damaged while tile tub surround was being removed during mitigation							
9. R&R Drywall window return - up to 6"	4.00 LF		0.46	11.18	0.42	9.38	56.36
Repair drywall return on both sides of window							
10. Texture drywall - light hand texture	38.75 SF		0.00	1.25	0.26	9.74	58.44
Additional SF needed to blend in with surrounding texture							
11. Seal/prime (1 coat) then paint (2 coats) the walls	150.50 SF		0.00	1.76	3.97	53.78	322.63
12. Vanity	2.58 LF		0.00	236.97	41.66	130.62	783.66
13. Seal & paint vanity - inside and out	4.58 LF		0.00	51.32	1.87	47.40	284.32
Includes exposed end of vanity							
14. Vanity top - one sink - cultured marble	2.58 LF		0.00	95.21	13.13	51.74	310.51
15. Backsplash - solid surface - Unattached	4.58 LF		0.00	14.97	4.03	14.52	87.11
16. Sink - single - Reset	1.00 EA		0.00	106.42	0.06	21.30	127.78
17. Sink faucet - Reset	1.00 EA		0.00	147.74	0.00	29.54	177.28
18. P-trap assembly - ABS (plastic)	1.00 EA		0.00	72.39	0.69	14.62	87.70
19. Plumbing fixture supply line	2.00 EA		0.00	24.01	1.19	9.84	59.05
20. Angle stop valve	2.00 EA		0.00	44.49	2.06	18.22	109.26
21. Detach & Reset Mirror - framed	8.59 SF	6.33	0.00	0.00	0.00	10.88	65.25
22. Concrete grinding	22.28 SF		0.00	3.80	0.00	16.94	101.60
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
23. HEPA Vacuuming - Light - (PER SF)	22.28 SF		0.00	0.49	1.08	2.18	14.18
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
24. Mortar bed for tile floors	22.28 SF		0.00	4.69	4.26	21.76	130.51

JDR Restoration & Remodeling
 - Home Re-Imagined -
 E: jdrrestoration.com


CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
25. Tile floor covering	22.28 SF		0.00	10.98	9.82	50.88	305.33
26. Grout sealer	22.28 SF		0.00	1.21	0.35	5.48	32.79
27. Baseboard - 3 1/4"	11.50 LF		0.00	3.94	1.79	9.42	56.52
28. Seal (1 coat) & paint (1 coat) baseboard	11.50 LF		0.00	2.08	0.13	4.80	28.85
29. Door stop - wall or floor mounted	1.00 EA		0.00	14.52	0.52	3.00	18.04
30. Door opening (jamb & casing) - 32"to36"wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
31. Seal & paint door/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
32. Door hinges (set of 3) and slab - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
33. On site door prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
34. Interior door - Reset - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
35. Paint door slab only - 2 coats (per side)	1.00 EA		0.00	50.56	0.73	10.26	61.55
36. Mask wall - plastic, paper, tape (per LF)	25.83 LF		0.00	1.74	0.58	9.10	54.62
37. Floor protection - plastic and tape - 10 mil	22.28 SF		0.00	0.38	0.22	1.74	10.43
38. Toilet - Reset	1.00 EA		0.00	176.33	0.72	35.40	212.45
39. Plumbing fixture supply line	1.00 EA		0.00	24.01	0.60	4.92	29.53
40. Angle stop valve	1.00 EA		0.00	44.49	1.03	9.10	54.62
BATHTUB							
41. Batt insulation - 4" - R15 - paper / foil faced	82.64 SF		0.00	1.54	6.41	26.74	160.42
42. 1/2" Cement board	82.64 SF		0.00	5.14	13.57	87.68	526.02
43. Waterproof membrane - poly - tile underlayment	69.44 SF		0.00	6.16	15.01	88.56	531.32
44. Bathtub - Reset	1.00 EA		0.00	438.52	0.00	87.70	526.22
45. Tile tub surround - 60 to 75 SF	1.00 EA		0.00	1,485.81	41.65	305.50	1,832.96
46. Tile - soap dish	1.00 EA		0.00	26.75	0.89	5.54	33.18
47. Seal grout on tile wall	69.44 SF		0.00	1.31	1.09	18.42	110.48
48. Tile - towel bar	1.00 EA		0.00	33.92	1.05	7.00	41.97
49. R&R Window sill - tile on 2" x 4" wall	4.33 LF		2.34	10.38	1.41	11.30	67.79
50. Tub/shower faucet - Detach & reset	1.00 EA		0.00	249.06	0.00	49.82	298.88

MISCELLANEOUS

CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
51. Detach & Reset Towel bar	1.00 EA	17.34	0.00	0.00	0.00	3.46	20.80
52. Towel ring - Detach & reset	1.00 EA		0.00	18.30	0.00	3.66	21.96
53. Toilet paper holder - Detach & reset	1.00 EA		0.00	18.30	0.00	3.66	21.96
54. Detach & Reset Light bar - 4 lights	1.00 EA	63.37	0.00	0.00	0.00	12.68	76.05
55. Content Manipulation charge - per hour	0.50 HR		0.00	57.21	0.00	5.72	34.33
56. Final cleaning - construction - Residential	22.28 SF		0.00	0.37	0.82	1.64	10.70
Totals: Bathroom					187.16	1,449.50	8,698.64

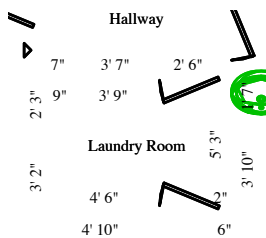

Laundry Room

Height: 9'

223.50 SF Walls
261.13 SF Walls & Ceiling
4.18 SY Flooring
24.83 LF Ceil. Perimeter

37.63 SF Ceiling
37.63 SF Floor
24.83 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
57. Batt insulation replacement per LF - 4" - up to 2' tall	9.75 LF		0.00	3.30	1.68	6.78	40.64
58. 1/2" - drywall per LF - up to 2' tall	24.83 LF		0.00	12.79	3.03	64.12	384.73
59. Texture drywall - light hand texture	62.08 SF		0.00	1.25	0.41	15.60	93.61
Additional SF needed to blend in with surrounding texture							
60. Seal/prime (1 coat) then paint (2 coats) the walls	223.50 SF		0.00	1.76	5.90	79.86	479.12
61. Concrete grinding	37.63 SF		0.00	3.80	0.00	28.60	171.59
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
62. HEPA Vacuuming - Light - (PER SF)	37.63 SF		0.00	0.49	1.82	3.68	23.94