



JDR Restoration & Remodeling

JDR Restoration & Remodeling  
- Home Re-Imagined -  
E: jdrrestoration.com

Insured: [REDACTED]  
Property: [REDACTED]  
[REDACTED]

Home: [REDACTED]

Contractor: [REDACTED]  
Company: JDR Restoration & Remodeling  
Business: [REDACTED]  
[REDACTED]

Business: (972) 584-7961  
E-mail: info@jdrremodeling.com



Claim Number: Policy Number: Type of Loss: Water Damage

Date of Loss:  
Date Inspected: 7/2/2024 12:00 PM

Date Received:  
Date Entered: 7/5/2024 8:25 AM

Price List: TXDF8X\_JUL24  
Restoration/Service/Remodel  
Estimate: [REDACTED]




## Main Level

### Main Level

| DESCRIPTION                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | QTY      | RESET | REMOVE | REPLACE | TAX  | O&P    | TOTAL    |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|-------|--------|---------|------|--------|----------|
| Job setup, safety and administration                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |          |       |        |         |      |        |          |
| 1. Residential Supervision / Project Management - per hour                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | 20.00 HR |       | 0.00   | 72.29   | 0.00 | 289.16 | 1,734.96 |
| Estimated 2 hrs/day, 5 days/wk, for 2 weeks. Supervisor is responsible for budget creating and management, trade scheduling, ordering materials, working with named insured to select finishes, ensuring timely completion of project, and overall job quality.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |          |       |        |         |      |        |          |
| From Xactimate:                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |          |       |        |         |      |        |          |
| Includes: Hourly labor rate for residential supervision/project management.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |          |       |        |         |      |        |          |
| Note: This is for a Superintendent/Proj. Manager used to manage residential jobs where formal Supervision/Proj. Management is needed to coordinate the work of subcontractors, or to perform other project management duties. This item should not be used for a working crew leader. The GC, estimator and/or parties involved will determine whether or not the use of a formal Superintendent/Proj. Manager is warranted, as well as the number of hours required to perform these tasks. A Superintendent/Proj. Manager generally manages multiple jobs at once. Generally, a typical single-family detached rebuild or new build would have a minimal amount of hours per weekday. In some cases, such as large multi-family/multi-unit/multi-bldg projects a full-time formal supervisor may be warranted. A Superintendent/Proj. Manager may complete tasks such as, but not limited to, creating/maintaining project schedules, coordinating/meeting trades, ordering materials, inspecting job sites, obtaining permits, meeting with inspectors, etc. |          |       |        |         |      |        |          |
| 2. Megohmmeter check electrical circuits - average residence                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | 1.00 EA  |       | 0.00   | 973.87  | 0.00 | 194.78 | 1,168.65 |
| Necessary to check electrical system to insure it is safe for occupants                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |          |       |        |         |      |        |          |
| 3. Respirator - Half face purpose resp. (per day)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | 2.00 DA  |       | 0.00   | 1.67    | 0.00 | 0.66   | 4.00     |
| 2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |          |       |        |         |      |        |          |
| 4. Respirator cartridge - HEPA (per pair)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 2.00 EA  |       | 0.00   | 16.92   | 2.79 | 7.32   | 43.95    |
| 2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |          |       |        |         |      |        |          |
| 5. Add for HEPA filter canister/backpack vacuums)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | 1.00 EA  |       | 0.00   | 89.91   | 6.02 | 19.18  | 115.11   |
| Total: Main Level                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |          |       |        |         | 8.81 | 511.10 | 3,066.67 |

## Bathroom

Height: 9'

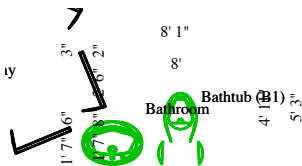

150.50 SF Walls  
189.83 SF Walls & Ceiling  
2.48 SY Flooring  
25.83 LF Ceil. Perimeter

39.33 SF Ceiling  
22.28 SF Floor  
11.50 LF Floor Perimeter

| DESCRIPTION                                                | QTY     | RESET | REMOVE | REPLACE | TAX  | O&P  | TOTAL |
|------------------------------------------------------------|---------|-------|--------|---------|------|------|-------|
| 6. Batt insulation replacement per LF - 4" - up to 2' tall | 5.42 LF |       | 0.00   | 3.30    | 0.93 | 3.76 | 22.58 |
| Allowance to replace insulation on exterior-facing walls   |         |       |        |         |      |      |       |

## CONTINUED - Bathroom



| DESCRIPTION                                                                                       | QTY       | RESET | REMOVE | REPLACE | TAX   | O&P    | TOTAL  |
|---------------------------------------------------------------------------------------------------|-----------|-------|--------|---------|-------|--------|--------|
| 7. 1/2" - drywall per LF - up to 2' tall                                                          | 11.50 LF  |       | 0.00   | 12.79   | 1.40  | 29.70  | 178.19 |
| 8. R&R 1/2" drywall - hung, taped, floated, ready for paint                                       | 8.00 SF   |       | 0.46   | 3.14    | 0.44  | 5.84   | 35.08  |
| Replace drywall that was damaged while tile tub surround was being removed during mitigation      |           |       |        |         |       |        |        |
| 9. R&R Drywall window return - up to 6"                                                           | 4.00 LF   |       | 0.46   | 11.18   | 0.42  | 9.38   | 56.36  |
| Repair drywall return on both sides of window                                                     |           |       |        |         |       |        |        |
| 10. Texture drywall - light texture                                                               | 38.75 SF  |       | 0.00   | 1.25    | 0.26  | 9.74   | 58.44  |
| Additional SF needed to blend in with surrounding texture                                         |           |       |        |         |       |        |        |
| 11. Seal/prime (1 coat) then paint (2 coats) the walls                                            | 150.50 SF |       | 0.00   | 1.76    | 3.97  | 53.78  | 322.63 |
| 12. Vanity                                                                                        | 2.58 LF   |       | 0.00   | 236.97  | 41.66 | 130.62 | 783.66 |
| 13. Seal & paint vanity - inside and out                                                          | 4.58 LF   |       | 0.00   | 51.32   | 1.87  | 47.40  | 284.32 |
| Includes exposed end of vanity                                                                    |           |       |        |         |       |        |        |
| 14. Vanity top - one sink - solid marble                                                          | 2.58 LF   |       | 0.00   | 95.21   | 13.13 | 51.74  | 310.51 |
| 15. Backsplash - solid surface Unattached                                                         | 4.58 LF   |       | 0.00   | 14.97   | 4.03  | 14.52  | 87.11  |
| 16. Sink - single - Reset                                                                         | 1.00 EA   |       | 0.00   | 106.42  | 0.06  | 21.30  | 127.78 |
| 17. Sink faucet - Reset                                                                           | 1.00 EA   |       | 0.00   | 147.74  | 0.00  | 29.54  | 177.28 |
| 18. P-trap assembly - ABS (plastic)                                                               | 1.00 EA   |       | 0.00   | 72.39   | 0.69  | 14.62  | 87.70  |
| 19. Plumbing fixture supply line                                                                  | 2.00 EA   |       | 0.00   | 24.01   | 1.19  | 9.84   | 59.05  |
| 20. Angle stop valve                                                                              | 2.00 EA   |       | 0.00   | 44.49   | 2.06  | 18.22  | 109.26 |
| 21. Detach & Reset Mirror - framed                                                                | 8.59 SF   | 6.33  | 0.00   | 0.00    | 0.00  | 10.88  | 65.25  |
| 22. Concrete grinding                                                                             | 22.28 SF  |       | 0.00   | 3.80    | 0.00  | 16.94  | 101.60 |
| Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation |           |       |        |         |       |        |        |
| 23. HEPA Vacuuming - Light - (PER SF)                                                             | 22.28 SF  |       | 0.00   | 0.49    | 1.08  | 2.18   | 14.18  |

HEPA vacuum as required by OSHA

<https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153>

(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

OR

Use machine equipped with dust collection system recommended by the manufacturer

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism

When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes

|                                |          |  |      |      |      |       |        |
|--------------------------------|----------|--|------|------|------|-------|--------|
| 24. Mortar bed for tile floors | 22.28 SF |  | 0.00 | 4.69 | 4.26 | 21.76 | 130.51 |
|--------------------------------|----------|--|------|------|------|-------|--------|

JDR Restoration & Remodeling  
- Home Re-Imagined -  
E: jdrrestoration.com

## CONTINUED - Bathroom




| DESCRIPTION                                                                 | QTY      | RESET | REMOVE | REPLACE  | TAX   | O&P    | TOTAL    |
|-----------------------------------------------------------------------------|----------|-------|--------|----------|-------|--------|----------|
| 25. Tile floor covering                                                     | 22.28 SF |       | 0.00   | 10.98    | 9.82  | 50.88  | 305.33   |
| 26. Grout sealer                                                            | 22.28 SF |       | 0.00   | 1.21     | 0.35  | 5.48   | 32.79    |
| 27. Baseboard - 3 1/4"                                                      | 11.50 LF |       | 0.00   | 3.94     | 1.79  | 9.42   | 56.52    |
| 28. Seal (1 coat) & paint (1 coat) baseboard                                | 11.50 LF |       | 0.00   | 2.08     | 0.13  | 4.80   | 28.85    |
| 29. Door stop - wall or floor mounted                                       | 1.00 EA  |       | 0.00   | 14.52    | 0.52  | 3.00   | 18.04    |
| 30. Door opening (jamb & casing) - 32" to 36" wide - paint grade            | 1.00 EA  |       | 0.00   | 179.14   | 10.40 | 37.90  | 227.44   |
| 31. Seal & paint door/window trim & jamb - (per side)                       | 2.00 EA  |       | 0.00   | 43.19    | 0.92  | 17.46  | 104.76   |
| 32. Door hinges (set of 3) - Detach & reset                                 | 1.00 EA  |       | 0.00   | 29.94    | 0.00  | 5.98   | 35.92    |
| Door hinges will need to be detached and reset to allow replacement of jamb |          |       |        |          |       |        |          |
| 33. On site door prep. for full hinges - Labor only                         | 1.00 EA  |       | 0.00   | 102.27   | 0.00  | 20.46  | 122.73   |
| 34. Interior door - Reset - slab only                                       | 1.00 EA  |       | 0.00   | 13.77    | 0.00  | 2.76   | 16.53    |
| 35. Paint door slab only - (per side)                                       | 1.00 EA  |       | 0.00   | 50.56    | 0.73  | 10.26  | 61.55    |
| 36. Mask wall - plastic, paper, tape (per LF)                               | 25.83 LF |       | 0.00   | 1.74     | 0.58  | 9.10   | 54.62    |
| 37. Floor protection - plastic and tape 10 mil                              | 22.28 SF |       | 0.00   | 0.38     | 0.22  | 1.74   | 10.43    |
| 38. Toilet - Reset                                                          | 1.00 EA  |       | 0.00   | 176.33   | 0.72  | 35.40  | 212.45   |
| 39. Plumbing fixture supply line                                            | 1.00 EA  |       | 0.00   | 24.01    | 0.60  | 4.92   | 29.53    |
| 40. Angle stop valve                                                        | 1.00 EA  |       | 0.00   | 44.49    | 1.03  | 9.10   | 54.62    |
| <b>BATHTUB</b>                                                              |          |       |        |          |       |        |          |
| 41. Batt insulation - 4" - R15 - paper / foil faced                         | 82.64 SF |       | 0.00   | 1.54     | 6.41  | 26.74  | 160.42   |
| 42. 1/2" Cement board                                                       | 82.64 SF |       | 0.00   | 5.14     | 13.57 | 87.68  | 526.02   |
| 43. Waterproof membrane - poly - tile underlayment                          | 69.44 SF |       | 0.00   | 6.16     | 15.01 | 88.56  | 531.32   |
| 44. Bathtub - Reset                                                         | 1.00 EA  |       | 0.00   | 438.52   | 0.00  | 87.70  | 526.22   |
| 45. Tile tub surround - 60 to 75 SF                                         | 1.00 EA  |       | 0.00   | 1,485.81 | 41.65 | 305.50 | 1,832.96 |
| 46. Tile - soap dish                                                        | 1.00 EA  |       | 0.00   | 26.75    | 0.89  | 5.54   | 33.18    |
| 47. Seal grout on tile wall                                                 | 69.44 SF |       | 0.00   | 1.31     | 1.09  | 18.42  | 110.48   |
| 48. Tile - towel bar                                                        | 1.00 EA  |       | 0.00   | 33.92    | 1.05  | 7.00   | 41.97    |
| 49. R&R Window sill - tile on wall                                          | 4.33 LF  |       | 2.34   | 10.38    | 1.41  | 11.30  | 67.79    |
| 50. Tub/shower faucet - Detach & reset                                      | 1.00 EA  |       | 0.00   | 249.06   | 0.00  | 49.82  | 298.88   |

## MISCELLANEOUS

## CONTINUED - Bathroom

| DESCRIPTION                                   | QTY      | RESET | REMOVE | REPLACE | TAX    | O&P      | TOTAL    |
|-----------------------------------------------|----------|-------|--------|---------|--------|----------|----------|
| 51. Detach & Reset Towel bar                  | 1.00 EA  | 17.34 | 0.00   | 0.00    | 0.00   | 3.46     | 20.80    |
| 52. Towel ring - Detach & reset               | 1.00 EA  |       | 0.00   | 18.30   | 0.00   | 3.66     | 21.96    |
| 53. Toilet paper holder - Detach & reset      | 1.00 EA  |       | 0.00   | 18.30   | 0.00   | 3.66     | 21.96    |
| 54. Detach & Reset Light bar - 4 lights       | 1.00 EA  | 63.37 | 0.00   | 0.00    | 0.00   | 12.68    | 76.05    |
| 55. Content Manipulation charge - 1 hour      | 0.50 HR  |       | 0.00   | 57.21   | 0.00   | 5.72     | 34.33    |
| 56. Final cleaning - construction Residential | 22.28 SF |       | 0.00   | 0.37    | 0.82   | 1.64     | 10.70    |
| Totals: Bathroom                              |          |       |        |         | 187.16 | 1,449.50 | 8,698.64 |

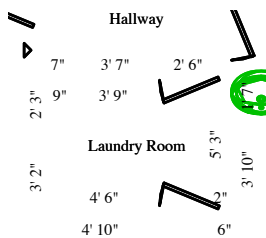

## Laundry Room

223.50 SF Walls  
261.13 SF Walls & Ceiling  
4.18 SY Flooring  
24.83 LF Ceil. Perimeter

37.63 SF Ceiling  
37.63 SF Floor  
24.83 LF Floor Perimeter

Height: 9'


| DESCRIPTION                                                                                       | QTY       | RESET | REMOVE | REPLACE | TAX  | O&P   | TOTAL  |
|---------------------------------------------------------------------------------------------------|-----------|-------|--------|---------|------|-------|--------|
| 57. Batt insulation replacement per LF - 4" - up to 2' tall                                       | 7.75 LF   |       | 0.00   | 3.30    | 1.68 | 6.78  | 40.64  |
| 58. 1/2" - drywall per LF - up to 2' tall                                                         | 24.83 LF  |       | 0.00   | 12.79   | 3.03 | 64.12 | 384.73 |
| 59. Texture drywall - light texture                                                               | 62.08 SF  |       | 0.00   | 1.25    | 0.41 | 15.60 | 93.61  |
| Additional SF needed to blend in with surrounding texture                                         |           |       |        |         |      |       |        |
| 60. Seal/prime (1 coat) then paint (2 coats) the walls                                            | 223.50 SF |       | 0.00   | 1.76    | 5.90 | 79.86 | 479.12 |
| 61. Concrete grinding                                                                             | 37.63 SF  |       | 0.00   | 3.80    | 0.00 | 28.60 | 171.59 |
| Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation |           |       |        |         |      |       |        |
| 62. HEPA Vacuuming - Light - (PER SF)                                                             | 37.63 SF  |       | 0.00   | 0.49    | 1.82 | 3.68  | 23.94  |

JDR Restoration & Remodeling  
- Home Re-Imagined -  
E: jdrrestoration.com

## CONTINUED - Laundry Room

| DESCRIPTION                                                                                                                                                            | QTY      | RESET | REMOVE | REPLACE | TAX   | O&P    | TOTAL    |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|-------|--------|---------|-------|--------|----------|
| HEPA vacuum as required by OSHA                                                                                                                                        |          |       |        |         |       |        |          |
| <a href="https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153">https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153</a>        |          |       |        |         |       |        |          |
| (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface |          |       |        |         |       |        |          |
| Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions                                                                    |          |       |        |         |       |        |          |
| OR                                                                                                                                                                     |          |       |        |         |       |        |          |
| Use machine equipped with dust collection system recommended by the manufacturer                                                                                       |          |       |        |         |       |        |          |
| Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions                                                                    |          |       |        |         |       |        |          |
| Dust collector must provide air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism     |          |       |        |         |       |        |          |
| When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes                                                            |          |       |        |         |       |        |          |
| 63. Mortar bed for tile floors                                                                                                                                         | 37.63 SF |       | 0.00   | 4.69    | 7.20  | 36.74  | 220.42   |
| 64. Tile floor covering                                                                                                                                                | 37.63 SF |       | 0.00   | 10.98   | 16.58 | 85.96  | 515.72   |
| 65. Grout sealer                                                                                                                                                       | 37.63 SF |       | 0.00   | 1.21    | 0.59  | 9.22   | 55.34    |
| 66. Baseboard - 3 1/4"                                                                                                                                                 | 24.83 LF |       | 0.00   | 3.94    | 3.87  | 20.34  | 122.04   |
| 67. Seal (1 coat) & paint (1 coat) baseboard                                                                                                                           | 24.83 LF |       | 0.00   | 2.08    | 0.29  | 10.40  | 62.34    |
| 68. Door stop - wall or floor mounted                                                                                                                                  | 1.00 EA  |       | 0.00   | 14.52   | 0.52  | 3.00   | 18.04    |
| 69. Door opening (jamb & casing) - 32"to36"wide - paint grade                                                                                                          | 1.00 EA  |       | 0.00   | 179.14  | 10.40 | 37.90  | 227.44   |
| 70. Seal & paint door/window trim & jamb - (per side)                                                                                                                  | 2.00 EA  |       | 0.00   | 43.19   | 0.92  | 17.46  | 104.76   |
| 71. Door hinges (set of 1) slab - Detach & reset                                                                                                                       | 1.00 EA  |       | 0.00   | 29.94   | 0.00  | 5.98   | 35.92    |
| Door hinges will need to be detached and reset to allow replacement of jamb                                                                                            |          |       |        |         |       |        |          |
| 72. On site door prep. for full hinges - Labor only                                                                                                                    | 1.00 EA  |       | 0.00   | 102.27  | 0.00  | 20.46  | 122.73   |
| 73. Interior door - Reset - slab only                                                                                                                                  | 1.00 EA  |       | 0.00   | 13.77   | 0.00  | 2.76   | 16.53    |
| 74. Paint door slab only - 2 coats (per side)                                                                                                                          | 2.00 EA  |       | 0.00   | 50.56   | 1.45  | 20.52  | 123.09   |
| 75. Mask wall - plastic, paper, tape (per LF)                                                                                                                          | 24.83 LF |       | 0.00   | 1.74    | 0.55  | 8.76   | 52.51    |
| 76. Floor protection - plastic and tape 10 mil                                                                                                                         | 37.63 SF |       | 0.00   | 0.38    | 0.37  | 2.94   | 17.61    |
| 77. Washer/Washing machine - Remove & reset                                                                                                                            | 1.00 EA  |       | 0.00   | 59.71   | 0.00  | 11.94  | 71.65    |
| 78. Dryer - Remove & reset                                                                                                                                             | 1.00 EA  |       | 0.00   | 46.04   | 0.00  | 9.20   | 55.24    |
| 79. Content Manipulation charge - 1 hour                                                                                                                               | 1.00 HR  |       | 0.00   | 57.21   | 0.00  | 11.44  | 68.65    |
| 80. Final cleaning - construction Residential                                                                                                                          | 37.63 SF |       | 0.00   | 0.37    | 1.38  | 2.78   | 18.08    |
| Totals: Laundry Room                                                                                                                                                   |          |       |        |         | 56.96 | 516.44 | 3,101.74 |

JDR Restoration & Remodeling  
- Home Re-Imagined -  
E: jdrrestoration.com

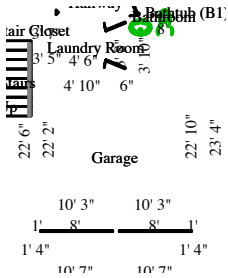


**Garage**

**Height: 9'**

814.50 SF Walls  
1,221.74 SF Walls & Ceiling  
45.25 SY Flooring  
90.50 LF Ceil. Perimeter

407.24 SF Ceiling  
407.24 SF Floor  
90.50 LF Floor Perimeter

| DESCRIPTION                                                                 | QTY       | RESET | REMOVE | REPLACE | TAX   | O&P    | TOTAL    |
|-----------------------------------------------------------------------------|-----------|-------|--------|---------|-------|--------|----------|
| 81. Batt insulation replacement per LF - 4" - up to 2' tall                 | 14.25 LF  |       | 0.00   | 3.30    | 2.46  | 9.90   | 59.39    |
| 82. 1/2" - drywall per LF - up to 2' tall                                   | 14.25 LF  |       | 0.00   | 12.79   | 1.74  | 36.80  | 220.80   |
| 83. Texture drywall - light texture                                         | 35.63 SF  |       | 0.00   | 1.25    | 0.24  | 8.94   | 53.72    |
| Additional SF needed to blend in with surrounding texture                   |           |       |        |         |       |        |          |
| 84. Seal/prime (1 coat) then paint (2 coats) the walls                      | 814.50 SF |       | 0.00   | 1.76    | 21.50 | 291.00 | 1,746.02 |
| 85. Baseboard - 3 1/4"                                                      | 14.25 LF  |       | 0.00   | 3.94    | 2.22  | 11.68  | 70.05    |
| 86. Seal (1 coat) & paint (1 coat) baseboard                                | 90.50 LF  |       | 0.00   | 2.08    | 1.05  | 37.86  | 227.15   |
| 87. Door opening (jamb & casing) - 32" to 36" wide - paint grade            | 1.00 EA   |       | 0.00   | 179.14  | 10.40 | 37.90  | 227.44   |
| 88. Seal & paint door/window trim & jamb - (per side)                       | 2.00 EA   |       | 0.00   | 43.19   | 0.92  | 17.46  | 104.76   |
| 89. Door hinges (set of 3) - Detach & reset                                 | 1.00 EA   |       | 0.00   | 29.94   | 0.00  | 5.98   | 35.92    |
| Door hinges will need to be detached and reset to allow replacement of jamb |           |       |        |         |       |        |          |
| 90. On site door prep. for full hinges - Labor only                         | 1.00 EA   |       | 0.00   | 102.27  | 0.00  | 20.46  | 122.73   |
| 91. Interior door - Reset - slab only                                       | 1.00 EA   |       | 0.00   | 13.77   | 0.00  | 2.76   | 16.53    |
| 92. Paint door slab only - (per side)                                       | 2.00 EA   |       | 0.00   | 50.56   | 1.45  | 20.52  | 123.09   |
| 93. Mask wall - plastic, paper, tape (per LF)                               | 90.50 LF  |       | 0.00   | 1.74    | 2.02  | 31.90  | 191.39   |
| 94. Floor protection - plastic and tape 10 mil                              | 407.24 SF |       | 0.00   | 0.38    | 4.03  | 31.76  | 190.54   |
| 95. Content Manipulation charge - hour                                      | 2.00 HR   |       | 0.00   | 57.21   | 0.00  | 22.88  | 137.30   |
| 96. Final cleaning - construction Residential                               | 407.24 SF |       | 0.00   | 0.37    | 14.92 | 30.14  | 195.74   |
| Totals: Garage                                                              |           |       |        |         | 62.95 | 617.94 | 3,722.57 |

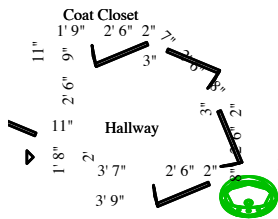

**Hallway**

**Height: 9'**

205.17 SF Walls  
242.23 SF Walls & Ceiling  
4.12 SY Flooring  
24.61 LF Ceil. Perimeter


37.05 SF Ceiling  
37.05 SF Floor  
22.11 LF Floor Perimeter

**Missing Wall - Goes to Floor**

**2' 6" X 6' 8"**

**Opens into LIVING\_ROOM2**

| DESCRIPTION                                                                         | QTY       | RESET | REMOVE | REPLACE | TAX   | O&P    | TOTAL    |
|-------------------------------------------------------------------------------------|-----------|-------|--------|---------|-------|--------|----------|
| 97. 1/2" - drywall per LF - up to 2' tall                                           | 17.28 LF  |       | 0.00   | 12.79   | 2.11  | 44.62  | 267.74   |
| 98. Texture drywall - light texture                                                 | 43.20 SF  |       | 0.00   | 1.25    | 0.29  | 10.86  | 65.15    |
| Additional SF needed to blend in with surrounding texture                           |           |       |        |         |       |        |          |
| 99. Seal/prime (1 coat) then paint (2 coats) the walls                              | 205.17 SF |       | 0.00   | 1.76    | 5.42  | 73.30  | 439.82   |
| 100. Cold air return cover - Detach reset                                           | 1.00 EA   |       | 0.00   | 21.10   | 0.00  | 4.22   | 25.32    |
| 101. Baseboard - 3 1/4"                                                             | 7.28 LF   |       | 0.00   | 3.94    | 1.14  | 5.96   | 35.78    |
| 102. Seal (1 coat) & paint (1 coat) baseboard                                       | 22.11 LF  |       | 0.00   | 2.08    | 0.26  | 9.26   | 55.51    |
| 103. Paint door/window trim & jamb - 2 coats (per side)                             | 1.00 EA   |       | 0.00   | 43.15   | 0.46  | 8.74   | 52.35    |
| Paint door trim for Coat Closet in order to achieve a uniform repair with baseboard |           |       |        |         |       |        |          |
| 104. Carpet pad                                                                     | 37.05 SF  |       | 0.00   | 0.67    | 1.65  | 5.30   | 31.77    |
| 105. Carpet                                                                         | 42.61 SF  |       | 0.00   | 3.88    | 10.48 | 35.16  | 210.97   |
| 15 % waste added for Carpet.                                                        |           |       |        |         |       |        |          |
| 106. Final cleaning - construction Residential                                      | 37.05 SF  |       | 0.00   | 0.37    | 1.36  | 2.74   | 17.81    |
| Totals: Hallway                                                                     |           |       |        |         | 23.17 | 200.16 | 1,202.22 |

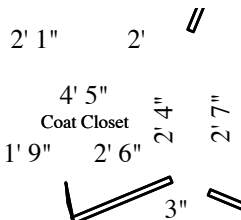

**Coat Closet**

**Height: 9'**

121.50 SF Walls  
131.81 SF Walls & Ceiling  
1.15 SY Flooring  
13.50 LF Ceil. Perimeter


10.31 SF Ceiling  
10.31 SF Floor  
13.50 LF Floor Perimeter

| DESCRIPTION         | QTY      | RESET | REMOVE | REPLACE | TAX  | O&P  | TOTAL |
|---------------------|----------|-------|--------|---------|------|------|-------|
| 107. R&R Carpet pad | 10.31 SF |       | 0.13   | 0.67    | 0.46 | 1.74 | 10.45 |



## CONTINUED - Coat Closet

| DESCRIPTION                                                                                                                   | QTY      | RESET | REMOVE | REPLACE | TAX  | O&P   | TOTAL  |
|-------------------------------------------------------------------------------------------------------------------------------|----------|-------|--------|---------|------|-------|--------|
| 108. Remove Carpet                           | 10.31 SF |       | 0.30   | 0.00    | 0.00 | 0.62  | 3.71   |
| 109. Carpet                                                                                                                   | 11.85 SF |       | 0.00   | 3.88    | 2.91 | 9.78  | 58.67  |
| Carpet is continuous with Hallway                                                                                             |          |       |        |         |      |       |        |
| 15 % waste added for Carpet.                                                                                                  |          |       |        |         |      |       |        |
| 110. Content Manipulation charge - per hour  | 1.00 HR  |       | 0.00   | 57.21   | 0.00 | 11.44 | 68.65  |
| Totals: Coat Closet                                                                                                           |          |       |        |         | 3.37 | 23.58 | 141.48 |

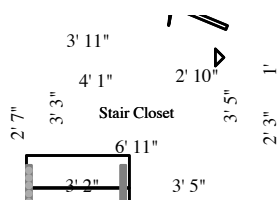

## Stair Closet


108.76 SF Walls  
134.48 SF Walls & Ceiling  
2.55 SY Flooring  
19.00 LF Ceil. Perimeter

Height: Sloped

25.72 SF Ceiling  
22.95 SF Floor  
17.67 LF Floor Perimeter

## Subroom: Room5 (1)

Height: 8'

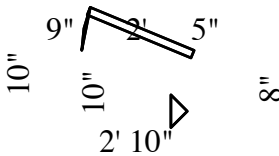

34.61 SF Walls  
36.50 SF Walls & Ceiling  
0.21 SY Flooring  
4.33 LF Ceil. Perimeter

1.88 SF Ceiling  
1.88 SF Floor  
4.33 LF Floor Perimeter

## Missing Wall


2' 9 15/16" X 8'

Opens into STAIR\_CLOSET

| DESCRIPTION                                                                                                                                        | QTY       | RESET | REMOVE | REPLACE | TAX   | O&P   | TOTAL  |
|----------------------------------------------------------------------------------------------------------------------------------------------------|-----------|-------|--------|---------|-------|-------|--------|
| 111. 1/2" - drywall per LF - up to 2' tall                                                                                                         | 4.67 LF   |       | 0.00   | 12.79   | 0.57  | 12.06 | 72.36  |
| 112. Texture drywall - light texture                            | 11.68 SF  |       | 0.00   | 1.25    | 0.08  | 2.94  | 17.62  |
| Additional SF needed to blend in with surrounding texture                                                                                          |           |       |        |         |       |       |        |
| 113. Seal/prime (1 coat) then paint (2 coats) the walls                                                                                            | 143.37 SF |       | 0.00   | 1.76    | 3.79  | 51.22 | 307.34 |
| 114. Baseboard - 3 1/4"                                                                                                                            | 4.67 LF   |       | 0.00   | 3.94    | 0.73  | 3.82  | 22.95  |
| 115. Seal (1 coat) & paint (1 coat) baseboard                                                                                                      | 22.00 LF  |       | 0.00   | 2.08    | 0.25  | 9.22  | 55.23  |
| 116. Door opening (jamb & casing) - 32"to36"wide - paint grade  | 1.00 EA   |       | 0.00   | 179.14  | 10.40 | 37.90 | 227.44 |
| 117. Seal & paint door/window trim & jamb - (per side)          | 2.00 EA   |       | 0.00   | 43.19   | 0.92  | 17.46 | 104.76 |

## CONTINUED - Stair Closet

| DESCRIPTION                                                                 | QTY      | RESET | REMOVE | REPLACE | TAX   | O&P    | TOTAL    |
|-----------------------------------------------------------------------------|----------|-------|--------|---------|-------|--------|----------|
| 118. Door hinges (set of 3) slab - Detach & reset                           | 1.00 EA  |       | 0.00   | 29.94   | 0.00  | 5.98   | 35.92    |
| Door hinges will need to be detached and reset to allow replacement of jamb |          |       |        |         |       |        |          |
| 119. On site door prep. for full mortised hinges - Labor only               | 1.00 EA  |       | 0.00   | 102.27  | 0.00  | 20.46  | 122.73   |
| 120. Interior door - Reset - slab only                                      | 1.00 EA  |       | 0.00   | 13.77   | 0.00  | 2.76   | 16.53    |
| 121. Paint door slab only (per side)                                        | 2.00 EA  |       | 0.00   | 50.56   | 1.45  | 20.52  | 123.09   |
| 122. Mask wall - plastic, paper, tape (per LF)                              | 23.33 LF |       | 0.00   | 1.74    | 0.52  | 8.22   | 49.33    |
| 123. Floor protection - plastic and tape - 10 mil                           | 4.83 SF  |       | 0.00   | 0.38    | 0.25  | 1.94   | 11.63    |
| 124. Carpet pad                                                             | 24.83 SF |       | 0.00   | 0.67    | 1.11  | 3.54   | 21.29    |
| 125. Carpet                                                                 | 28.56 SF |       | 0.00   | 3.88    | 7.02  | 23.56  | 141.39   |
| 15 % waste added for Carpet.                                                |          |       |        |         |       |        |          |
| 126. Content Manipulation charge - per hour                                 | 1.00 HR  |       | 0.00   | 57.21   | 0.00  | 11.44  | 68.65    |
| 127. Final cleaning - construction Residential                              | 24.83 SF |       | 0.00   | 0.37    | 0.91  | 1.84   | 11.94    |
| Totals: Stair Closet                                                        |          |       |        |         | 28.00 | 234.88 | 1,410.20 |

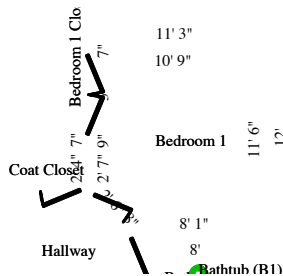

### Bedroom 1

386.52 SF Walls  
506.62 SF Walls & Ceiling  
13.35 SY Flooring  
42.95 LF Ceil. Perimeter


Height: 9'

120.11 SF Ceiling  
120.11 SF Floor  
42.95 LF Floor Perimeter

| DESCRIPTION                                                  | QTY       | RESET | REMOVE | REPLACE | TAX   | O&P    | TOTAL  |
|--------------------------------------------------------------|-----------|-------|--------|---------|-------|--------|--------|
| 128. Batt insulation replacement per LF - 4" - up to 2' tall | 2.67 LF   |       | 0.00   | 3.30    | 0.46  | 1.86   | 11.13  |
| 129. 1/2" - drywall per LF - up to 2' tall                   | 11.00 LF  |       | 0.00   | 12.79   | 1.34  | 28.40  | 170.43 |
| 130. Seal/prime (1 coat) then paint (2 coats) the walls      | 386.52 SF |       | 0.00   | 1.76    | 10.20 | 138.10 | 828.58 |
| 131. Outlet or switch cover                                  | 1.00 EA   |       | 0.00   | 3.69    | 0.08  | 0.76   | 4.53   |
| 132. Baseboard - 3 1/4"                                      | 11.00 LF  |       | 0.00   | 3.94    | 1.72  | 9.00   | 54.06  |
| 133. Seal (1 coat) & paint (1 coat) baseboard                | 42.95 LF  |       | 0.00   | 2.08    | 0.50  | 17.96  | 107.80 |
| 134. Door stop - wall or floor mounted                       | 1.00 EA   |       | 0.00   | 14.52   | 0.52  | 3.00   | 18.04  |

## CONTINUED - Bedroom 1

| DESCRIPTION                                                                             | QTY       | RESET | REMOVE | REPLACE | TAX   | O&P    | TOTAL    |
|-----------------------------------------------------------------------------------------|-----------|-------|--------|---------|-------|--------|----------|
| 135. Paint door/window trim & jamb - Large - 2 coats (per side)                         | 1.00 EA   |       | 0.00   | 50.75   | 0.54  | 10.26  | 61.55    |
| Paint closet door trim in order to achieve a uniform repair with baseboard              |           |       |        |         |       |        |          |
| 136. Door opening (jamb & casing) - 32"to36"wide - paint grade                          | 1.00 EA   |       | 0.00   | 179.14  | 10.40 | 37.90  | 227.44   |
| 137. Seal & paint door/window trim & jamb - (per side)                                  | 2.00 EA   |       | 0.00   | 43.19   | 0.92  | 17.46  | 104.76   |
| 138. Door hinges (set of 3) - Detach & reset                                            | 1.00 EA   |       | 0.00   | 29.94   | 0.00  | 5.98   | 35.92    |
| Door hinges will need to be detached and reset to allow replacement of jamb             |           |       |        |         |       |        |          |
| 139. On site door prep. for full mortised hinges - Labor only                           | 1.00 EA   |       | 0.00   | 102.27  | 0.00  | 20.46  | 122.73   |
| 140. Interior door - Reset - slab only                                                  | 1.00 EA   |       | 0.00   | 13.77   | 0.00  | 2.76   | 16.53    |
| 141. Paint door slab only - (per side)                                                  | 2.00 EA   |       | 0.00   | 50.56   | 1.45  | 20.52  | 123.09   |
| 142. Mask wall - plastic, paper, tape (per LF)                                          | 42.95 LF  |       | 0.00   | 1.74    | 0.96  | 15.14  | 90.83    |
| 143. Floor protection - plastic and tape - 10 mil                                       | 2.95 SF   |       | 0.00   | 0.38    | 0.42  | 3.34   | 20.08    |
| 144. Cold air return cover - Detach & reset                                             | 1.00 EA   |       | 0.00   | 21.10   | 0.00  | 4.22   | 25.32    |
| Cold air return cover will need to be detached and reset to allow for painting of walls |           |       |        |         |       |        |          |
| 145. Remove Carpet                                                                      | 98.61 SF  |       | 0.30   | 0.00    | 0.00  | 5.92   | 35.50    |
| Remove carpet that was not torn out during mitigation                                   |           |       |        |         |       |        |          |
| 146. Remove Carpet pad                                                                  | 98.61 SF  |       | 0.13   | 0.00    | 0.00  | 2.56   | 15.38    |
| Remove carpet pad that was not torn out during mitigation                               |           |       |        |         |       |        |          |
| 147. Carpet pad                                                                         | 120.11 SF |       | 0.00   | 0.67    | 5.35  | 17.18  | 103.00   |
| 148. Carpet                                                                             | 138.12 SF |       | 0.00   | 3.88    | 33.96 | 113.98 | 683.85   |
| Includes 15% waste                                                                      |           |       |        |         |       |        |          |
| 149. Content Manipulation charge - per hour                                             | 2.00 HR   |       | 0.00   | 57.21   | 0.00  | 22.88  | 137.30   |
| 150. Final cleaning - construction - Residential                                        | 120.11 SF |       | 0.00   | 0.37    | 4.40  | 8.88   | 57.72    |
| Totals: Bedroom 1                                                                       |           |       |        |         | 73.22 | 508.52 | 3,055.57 |

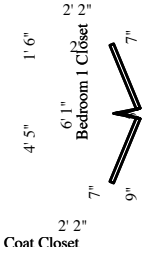


## Bedroom 1 Closet

Height: 9'

145.50 SF Walls  
157.67 SF Walls & Ceiling  
1.35 SY Flooring  
16.17 LF Ceil. Perimeter

12.17 SF Ceiling  
12.17 SF Floor  
16.17 LF Floor Perimeter

| DESCRIPTION                                 | QTY      | RESET | REMOVE | REPLACE | TAX  | O&P   | TOTAL  |
|---------------------------------------------|----------|-------|--------|---------|------|-------|--------|
| 151. R&R Carpet pad                         | 12.17 SF |       | 0.13   | 0.67    | 0.54 | 2.06  | 12.33  |
| 152. Remove Carpet                          | 12.17 SF |       | 0.30   | 0.00    | 0.00 | 0.74  | 4.39   |
| 153. Carpet                                 | 13.99 SF |       | 0.00   | 3.88    | 3.44 | 11.54 | 69.26  |
| Carpet is continuous with Bedroom 1         |          |       |        |         |      |       |        |
| 15 % waste added for Carpet.                |          |       |        |         |      |       |        |
| 154. Content Manipulation charge - per hour | 1.00 HR  |       | 0.00   | 57.21   | 0.00 | 11.44 | 68.65  |
| Totals: Bedroom 1 Closet                    |          |       |        |         | 3.98 | 25.78 | 154.63 |

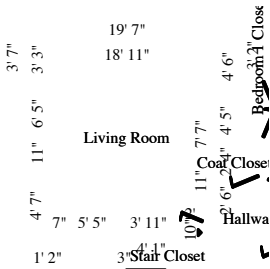

## Living Room

Height: 9'

482.95 SF Walls  
762.18 SF Walls & Ceiling  
31.03 SY Flooring  
57.18 LF Ceil. Perimeter


279.23 SF Ceiling  
279.23 SF Floor  
55.68 LF Floor Perimeter

|                                |                  |                     |
|--------------------------------|------------------|---------------------|
| Missing Wall                   | 4' 6 13/16" X 9' | Opens into Exterior |
| Missing Wall                   | 2' 8 1/2" X 9'   | Opens into Exterior |
| Missing Wall - Goes to Ceiling | 6' 5" X 6'       | Opens into Exterior |
| Missing Wall - Goes to Floor   | 2' 6" X 6' 8"    | Opens into HALLWAY  |
| Missing Wall - Goes to Floor   | 5' 5" X 6' 8"    | Opens into ENTRY    |

| DESCRIPTION                                             | QTY       | RESET | REMOVE | REPLACE | TAX   | O&P    | TOTAL    |
|---------------------------------------------------------|-----------|-------|--------|---------|-------|--------|----------|
| 155. 1/2" - drywall per LF - up to 2' tall              | 1.17 LF   |       | 0.00   | 12.79   | 0.14  | 3.02   | 18.12    |
| 156. Seal/prime (1 coat) then paint (2 coats) the walls | 482.95 SF |       | 0.00   | 1.76    | 12.75 | 172.56 | 1,035.30 |
| 157. Baseboard - 3 1/4"                                 | 1.17 LF   |       | 0.00   | 3.94    | 0.18  | 0.96   | 5.75     |
| 158. Seal (1 coat) & paint (1 coat) baseboard           | 55.68 LF  |       | 0.00   | 2.08    | 0.64  | 23.28  | 139.73   |
| 159. Mask wall - plastic, paper, tape (per LF)          | 57.18 LF  |       | 0.00   | 1.74    | 1.27  | 20.16  | 120.92   |

## CONTINUED - Living Room

| DESCRIPTION                                       | QTY       | RESET | REMOVE | REPLACE | TAX    | O&P    | TOTAL    |
|---------------------------------------------------|-----------|-------|--------|---------|--------|--------|----------|
| 160. Floor protection - plastic and tape - 10 mil | 5.68 SF   |       | 0.00   | 0.38    | 0.55   | 4.36   | 26.07    |
| 161. Window drapery - hardware Detach & reset     | 3.00 EA   |       | 0.00   | 35.25   | 0.00   | 21.16  | 126.91   |
| 162. R&R Carpet pad                               | 279.23 SF |       | 0.13   | 0.67    | 12.44  | 47.16  | 282.98   |
| 163. Remove Carpet                                | 279.23 SF |       | 0.30   | 0.00    | 0.00   | 16.76  | 100.53   |
| 164. Carpet                                       | 321.11 SF |       | 0.00   | 3.88    | 78.95  | 264.98 | 1,589.84 |
| Carpet is continuous with Hallway                 |           |       |        |         |        |        |          |
| 15 % waste added for Carpet.                      |           |       |        |         |        |        |          |
| 165. Content Manipulation charge - per hour       | 2.00 HR   |       | 0.00   | 57.21   | 0.00   | 22.88  | 137.30   |
| 166. Content Manipulation (Bid Item)              | 1.00 EA   |       | 0.00   | 0.00    | 0.00   | 0.00   | 0.00     |
| Bid item to remove and reset piano                |           |       |        |         |        |        |          |
| 167. Final cleaning - construction Residential    | 279.23 SF |       | 0.00   | 0.37    | 10.22  | 20.66  | 134.20   |
| Totals: Living Room                               |           |       |        |         | 117.14 | 617.94 | 3,717.65 |

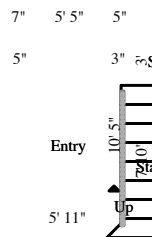

### Entry

Height: 9'

160.64 SF Walls  
223.64 SF Walls & Ceiling  
7.00 SY Flooring  
26.93 LF Ceil. Perimeter

63.00 SF Ceiling  
63.00 SF Floor  
21.51 LF Floor Perimeter

### Missing Wall

5' 11 3/16" X 9'


Opens into Exterior

### Missing Wall - Goes to Floor

5' 5" X 6' 8"

Opens into LIVING\_ROOM2

| DESCRIPTION                                 | QTY      | RESET | REMOVE | REPLACE | TAX   | O&P   | TOTAL  |
|---------------------------------------------|----------|-------|--------|---------|-------|-------|--------|
| 168. R&R Carpet pad                         | 63.00 SF |       | 0.13   | 0.67    | 2.81  | 10.64 | 63.85  |
| 169. Remove Carpet                          | 63.00 SF |       | 0.30   | 0.00    | 0.00  | 3.78  | 22.68  |
| 170. Carpet                                 | 72.45 SF |       | 0.00   | 3.88    | 17.81 | 59.78 | 358.70 |
| Carpet is continuous with Living Room       |          |       |        |         |       |       |        |
| 15 % waste added for Carpet.                |          |       |        |         |       |       |        |
| 171. Content Manipulation charge - per hour | 1.00 HR  |       | 0.00   | 57.21   | 0.00  | 11.44 | 68.65  |
| Totals: Entry                               |          |       |        |         | 20.62 | 85.64 | 513.88 |

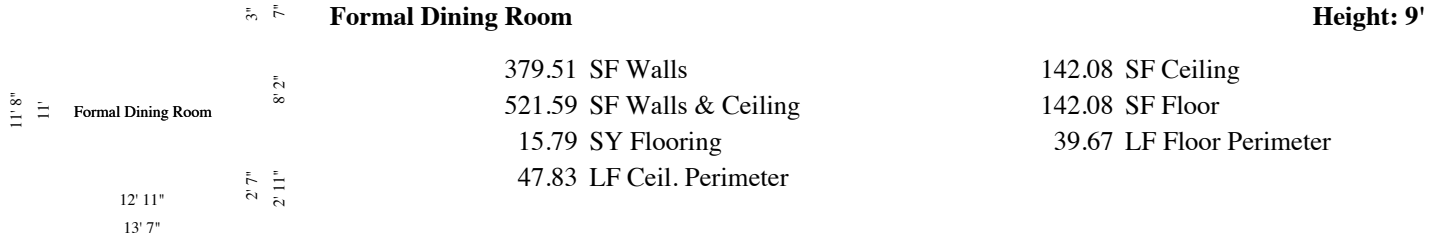

## Missing Wall - Goes to Floor

8' 2" X 6' 8"

Opens into Exterior

| DESCRIPTION                                                                            | QTY       | RESET | REMOVE | REPLACE | TAX    | O&P      | TOTAL     |
|----------------------------------------------------------------------------------------|-----------|-------|--------|---------|--------|----------|-----------|
| 172. R&R Carpet pad                                                                    | 142.08 SF |       | 0.13   | 0.67    | 6.33   | 24.00    | 143.99    |
| 173. Remove Carpet                                                                     | 142.08 SF |       | 0.30   | 0.00    | 0.00   | 8.52     | 51.14     |
| 174. Carpet                                                                            | 163.40 SF |       | 0.00   | 3.88    | 40.17  | 134.84   | 809.00    |
| Carpet is identical with that which is installed in Living Room, Hallway and Bedroom 1 |           |       |        |         |        |          |           |
| 15 % waste added for Carpet.                                                           |           |       |        |         |        |          |           |
| 175. Content Manipulation charge - per hour                                            | 1.00 HR   |       | 0.00   | 57.21   | 0.00   | 11.44    | 68.65     |
| Totals: Formal Dining Room                                                             |           |       |        |         | 46.50  | 178.80   | 1,072.78  |
| Total: Main Level                                                                      |           |       |        |         | 631.88 | 4,970.28 | 29,858.03 |

## Debris Removal

| DESCRIPTION                                                    | QTY     | RESET | REMOVE | REPLACE | TAX  | O&P   | TOTAL  |
|----------------------------------------------------------------|---------|-------|--------|---------|------|-------|--------|
| 176. Tandem axle dump trailer - per load - including dump fees | 1.00 EA |       | 385.00 | 0.00    | 0.00 | 77.00 | 462.00 |
| Totals: Debris Removal                                         |         |       |        |         | 0.00 | 77.00 | 462.00 |

## Labor Minimums Applied

| DESCRIPTION                                | QTY     | RESET | REMOVE | REPLACE | TAX  | O&P    | TOTAL  |
|--------------------------------------------|---------|-------|--------|---------|------|--------|--------|
| 177. Insulation labor minimum              | 1.00 EA |       | 0.00   | 130.72  | 0.00 | 26.14  | 156.86 |
| 178. Cabinetry labor minimum               | 1.00 EA |       | 0.00   | 67.15   | 0.00 | 13.44  | 80.59  |
| 179. Mirror/shower door minimum            | 1.00 EA |       | 0.00   | 93.59   | 0.00 | 18.72  | 112.31 |
| 180. Heat, vent, & air cond. labor minimum | 1.00 EA |       | 0.00   | 216.03  | 0.00 | 43.20  | 259.23 |
| 181. Window treatment repair               | 1.00 EA |       | 0.00   | 42.21   | 0.00 | 8.44   | 50.65  |
| Totals: Labor Minimums Applied             |         |       |        |         | 0.00 | 109.94 | 659.64 |



JDR Restoration & Remodeling

JDR Restoration & Remodeling  
- Home Re-Imagined -  
E: jdrrestoration.com

Line Item Totals:

631.88

5,157.22

30,979.67

Grand Total Areas:

|          |                    |          |                             |          |                        |
|----------|--------------------|----------|-----------------------------|----------|------------------------|
| 3,300.97 | SF Walls           | 1,202.89 | SF Ceiling                  | 4,503.86 | SF Walls and Ceiling   |
| 1,209.29 | SF Floor           | 134.37   | SY Flooring                 | 370.19   | LF Floor Perimeter     |
| 0.00     | SF Long Wall       | 0.00     | SF Short Wall               | 402.17   | LF Ceil. Perimeter     |
| 1,209.29 | Floor Area         | 1,311.28 | Total Area                  | 3,094.93 | Interior Wall Area     |
| 1,934.03 | Exterior Wall Area | 214.39   | Exterior Perimeter of Walls |          |                        |
| 0.00     | Surface Area       | 0.00     | Number of Squares           | 0.00     | Total Perimeter Length |
| 0.00     | Total Ridge Length | 0.00     | Total Hip Length            |          |                        |






## JDR Restoration & Remodeling

JDR Restoration & Remodeling  
- Home Re-Imagined -  
E: jdrrestoration.com

### Summary for Dwelling

|                               |                    |
|-------------------------------|--------------------|
| Line Item Total               | 25,190.57          |
| Material Sales Tax            | 586.16             |
| Cleaning Mtl Tax              | 8.81               |
| Subtotal                      | 25,785.54          |
| Overhead                      | 2,578.61           |
| Profit                        | 2,578.61           |
| Cleaning Sales Tax            | 36.91              |
| <b>Replacement Cost Value</b> | <b>\$30,979.67</b> |
| <b>Net Claim</b>              | <b>\$30,979.67</b> |



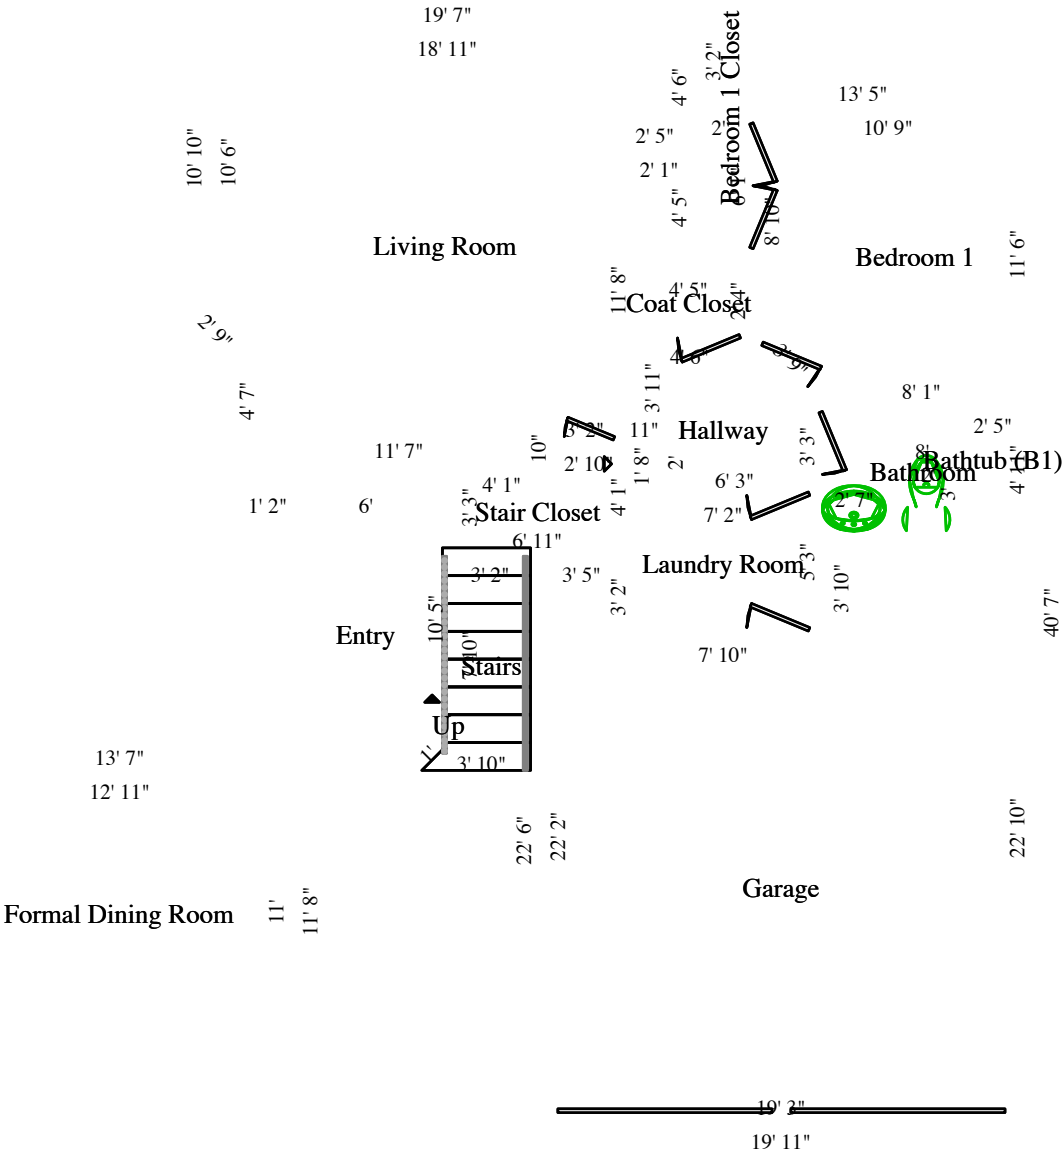

Main Level

## Ciridae — Comparison Summary

| Status     | Count      | Meaning                                                |
|------------|------------|--------------------------------------------------------|
| Green      | 4          | Exact match (scope + metadata within $\pm 2\%$ )       |
| Orange     | 101        | Same scope; metadata differs beyond $\pm 2\%$          |
| Blue       | 68         | JDR-only: not found in insurance estimate              |
| Nuggets    | 52         | Insurance-only: present in insurer's scope, not in JDR |
| Dollar gap | \$1,126.44 | JDR total \$17,671.85 vs Insurance \$18,798.29         |

### Insurance-Only Items (Nuggets)

These items appear in the insurance estimate but are absent from the JDR. JDR can often add them directly since the insurer has already agreed to them.

| Room (Insurance)            | Description                                                                 | Amount     |
|-----------------------------|-----------------------------------------------------------------------------|------------|
| APPLIANCES                  | Detach & Reset Washer/Washing Machine - Front-loading                       | \$71.64    |
| APPLIANCES                  | Freezer - Remove & reset                                                    | \$73.64    |
| Bedroom - TRIM/DOORS        | Baseboard - 3 1/4" MDF w/profile                                            | \$67.01    |
| Bedroom - TRIM/DOORS        | Paint baseboard - two coats (For replace baseboard)                         | \$33.82    |
| CABINETY                    | Cabinetry labor minimum                                                     | \$83.35    |
| CARPET                      | 79. Carpet pad - per specs from independent pad analysis                    | \$6.20     |
| CARPET                      | 80. Carpet - per specs from independent carpet analysis                     | \$270.51   |
| CARPET                      | Carpet - per specs from independent carpet analysis                         | \$395.56   |
| CARPET                      | Carpet pad - per specs from independent pad analysis                        | \$27.83    |
| CLEANING                    | Cleaning labor minimum                                                      | \$152.87   |
| CONDITION DEP %             | 77. Contents - move out then reset - Small room                             | \$75.62    |
| CONTENT MANIPULATION        | Contents - move out then reset - Large room                                 | \$151.10   |
| CONTENT MANIPULATION        | Contents - move out then reset - Large room (Grand Piano is in Living Room) | \$151.10   |
| CONTENT MANIPULATION        | Contents - move out then reset - Small room                                 | \$75.62    |
| DRYWALL                     | 1/2" drywall - hung, taped, floated, ready for paint (Tub Surround)         | \$240.74   |
| DRYWALL                     | 1/2" water rock (greenboard) hung, taped ready for texture (Tub Surround)   | \$224.11   |
| DRYWALL                     | Tape joint for new to existing drywall - per LF                             | \$1,116.72 |
| DRYWALL                     | Texture drywall - light hand texture                                        | \$377.01   |
| DRYWALL                     | Texture drywall - light hand texture                                        | \$117.61   |
| FINISH CARPENTRY / TRIMWORK | Baseboard - 3 1/4" MDF w/profile                                            | \$368.45   |
| FINISH CARPENTRY / TRIMWORK | Detach & Reset Shelving - 12" - in place                                    | \$72.26    |

|                                |                                                                           |            |
|--------------------------------|---------------------------------------------------------------------------|------------|
| FINISH CARPENTRY / TRIMWORK    | Door opening (jamb & casing) - 32"to36"wide - paint grade                 | \$909.44   |
| FLOOR COVERING - CARPET        | Carpet - per specs from independent carpet analysis                       | \$5,344.48 |
| FLOOR COVERING - CARPET        | Remove Carpet                                                             | \$6.01     |
| FLOOR COVERING - CARPET        | Remove Carpet (Some carpet and pad was removed by mitigation company)     | \$163.00   |
| Garage                         | Baseboard - 3 1/4" MDF w/profile                                          | \$81.35    |
| Garage                         | Freezer - Remove & reset                                                  | \$73.64    |
| Garage                         | Paint baseboard - two coats (For replace baseboard)                       | \$41.06    |
| Hall Bathroom                  | 1/2" water rock (greenboard) hung, taped ready for texture (Tub Surround) | \$224.11   |
| Hall Bathroom                  | Baseboard - 3 1/4" MDF w/profile                                          | \$68.57    |
| Hall Bathroom                  | Ceramic/porcelain tile (Tub Surround)                                     | \$1,008.74 |
| Hall Bathroom                  | Install Bathtub                                                           | \$631.71   |
| Hall Bathroom                  | Interior door - Reset - slab only                                         | \$16.51    |
| Hall Bathroom                  | Tape joint for new to existing drywall - per LF                           | \$263.26   |
| Laundry Room                   | Floor leveling cement - Average                                           | \$118.10   |
| Main Level                     | Haul debris - per pickup truck load - including dump fees                 | \$288.60   |
| Maximum Additional Amounts ... | General Contractor O&P; on Depreciation                                   | \$166.50   |
| Offset                         | 1/2" - drywall per LF - up to 2' tall                                     | \$108.14   |
| Offset                         | Paint the walls - one coat                                                | \$217.03   |
| Offset                         | Texture drywall - light hand texture                                      | \$42.22    |
| PAINTING                       | Paint baseboard - two coats (For replace baseboard)                       | \$187.22   |
| PAINTING                       | Paint {V} - one coat                                                      | \$2,480.48 |
| PAINTING                       | Seal & paint wood shelving, 12"- 24" width                                | \$52.46    |
| Summary for Dwelling           | General Contractor Overhead @ 10.0% x 6,105.10                            | \$610.51   |
| TILE                           | Ceramic/porcelain tile (Tub Surround)                                     | \$1,008.74 |
| TRIM/DOORS                     | * Paint baseboard - two coats (For replace baseboard)                     | \$59.59    |
| TRIM/DOORS                     | Baseboard - 3 1/4" MDF w/profile                                          | \$118.03   |
| TRIM/DOORS                     | Baseboard - 3 1/4" MDF w/profile                                          | \$33.49    |
| TRIM/DOORS                     | Paint baseboard - two coats (For replace baseboard)                       | \$16.91    |
| WALLS                          | 81. Tape joint for new to existing drywall - per LF                       | \$95.32    |
| WALLS                          | Seal & paint wood shelving, 12"- 24" width                                | \$52.46    |
| WALLS                          | Tape joint for new to existing drywall - per LF                           | \$335.97   |