



JDR Restoration & Remodeling

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Insured: [REDACTED]
Property: [REDACTED]
[REDACTED]

Home: [REDACTED]
E-mail: [REDACTED]

Contractor: [REDACTED]
Company: JDR Restoration & Remodeling
Business: [REDACTED]
[REDACTED]

Business: [REDACTED]
E-mail: [REDACTED]



Claim Number: [REDACTED]

Policy Number: [REDACTED]

Type of Loss: Water Damage

Date of Loss:
Date Inspected: 9/19/2024 11:40 AM

Date Received:
Date Entered: 9/24/2024 1:13 PM


Price List: [REDACTED]
Restoration/Service/Remodel
Estimate: [REDACTED]
[REDACTED]



Main Level

Main Level

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
Job setup, safety and administration							
1. Residential Supervision / Project Management - per hour	20.00 HR		0.00	75.50	0.00	302.00	1,812.00
Estimated 2 hrs/day, 5 days/wk, for 5 weeks. Supervisor is responsible for budget creating and management, trade scheduling, ordering materials, working with named insured to select finishes, ensuring timely completion of project, and overall job quality.							
From Xactimate: Includes: Hourly labor rate for residential supervision/project management. Note: This is for a Superintendent/Proj. Manager used to manage residential jobs where formal Supervision/Proj. Management is needed to coordinate the work of subcontractors, or to perform other project management duties. This item should not be used for a working crew leader. The GC, estimator and/or parties involved will determine whether or not the use of a formal Superintendent/Proj. Manager is warranted, as well as the number of hours required to perform these tasks. A Superintendent/Proj. Manager generally manages multiple jobs at once. Generally, a typical single-family detached rebuild or new build would have a minimal amount of hours per weekday. In some cases, such as large multi-family/multi-unit/multi-bldg projects a full-time formal supervisor may be warranted. A Superintendent/Proj. Manager may complete tasks such as, but not limited to, creating/maintaining project schedules, coordinating/meeting trades, ordering materials, inspecting job sites, obtaining permits, meeting with inspectors, etc.							
2. Megohmmeter check electrical circuits - average residence	1.00 EA		0.00	982.42	0.00	196.48	1,178.90
Necessary to check electrical system to insure it is safe for occupants							
3. Respirator - 1/2" face - multi-purpose resp. (per day)	2.00 DA		0.00	1.67	0.00	0.66	4.00
2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming							
4. Respirator cartridge - A only (per pair)	2.00 EA		0.00	16.92	2.79	7.32	43.95
2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming							
5. Add for HEPA filter (for canister/backpack vacuums)	1.00 EA		0.00	89.91	6.02	19.18	115.11
Total: Main Level					8.81	525.64	3,153.96

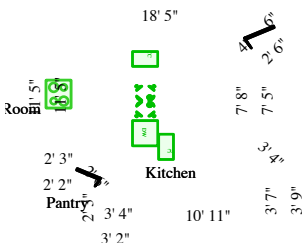

Kitchen

Height: 9'

239.85 SF Walls
493.17 SF Walls & Ceiling
20.04 SY Flooring
40.10 LF Ceil. Perimeter


253.32 SF Ceiling
180.40 SF Floor
22.60 LF Floor Perimeter

Missing Wall

18' 5 3/16" X 9'

Opens into FAMILY_ROOM

CONTINUED - Kitchen

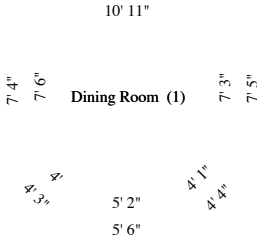

Subroom: Dining Room (1)

Height: 9'

252.64 SF Walls
355.48 SF Walls & Ceiling
11.43 SY Flooring
28.07 LF Ceil. Perimeter

102.83 SF Ceiling
102.83 SF Floor
28.07 LF Floor Perimeter

Missing Wall

10' 11" X 9'

Opens into KITCHEN

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
6. Batt insulation R30 - paper / foil faced	121.47 SF		0.00	2.14	15.63	55.12	330.70
Allowance to replace insulation on exterior-facing walls							
7. 1/2" - 1" wall per LF - up to 2' tall	60.73 LF		0.00	12.80	7.42	156.94	941.70
8. Texture drywall both / skim coat	411.54 SF		0.00	1.86	4.41	153.98	923.85
9. Seal/prime (1 coat) then paint (2 coats) the surface area	411.54 SF		0.00	1.75	10.86	146.22	877.28
10. Window blind - horizontal or vertical - Detach & reset	4.00 EA		0.00	38.72	0.00	30.98	185.86
Blinds on three windows and one door will need to be detached and reset to allow for painting of window openings and door slab							
11. Crown molding - 1"	7.00 LF		0.00	5.42	1.47	7.88	47.29
12. Paint crown molding - two coats	68.17 LF		0.00	2.10	1.01	28.84	173.01
13. Custom cabinets - 19 units	19.00 LF		0.00	274.89	359.47	1,116.48	6,698.86
Island cabinet measures 9.5 LF x 4.83 LF and was custom built by Fricks Custom Cabinets. Price may be updated when bid to replace it has been received from the mfr.							
14. Toe kick - finished wood - 1/2"	28.66 LF		0.00	8.69	8.39	51.50	308.95
15. Custom cabinets - full height units	3.33 LF		0.00	405.11	95.45	288.90	1,733.37
Replace full height cabinet for refrigerator							
16. Sand wood - 184.65 SF	184.65 SF		0.00	6.66	1.98	246.36	1,478.11
Prep new island, upper cabinets, lower cabinets and full height cabinets for paint							
17. Seal & prime cabinetry - lower - inside and out	28.66 LF		0.00	62.37	12.37	359.98	2,159.87
Paint new island cabinet							
18. Seal & prime cabinetry - lower - faces only	7.58 LF		0.00	36.23	1.96	55.32	331.90
Paint existing lower cabinets in order to achieve a uniform repair with new full height cabinet							
19. Seal & prime cabinetry - upper - faces only	7.58 LF		0.00	31.54	1.65	48.16	288.88
Paint existing upper cabinets in order to achieve a uniform repair with new full height cabinet							

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Kitchen

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
20. Seal & paint full height cabinetry - inside and out	3.33 LF		0.00	73.47	2.66	49.48	296.80
Paint new full height cabinet around refrigerator							
21. Seal & paint full height cabinetry - faces only	2.58 LF		0.00	38.92	0.76	20.24	121.41
Paint existing full height cabinet in order to achieve a uniform appearance with new full height cabinet							
22. Cabinet knobs & pulls - Detach & reset	26.00 EA		0.00	2.64	0.00	13.72	82.36
23. Detach & reset Countertop - Granite or Marble	45.89 SF	35.05	0.00	0.00	0.42	321.76	1,930.62
Island countertop will need to be detached and reset to allow for replacement of cabinet							
24. Outlet or switch - Detach & reset	3.00 EA		0.00	22.81	0.00	13.68	82.11
Electrical outlets will need to be detached and reset to allow for replacement of island cabinet							
25. Detach & reset Sink - double basin	1.00 EA	198.89	0.00	0.00	0.09	39.80	238.78
26. Sink faucet - Detach & reset	1.00 EA		0.00	148.48	0.00	29.70	178.18
27. Detach & reset P-trap assembly - ABS (plastic)	1.00 EA	74.00	0.00	0.00	0.00	14.80	88.80
28. Plumbing fixture supply line	2.00 EA		0.00	24.05	1.19	9.86	59.15
29. Angle stop valve	2.00 EA		0.00	46.12	2.06	18.86	113.16
30. Garbage disposal / disposer - Detach & reset	1.00 EA		0.00	198.39	0.00	39.68	238.07
31. Dishwasher - Detach & reset	1.00 EA		0.00	289.40	0.00	57.88	347.28
32. Trash compactor - Detach & reset	1.00 EA		0.00	127.51	0.00	25.50	153.01
33. Wine cooler - Detach & reset	1.00 EA		0.00	127.51	0.00	25.50	153.01
34. Built-in oven - Detach & reset	3.00 EA		0.00	254.83	0.00	152.90	917.39
Two built-in ovens and one built-in microwave will need to be detached and reset to allow for painting of full height cabinet							
35. Concrete grinding	322.84 SF		0.00	3.88	0.00	250.52	1,503.14
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
36. HEPA Vacuuming - (PER SF)	322.84 SF		0.00	0.49	15.66	31.64	205.49

HEPA vacuum as required by OSHA

<https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153>

(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

OR

Use machine equipped with dust collection system recommended by the manufacturer

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism


When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Kitchen

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
37. Floor leveling - Average	322.84 SF		0.00	2.41	33.56	162.32	973.92
38. Engineered wood flooring - specs from independent analysis	322.84 SF		0.00	13.59	277.26	932.94	5,597.60
39. Add for glue down wood flooring application over concrete	322.84 SF		0.00	1.29	29.56	89.22	535.24
40. Baseboard - 4 1/4"	60.73 LF		0.00	4.81	13.38	61.10	366.59
41. Quarter round	60.73 LF		0.00	1.99	5.36	25.26	151.47
42. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	60.73 LF		0.00	2.45	1.40	30.04	180.23
43. Door stop - for floor mounted	1.00 EA		0.00	15.33	0.52	3.16	19.01
44. Casing - 2 1/4"	14.00 LF		0.00	2.51	1.66	7.36	44.16
45. Paint door/window jamb - 2 coats (per side)	2.00 EA		0.00	43.21	0.92	17.46	104.80
Paint door opening(s) in order to achieve a uniform appearance with baseboard							
46. Prime & paint door slab only - exterior (per side)	1.00 EA		0.00	60.35	1.31	12.34	74.00
Paint door slab(s) in order to achieve a uniform appearance with door opening(s) and baseboard							
47. Exterior door - detach & reset	1.00 EA		0.00	149.65	0.57	30.06	180.28
Door will need to be detached and reset to allow painting of slab							
48. Detach & reset door hinges (set of 3)	1.00 EA	32.88	0.00	0.00	0.00	6.58	39.46
Door hinges will need to be detached and reset to allow painting of door slab							
49. Door knob/lockset - detach & reset	1.00 EA		0.00	25.84	0.00	5.16	31.00
Door knob will need to be detached and reset to allow painting of door slab							
50. Mask wall - plastic, paper, tape (per LF)	68.17 LF		0.00	1.74	1.52	24.02	144.16
51. Floor protection - plastic and tape - 10 mil	322.84 SF		0.00	0.39	3.20	25.82	154.93
52. Dishwasher - detach & reset	1.00 EA		0.00	289.40	0.00	57.88	347.28
53. Refrigerator - detach & reset	1.00 EA		0.00	61.64	0.00	12.32	73.96
54. Final cleaning - Residential	322.84 SF		0.00	0.37	11.82	23.90	155.17
Totals: Kitchen					926.95	5,389.12	32,361.65

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

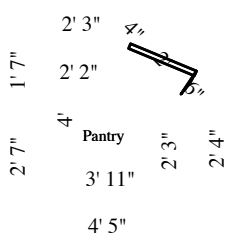

Pantry

Height: 10'


147.95 SF Walls
162.04 SF Walls & Ceiling
1.57 SY Flooring
14.79 LF Ceil. Perimeter

14.09 SF Ceiling
14.09 SF Floor
14.79 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
55. Batt insulation removal per LF - 4" - up to 2' tall	4.92 LF		0.00	3.31	0.85	3.44	20.58
Allowance to replace insulation on exterior-facing walls							
56. 1/2" - 1" insulation per LF - up to 2' tall	15.56 LF		0.00	12.80	1.90	40.22	241.29
57. Texture drywall both / skim coat	147.95 SF		0.00	1.86	1.59	55.36	332.14
58. Seal/prime (1 coat) then paint (2 coats) the walls	147.95 SF		0.00	1.75	3.91	52.56	315.38
59. Seal & prime closet shelving - pantry	1.00 EA		0.00	122.19	1.31	24.70	148.20
60. Concrete grinding	14.37 SF		0.00	3.88	0.00	11.16	66.92
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
61. HEPA Vacuuming - (PER SF)	14.37 SF		0.00	0.49	0.70	1.40	9.14
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
62. Floor leveling - Average	14.37 SF		0.00	2.41	1.49	7.22	43.34
63. Engineered wood flooring - specs from independent analysis	14.37 SF		0.00	13.59	12.34	41.52	249.15
64. Add for sanding down wood flooring application over concrete	14.37 SF		0.00	1.29	1.32	3.96	23.82
65. Baseboard - 4 1/4"	15.56 LF		0.00	4.81	3.43	15.64	93.91
66. Quarter round	15.56 LF		0.00	1.99	1.37	6.48	38.81
67. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	15.56 LF		0.00	2.45	0.36	7.70	46.18
68. Door opening (1" x 6" & casing) - up to 32" wide - paint grade	1.00 EA		0.00	163.03	9.93	34.58	207.54

CONTINUED - Pantry

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
69. Door jamb s (open-on / close-off)	1.00 EA		0.00	87.16	1.73	17.78	106.67
70. On site prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
71. Seal & floor/window trim & jamb - (per side)	2.00 EA		0.00	42.52	0.91	17.18	103.13
72. Paint door s only - 2 coats (per side)	2.00 EA		0.00	49.92	1.45	20.26	121.55
73. Detach & Door hinges (set of 3)	1.00 EA	32.88	0.00	0.00	0.00	6.58	39.46
Door hinges will need to be detached and reset to allow for painting of slab							
74. Detach & Door knob - interior	1.00 EA	25.84	0.00	0.00	0.00	5.16	31.00
Door knob will need to be detached and reset to allow for painting of slab							
75. Interior door - slab only	1.00 EA		0.00	13.83	0.00	2.76	16.59
76. Mask wall - ic, paper, tape (per LF)	15.56 LF		0.00	1.74	0.35	5.50	32.92
77. Floor protection - ic and tape - 10 mil	14.37 SF		0.00	0.39	0.14	1.14	6.88
78. Final cleaning - truction - Residential	14.37 SF		0.00	0.37	0.53	1.06	6.91
Totals: Pantry					45.61	403.82	2,424.24

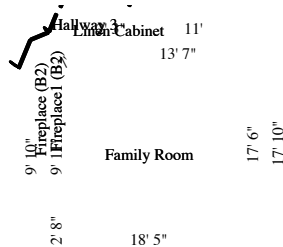

Family Room

Height: 9'

253.32 SF Walls
567.53 SF Walls & Ceiling
29.97 SY Flooring
43.91 LF Ceil. Perimeter

314.21 SF Ceiling
269.70 SF Floor
21.12 LF Floor Perimeter

Missing Wall

6' 11 5/8" X 9'

Opens into HALLWAY_3

Missing Wall - Goes to Floor

2' 8" X 6' 8"

Opens into FORMAL_LIVIN

Missing Wall

18' 5 3/16" X 9'

Opens into KITCHEN

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
79. Batt insulation R30 - paper / foil faced	98.84 SF		0.00	2.14	12.72	44.84	269.08
Allowance to replace insulation on exterior-facing walls							
80. 1/2" - wall per LF - up to 2' tall	49.42 LF		0.00	12.80	6.03	127.72	766.33
81. Texture drywall both / skim coat	358.69 SF		0.00	1.86	3.85	134.22	805.23

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com


CONTINUED - Family Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
82. Seal/prime (1 coat) then paint (2 coats) the surface area	358.69 SF		0.00	1.75	9.47	127.44	764.62
83. Window blind - horizontal or vertical - Detach & reset	4.00 EA		0.00	38.72	0.00	30.98	185.86
Blinds will need to be detached and reset to allow for painting of window openings							
84. Outlet or switch cover	4.00 EA		0.00	3.70	0.31	3.02	18.13
85. Paint crown molding - one coat	43.91 LF		0.00	1.40	0.51	12.40	74.38
Crown molding is continuous with Kitchen							
86. Paint brick	201.69 SF		0.00	1.02	4.49	42.04	252.25
Paint fireplace and hearth							
87. Concrete grinding	269.70 SF		0.00	3.88	0.00	209.28	1,255.72
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
88. HEPA Vacuuming - (PER SF)	269.70 SF		0.00	0.49	13.08	26.44	171.67
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
89. Floor leveling compound - Average	269.70 SF		0.00	2.41	28.04	135.60	813.62
90. Engineered wood flooring - specs from independent analysis	269.70 SF		0.00	13.59	231.63	779.36	4,676.21
91. Add for glue down wood flooring application over concrete	269.70 SF		0.00	1.29	24.70	74.52	447.13
92. Baseboard - 4 1/4"	49.42 LF		0.00	4.81	10.89	49.72	298.32
93. Quarter round	49.42 LF		0.00	1.99	4.36	20.56	123.27
94. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	49.42 LF		0.00	2.45	1.14	24.44	146.66
95. Cabinetry - (base) units - Reset	15.00 LF		0.00	42.08	0.00	126.24	757.44
96. Countertop - surface/granite - Reset	18.00 SF		0.00	15.13	0.16	54.50	327.00
97. Stain & finish cabinetry - lower - faces only	9.00 LF		0.00	51.48	4.19	93.50	561.01
98. Stain & finish cabinetry - upper - faces only	4.08 LF		0.00	44.22	1.59	36.40	218.41

Stain upper cabinets in order to achieve a uniform appearance with lower cabinets

CONTINUED - Family Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
99. Entertainment center unit - Reset	10.75 LF		0.00	41.93	0.00	90.16	540.91
100. Stain & finish entertainment center - full height unit - inside and out	10.75 LF		0.00	121.31	13.19	263.46	1,580.73
101. Mask wall - plastic, paper, tape (per LF)	43.91 LF		0.00	1.74	0.98	15.48	92.86
102. Floor protection - plastic and tape - 10 mil	269.70 SF		0.00	0.39	2.67	21.58	129.43
103. Final cleaning - Residential	269.70 SF		0.00	0.37	9.88	19.96	129.63
Totals: Family Room					383.88	2,563.86	15,405.90

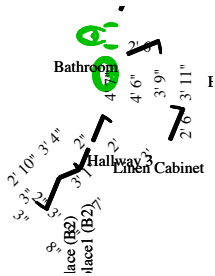

Hallway 3

Height: 9'

228.86 SF Walls
285.94 SF Walls & Ceiling
6.34 SY Flooring
27.65 LF Ceil. Perimeter

57.08 SF Ceiling
57.08 SF Floor
24.65 LF Floor Perimeter

Missing Wall - Goes to Floor

3' X 6' 8"

Opens into FORMAL_LIVIN

Missing Wall

6' 11 5/8" X 9'

Opens into FAMILY_ROOM

Missing Wall

3' X 9'

Opens into LINEN_CABINE

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
104. 1/2" - 1" wall per LF - up to 2' tall	32.79 LF		0.00	12.80	4.00	84.74	508.45
105. Texture drywall - both / skim coat	272.33 SF		0.00	1.86	2.92	101.88	611.33
106. Seal/prime (1 coat) then paint (2 coats) the surface area	272.33 SF		0.00	1.75	7.19	96.76	580.53
107. Paint crown molding - one coat	27.65 LF		0.00	1.40	0.32	7.80	46.83
Crown molding is continuous with Kitchen							
108. Concrete grinding	59.81 SF		0.00	3.88	0.00	46.42	278.48
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
109. HEPA Vacuuming - (PER SF)	59.81 SF		0.00	0.49	2.90	5.86	38.07

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Hallway 3

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
110. Floor leveling compound - Average	59.81 SF		0.00	2.59	6.22	32.22	193.35
111. Tile floor leveling - High grade	59.81 SF		0.00	13.53	38.88	169.62	1,017.73
112. Grout sealer	59.81 SF		0.00	1.22	0.94	14.78	88.69
113. T- molding - wood flooring	15.00 LF		0.00	7.80	8.71	25.14	150.85
114. Baseboard - 4	32.79 LF		0.00	4.81	7.22	32.98	197.92
115. Quarter round	32.79 LF		0.00	1.99	2.89	13.64	81.78
116. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	32.79 LF		0.00	2.45	0.76	16.22	97.32
117. Door opening (1) & casing) - 32"to36"wide - paint grade	1.00 EA		0.00	179.36	10.40	37.96	227.72
Replace door jamb in opening between sections of Hallway 3							
118. Casing -	34.00 LF		0.00	2.51	4.04	17.86	107.24
Replace casing on outside of door to Bedroom 1 and Laundry Room							
119. Paint door/window jamb - 2 coats (per side)	7.00 EA		0.00	43.21	3.21	61.14	366.82
120. Paint door/window jamb - Large - 2 coats (per side)	1.00 EA		0.00	50.82	0.54	10.26	61.62
Paint door opening(s) in order to achieve a uniform appearance with baseboard							
121. Prime & paint door slab only - exterior (per side)	3.00 EA		0.00	60.35	3.92	37.00	221.97
Paint door slab(s) in order to achieve a uniform appearance with door opening(s) and baseboard							
122. Exterior door jamb & reset	3.00 EA		0.00	149.65	1.72	90.14	540.81
Door will need to be detached and reset to allow painting of slab							
123. Detach & reset door hinges (set of 3)	3.00 EA	32.88	0.00	0.00	0.00	19.72	118.36
Door hinges will need to be detached and reset to allow painting of door slab							
124. Door knob/lockset & reset	3.00 EA		0.00	25.84	0.00	15.50	93.02
Door knob will need to be detached and reset to allow painting of door slab							
125. Mask wall fabric, paper, tape (per LF)	27.65 LF		0.00	1.74	0.62	9.74	58.47

CONTINUED - Hallway 3

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
126. Floor protection - 10 mil	59.81 SF		0.00	0.39	0.59	4.78	28.70
127. Final cleaning - Residential	59.81 SF		0.00	0.37	2.20	4.42	28.75
Totals: Hallway 3					110.19	956.58	5,744.81



Linen Cabinet

Height: 9'




28.94 SF Walls	2.25 SF Ceiling
31.19 SF Walls & Ceiling	0.17 SF Floor
0.02 SY Flooring	0.50 LF Floor Perimeter
4.57 LF Ceil. Perimeter	

Missing Wall

3' X 9'

Opens into HALLWAY_3

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
128. Shelving - 1 unit	3.00 LF		0.00	8.66	0.01	5.20	31.19
Reset two shelves including one on bottom							
129. Seal & reset closet shelving - linen closet	1.00 EA		0.00	122.19	1.31	24.70	148.20
130. Cabinetry - full height unit - Reset	2.75 LF		0.00	41.93	0.00	23.06	138.37
Reset cabinet face							
131. Seal & reset full height cabinetry - faces only	2.75 LF		0.00	38.92	0.81	21.56	129.40
132. Cabinet knobs - 3 units - Detach & reset	3.00 EA		0.00	2.64	0.00	1.58	9.50
Totals: Linen Cabinet					2.13	76.10	456.66

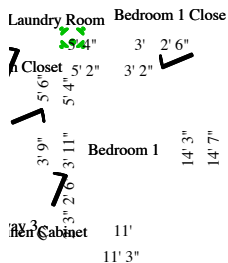

Bedroom 1

Height: 9'

454.50 SF Walls	156.75 SF Ceiling
611.25 SF Walls & Ceiling	156.75 SF Floor
17.42 SY Flooring	50.50 LF Floor Perimeter
50.50 LF Ceil. Perimeter	

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
133. Paint the walls - two coats	454.50 SF		0.00	1.29	9.75	119.22	715.28

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com


CONTINUED - Bedroom 1

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
134. Window blind - horizontal or vertical - Detach & reset	1.00 EA		0.00	38.72	0.00	7.74	46.46
Blinds will need to be detached and reset to allow for painting of window openings							
135. Concrete grinding	156.75 SF		0.00	3.88	0.00	121.64	729.83
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
136. HEPA Vacuuming - (PER SF)	156.75 SF		0.00	0.49	7.61	15.36	99.78
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
137. Floor leveling - Average	156.75 SF		0.00	2.41	16.29	78.82	472.88
138. Engineered wood flooring - specs from independent analysis	156.75 SF		0.00	13.59	134.62	452.96	2,717.81
139. Add for glue down wood flooring application over concrete	156.75 SF		0.00	1.29	14.35	43.32	259.88
140. Baseboard - 4	50.50 LF		0.00	4.81	11.12	50.80	304.83
141. Quarter round	50.50 LF		0.00	1.99	4.46	21.00	125.96
142. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	50.50 LF		0.00	2.45	1.17	24.98	149.88
143. Door stop - floor mounted	1.00 EA		0.00	15.33	0.52	3.16	19.01
144. Seal & paint floor/window trim & jamb - (per side)	1.00 EA		0.00	42.52	0.45	8.60	51.57
145. Paint door - only - 2 coats (per side)	2.00 EA		0.00	49.92	1.45	20.26	121.55
146. Detach & reset Door hinges (set of 3)	1.00 EA	32.88	0.00	0.00	0.00	6.58	39.46
Door hinges will need to be detached and reset to allow for painting of slab							
147. Detach & reset Door knob - interior	1.00 EA	25.84	0.00	0.00	0.00	5.16	31.00
Door knob will need to be detached and reset to allow for painting of slab							
148. Interior door - slab only	1.00 EA		0.00	13.83	0.00	2.76	16.59
149. Mask wall - paper, tape (per LF)	50.50 LF		0.00	1.74	1.13	17.80	106.80
150. Floor protection - 10 mil	156.75 SF		0.00	0.39	1.55	12.54	75.22

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Bedroom 1

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
151. Final cleaning - Instruction - Residential	156.75 SF		0.00	0.37	5.75	11.60	75.35
Totals: Bedroom 1					210.22	1,024.30	6,159.14

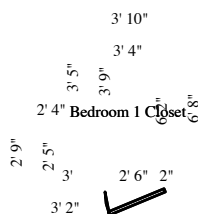

Bedroom 1 Closet

Height: 9'

213.00	SF Walls	26.19	SF Ceiling
239.19	SF Walls & Ceiling	26.19	SF Floor
2.91	SY Flooring	23.67	LF Floor Perimeter
23.67	LF Ceil. Perimeter		

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
152. Paint the walls and ceiling - two coats	213.00 SF		0.00	1.29	4.57	55.88	335.22
153. Concrete grinding	26.19 SF		0.00	3.88	0.00	20.32	121.94
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
154. HEPA Vacuuming - (PER SF)	26.19 SF		0.00	0.49	1.27	2.56	16.66

HEPA vacuum as required by OSHA

<https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153>

(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

OR

Use machine equipped with dust collection system recommended by the manufacturer

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions


2. The unit must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism

When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes

155. Floor leveling compound - Average	26.19 SF	0.00	2.41	2.72	13.16	79.00
156. Engineered wood flooring - specs from independent analysis	26.19 SF	0.00	13.59	22.49	75.68	454.09
157. Add for glue down wood flooring application over concrete	26.19 SF	0.00	1.29	2.40	7.24	43.43
158. Baseboard - 4" x 6" x 1/2"	23.67 LF	0.00	4.81	5.21	23.82	142.88
159. Quarter round - 1/2" x 1" x 1/4"	23.67 LF	0.00	1.99	2.09	9.84	59.03
160. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	23.67 LF	0.00	2.45	0.55	11.72	70.26
161. Door stop - 1" x 1" x 1/2" for floor mounted	1.00 EA	0.00	15.33	0.52	3.16	19.01
162. Seal & paint door/window trim & jamb - (per side)	2.00 EA	0.00	42.52	0.91	17.18	103.13

CONTINUED - Bedroom 1 Closet

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
163. Paint door slab only - 2 coats (per side)	2.00 EA		0.00	49.92	1.45	20.26	121.55
164. Detach & reset door hinges (set of 3)	1.00 EA	32.88	0.00	0.00	0.00	6.58	39.46
Door hinges will need to be detached and reset to allow for painting of slab							
165. Detach & reset door knob - interior	1.00 EA	25.84	0.00	0.00	0.00	5.16	31.00
Door knob will need to be detached and reset to allow for painting of slab							
166. Interior door slab - slab only	1.00 EA		0.00	13.83	0.00	2.76	16.59
167. Mask wall with plastic, paper, tape (per LF)	23.67 LF		0.00	1.74	0.53	8.34	50.06
168. Floor protection with plastic and tape - 10 mil	26.19 SF		0.00	0.39	0.26	2.10	12.57
169. Final cleaning - Residential	26.19 SF		0.00	0.37	0.96	1.94	12.59
Totals: Bedroom 1 Closet					45.93	287.70	1,728.47

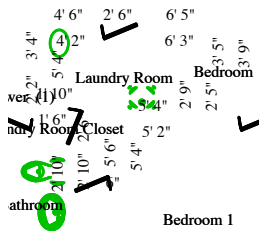

Laundry Room

Height: 9'

375.04 SF Walls
465.54 SF Walls & Ceiling
8.94 SY Flooring
49.17 LF Ceil. Perimeter

90.50 SF Ceiling
80.50 SF Floor
42.17 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
170. Paint the walls - two coats	375.04 SF		0.00	1.29	8.04	98.36	590.20
171. Concrete grinding	80.50 SF		0.00	3.88	0.00	62.46	374.80
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
172. HEPA Vacuuming - (PER SF)	80.50 SF		0.00	0.49	3.90	7.90	51.25

HEPA vacuum as required by OSHA

<https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153>

(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

OR

Use machine equipped with dust collection system recommended by the manufacturer

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions


Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism

When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes

CONTINUED - Laundry Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
173. Floor leveling compound - Average	80.50 SF		0.00	2.59	8.37	43.38	260.25
174. Tile floor leveling - High grade	80.50 SF		0.00	13.53	52.33	228.30	1,369.80
175. Grout sealer	80.50 SF		0.00	1.22	1.26	19.90	119.37
176. Baseboard - 4	42.17 LF		0.00	4.81	9.29	42.42	254.55
177. Quarter round	42.17 LF		0.00	1.99	3.72	17.52	105.16
178. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	42.17 LF		0.00	2.45	0.97	20.86	125.15
179. Door stop - floor mounted	1.00 EA		0.00	15.33	0.52	3.16	19.01
180. R&R Toe kick - unfinished wood - 1/2"	5.00 LF		2.27	8.69	1.46	11.28	67.54
181. Paint toe kick	5.00 LF		0.00	1.22	0.03	1.22	7.35
182. Quarter round	7.00 LF		0.00	1.99	0.62	2.90	17.45
Replace quarter round on base of cabinet							
183. Seal & paint base shoe or quarter round	7.00 LF		0.00	1.11	0.08	1.58	9.43
184. Paint door/window trim jamb - 2 coats (per side)	2.00 EA		0.00	43.21	0.92	17.46	104.80
185. Prime & paint floor slab only - exterior (per side)	1.00 EA		0.00	60.35	1.31	12.34	74.00
Paint door slab(s) in order to achieve a uniform appearance with door opening(s) and baseboard							
186. Exterior door - detach & reset	1.00 EA		0.00	149.65	0.57	30.06	180.28
Door will need to be detached and reset to allow painting of slab							
187. Interior door - detach & reset - slab only	1.00 EA		0.00	23.00	0.00	4.60	27.60
Closet door will need to be detached and reset to allow painting of slab							
188. Detach & reset Door hinges (set of 3)	1.00 EA	32.88	0.00	0.00	0.00	6.58	39.46
Door hinges will need to be detached and reset to allow painting of door slab							
189. Door knob/lockset - detach & reset	1.00 EA		0.00	25.84	0.00	5.16	31.00
Door knob will need to be detached and reset to allow painting of door slab							
190. Floor protection - plastic and tape - 10 mil	80.50 SF		0.00	0.39	0.80	6.44	38.64
191. Washer/Washing machine	1.00 EA		0.00	29.99	0.00	6.00	35.99
192. Dryer - detach & reset	1.00 EA		0.00	23.12	0.00	4.62	27.74
193. Freezer - detach & reset	1.00 EA		0.00	61.64	0.00	12.32	73.96
194. Final cleaning - Residential	80.50 SF		0.00	0.37	2.95	5.96	38.70
Totals: Laundry Room					97.14	672.78	4,043.48

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

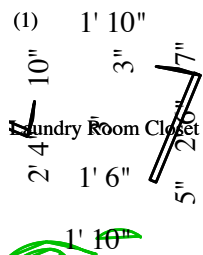

Laundry Room Closet

Height: 9'

81.00 SF Walls
85.50 SF Walls & Ceiling
0.50 SY Flooring
9.00 LF Ceil. Perimeter

4.50 SF Ceiling
4.50 SF Floor
9.00 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
195. Paint the walls - two coats	81.00 SF		0.00	1.29	1.74	21.24	127.47
196. Concrete grinding	4.50 SF		0.00	3.88	0.00	3.50	20.96
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
197. HEPA Vacuuming - (PER SF)	4.50 SF		0.00	0.49	0.22	0.44	2.87
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
198. Floor leveling compound - Average	4.50 SF		0.00	2.59	0.47	2.44	14.57
199. Tile floor leveling compound - High grade	4.50 SF		0.00	13.53	2.93	12.76	76.58
200. Grout sealer	4.50 SF		0.00	1.22	0.07	1.12	6.68
201. Baseboard - 4" x 4"	9.00 LF		0.00	4.81	1.98	9.06	54.33
202. Quarter round	9.00 LF		0.00	1.99	0.79	3.74	22.44
203. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	9.00 LF		0.00	2.45	0.21	4.46	26.72
204. Paint door/window trim - jamb - 2 coats (per side)	1.00 EA		0.00	43.21	0.46	8.74	52.41
205. Paint door slab - 2 coats (per side)	2.00 EA		0.00	50.63	1.45	20.56	123.27
Paint door slab(s) in order to achieve a uniform appearance with baseboard and door opening(s)							
206. Interior door - detach & reset - slab only	1.00 EA		0.00	23.00	0.00	4.60	27.60
Closet door will need to be detached and reset to allow painting of slab							
207. Detach & reset door hinges (set of 3)	1.00 EA	32.88	0.00	0.00	0.00	6.58	39.46
Door hinges will need to be detached and reset to allow painting of door slab							
208. Door knob/lockset - detach & reset	1.00 EA		0.00	25.84	0.00	5.16	31.00

CONTINUED - Laundry Room Closet

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
Door knob will need to be detached and reset to allow painting of door slab							
209. Floor protection - 10 mil	4.50 SF		0.00	0.39	0.04	0.36	2.16
210. Final cleaning - Residential	4.50 SF		0.00	0.37	0.17	0.34	2.18
Totals: Laundry Room Closet					10.53	105.10	630.70




Bathroom

Height: 8'

227.80 SF Walls
273.43 SF Walls & Ceiling
4.29 SY Flooring
30.16 LF Ceil. Perimeter

45.63 SF Ceiling
38.63 SF Floor
25.66 LF Floor Perimeter

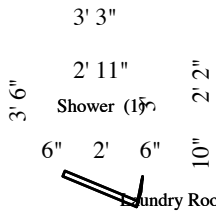

Subroom: Shower (1)

Height: 8'

94.67 SF Walls
103.42 SF Walls & Ceiling
0.97 SY Flooring
11.83 LF Ceil. Perimeter

8.75 SF Ceiling
8.75 SF Floor
11.83 LF Floor Perimeter


DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
211. Paint the - two coats	322.47 SF		0.00	1.29	6.92	84.58	507.49
212. Window blind - horizontal or vertical - Detach & reset	1.00 EA		0.00	38.72	0.00	7.74	46.46
Blinds will need to be detached and reset to allow for painting of window openings							
213. Concrete grinding	47.38 SF		0.00	3.88	0.00	36.76	220.59
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
214. HEPA Vacuuming - (PER SF)	47.38 SF		0.00	0.49	2.30	4.64	30.16

CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153							
(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface							
Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions							
OR							
Use machine equipped with dust collection system recommended by the manufacturer							
Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions							
Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism							
When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
215. Tile floor cleaning - High grade	47.38 SF		0.00	13.53	30.80	134.38	806.23
216. Grout sealer	47.38 SF		0.00	1.22	0.74	11.70	70.24
217. R&R Vanity	4.50 LF		9.11	237.15	72.67	236.18	1,417.03
218. Sand wood floor	17.50 SF		0.00	6.66	0.19	23.36	140.10
Prep new vanity and upper cabinet for paint							
219. Seal & touch up vanity - inside and out	4.50 LF		0.00	51.38	1.84	46.60	279.65
220. Seal & touch up cabinetry - upper - faces only	2.00 LF		0.00	31.54	0.43	12.70	76.21
Upper cabinet will need to be painted in order to achieve a uniform appearance with new vanity							
221. Cabinet knobs & pulls - Detach & reset	5.00 EA		0.00	2.64	0.00	2.64	15.84
222. Vanity top - Detach & reset	4.50 LF		0.00	41.02	0.11	36.94	221.64
223. Detach & reset Backsplash - solid surface - Unattached	4.50 LF	4.07	0.00	0.00	0.04	3.66	22.02
224. Sink - Detach & reset	1.00 EA		0.00	185.91	0.06	37.20	223.17
225. Sink faucet - Detach & reset	1.00 EA		0.00	148.48	0.00	29.70	178.18
226. Detach & reset P-trap assembly - ABS (plastic)	1.00 EA	74.00	0.00	0.00	0.00	14.80	88.80
227. Plumbing fixture supply line	2.00 EA		0.00	24.05	1.19	9.86	59.15
228. Angle stop valve	2.00 EA		0.00	46.12	2.06	18.86	113.16
229. Baseboard - 4" x 6"	37.50 LF		0.00	4.81	8.26	37.74	226.38
230. Quarter round	37.50 LF		0.00	1.99	3.31	15.58	93.52
231. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	37.50 LF		0.00	2.45	0.87	18.56	111.31
232. Door stop - floor mounted	1.00 EA		0.00	15.33	0.52	3.16	19.01
233. Toilet - 1" x 12" x 12"	1.00 EA		0.00	184.82	0.72	37.10	222.64
234. Plumbing fixture supply line	1.00 EA		0.00	24.05	0.60	4.94	29.59
235. Angle stop valve	1.00 EA		0.00	46.12	1.03	9.42	56.57

CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
236. Paint door/window jamb - 2 coats (per side)	1.00 EA		0.00	43.21	0.46	8.74	52.41
Paint door opening(s) in order to achieve a uniform appearance with baseboard							
237. Interior door slab only	1.00 EA		0.00	13.83	0.00	2.76	16.59
238. Paint door slab only - 2 coats (per side)	1.00 EA		0.00	50.63	0.73	10.26	61.62
Paint door slab(s) in order to achieve a uniform appearance with baseboard and door opening(s)							
239. Door hinges (3) and slab - Detach & reset	1.00 EA		0.00	32.88	0.00	6.58	39.46
Door slab(s) and hinges will need to be detached and reset to allow for painting of slab							
240. Detach & reset interior door knob	1.00 EA	25.84	0.00	0.00	0.00	5.16	31.00
Door knob(s) will need to be detached and reset to allow for painting of slab(s)							
241. Floor protection - 10 mil	47.38 SF		0.00	0.39	0.47	3.80	22.75
242. Final cleaning - Residential	47.38 SF		0.00	0.37	1.74	3.50	22.77
Totals: Bathroom					138.06	919.60	5,521.74

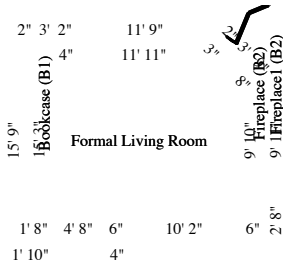

Formal Living Room

Height: 12'

488.26 SF Walls
761.43 SF Walls & Ceiling
29.70 SY Flooring
65.20 LF Ceil. Perimeter

273.18 SF Ceiling
267.26 SF Floor
26.62 LF Floor Perimeter

Missing Wall - Goes to Floor
Missing Wall - Goes to Floor
Missing Wall - Goes to Floor
Missing Wall - Goes to Floor
Missing Wall - Goes to Floor

3' X 6' 8"
3' X 6' 8"
2' 8" X 6' 8"
10' 2" X 9'
4' 8" X 9'


Opens into HALLWAY_1
Opens into HALLWAY_3
Opens into FAMILY_ROOM
Opens into FORMAL_DININ
Opens into ENTRY

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
243. Paint the walls - two coats	488.26 SF		0.00	1.29	10.47	128.08	768.41
244. Concrete grinding	267.26 SF		0.00	3.88	0.00	207.40	1,244.37
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
245. HEPA Vacuuming - (PER SF)	267.26 SF		0.00	0.49	12.96	26.20	170.12

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Formal Living Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
246. Floor leveling compound - Average	267.26 SF		0.00	2.41	27.78	134.38	806.26
247. Engineered wood flooring - specs from independent analysis	267.26 SF		0.00	13.59	229.53	772.32	4,633.91
248. Add for glue down wood flooring application over concrete	267.26 SF		0.00	1.29	24.47	73.86	443.10
249. Baseboard - 4" x 4" x 4"	44.23 LF		0.00	4.81	9.74	44.50	266.99
250. Quarter round - 4" x 4" x 4"	44.87 LF		0.00	1.99	3.96	18.66	111.91
Includes replacement of quarter round around perimeter of floor and on bookcase							
251. Seal (1 coat) & paint (1 coat) baseboard w/can &/or shoe	44.23 LF		0.00	2.45	1.02	21.88	131.26
252. Seal & paint base shoe or quarter round	18.25 LF		0.00	1.11	0.20	4.10	24.56
253. Seal & paint floor/window trim & jamb - (per side)	3.00 EA		0.00	42.52	1.36	25.80	154.72
254. Floor protection - 10 mil plastic and tape	267.26 SF		0.00	0.39	2.65	21.38	128.26
255. Final cleaning - Residential	267.26 SF		0.00	0.37	9.79	19.78	128.46
Totals: Formal Living Room					333.93	1,498.34	9,012.33

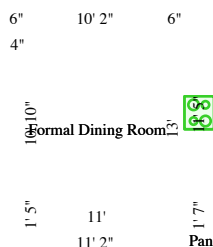

Formal Dining Room

Height: 10'

291.00 SF Walls
434.00 SF Walls & Ceiling
15.89 SY Flooring
48.00 LF Ceil. Perimeter

143.00 SF Ceiling
143.00 SF Floor
27.00 LF Floor Perimeter

Missing Wall - Goes to Floor
Missing Wall - Goes to Floor

10' 2" X 9'

10' 10" X 9'

Opens into FORMAL_LIVIN
Opens into ENTRY

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
-------------	-----	-------	--------	---------	-----	-----	-------

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com


CONTINUED - Formal Dining Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
256. Batt insulation element per LF - 4" - up to 2' tall	11.00 LF		0.00	3.31	1.90	7.66	45.97
Allowance to replace insulation on exterior-facing walls							
257. 1/2" - cove molding per LF - up to 2' tall	22.75 LF		0.00	12.80	2.78	58.80	352.78
258. Texture drywall - hand texture	56.88 SF		0.00	1.25	0.38	14.30	85.78
259. Seal/prime (1 coat) then paint (2 coats) the walls	291.00 SF		0.00	1.75	7.68	103.40	620.33
260. Window blind - horizontal or vertical - Detach & reset	2.00 EA		0.00	38.72	0.00	15.48	92.92
Blinds will need to be detached and reset to allow for painting of window openings							
261. Cove molding	46.00 LF		0.00	1.78	3.26	17.04	102.18
Replace molding on walls							
262. Seal (1 coat) & paint (2 coats) cove molding	46.00 LF		0.00	2.05	0.61	18.98	113.89
263. Outlet or switch cover	2.00 EA		0.00	3.70	0.16	1.52	9.08
264. Concrete grinding	146.47 SF		0.00	3.88	0.00	113.66	681.96
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
265. HEPA Vacuuming - (PER SF)	146.47 SF		0.00	0.49	7.10	14.36	93.23
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
266. Floor leveling - Average	146.47 SF		0.00	2.41	15.23	73.64	441.86
267. Engineered wood flooring - specs from independent analysis	146.47 SF		0.00	13.59	125.79	423.26	2,539.58
268. Add for glue down wood flooring application over concrete	146.47 SF		0.00	1.29	13.41	40.48	242.84
269. Baseboard - 4"	27.00 LF		0.00	4.81	5.95	27.18	163.00
270. Quarter round	27.00 LF		0.00	1.99	2.38	11.22	67.33
271. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	27.00 LF		0.00	2.45	0.62	13.36	80.13
272. Mask wall - fabric, paper, tape (per LF)	48.00 LF		0.00	1.74	1.07	16.92	101.51

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Formal Dining Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
273. Floor protection - 10 mil - 10 mil	146.47 SF		0.00	0.39	1.45	11.72	70.29
274. Final cleaning - Residential	146.47 SF		0.00	0.37	5.36	10.84	70.39
Totals: Formal Dining Room					195.13	993.82	5,975.05

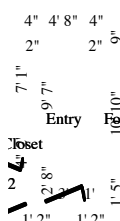

Entry

Height: 12'

274.72 SF Walls
339.72 SF Walls & Ceiling
7.22 SY Flooring
36.00 LF Ceil. Perimeter

65.00 SF Ceiling
65.00 SF Floor
17.83 LF Floor Perimeter

Missing Wall - Goes to Floor
Missing Wall - Goes to Floor
Missing Wall - Goes to Floor

2' 8" X 6' 8"
10' 10" X 9'
4' 8" X 9'

Opens into HALLWAY_2
Opens into FORMAL DINING ROOM
Opens into FORMAL LIVING ROOM

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
275. Drywall patch/repair, ready for paint	1.00 EA		0.00	103.38	0.34	20.74	124.46
276. Seal/prime (1 coat) then paint (2 coats) the walls	274.72 SF		0.00	1.75	7.25	97.62	585.63
277. Concrete grinding	67.08 SF		0.00	3.88	0.00	52.06	312.33
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
278. HEPA Vacuuming	67.08 SF		0.00	0.49	3.25	6.58	42.70

HEPA vacuum as required by OSHA

<https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153>

(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

OR

Use machine equipped with dust collection system recommended by the manufacturer

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions


Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism

When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes

279. Floor leveling	67.08 SF	0.00	2.41	6.97	33.74	202.37
280. Engineered wood floor - Average from independent analysis	67.08 SF	0.00	13.59	57.61	193.84	1,163.07
281. Add for g... down wood flooring application over concrete	67.08 SF	0.00	1.29	6.14	18.52	111.19

CONTINUED - Entry

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
282. Baseboard - 4" x 6" x 1/2" - 17.83 LF	17.83 LF		0.00	4.81	3.93	17.94	107.63
283. Quarter round - 1/2" x 3" x 1/2" - 17.83 LF	17.83 LF		0.00	1.99	1.57	7.42	44.47
284. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe - 17.83 LF	17.83 LF		0.00	2.45	0.41	8.82	52.91
285. R&R Casing - 1" x 4" x 1/2" - 7.00 LF	7.00 LF		0.62	2.51	0.83	4.54	27.28
286. Paint door/window jamb - 2 coats (per side) - 2.00 EA	2.00 EA		0.00	43.21	0.92	17.46	104.80
Paint door opening(s) in order to achieve a uniform appearance with baseboard							
287. Prime & paint door slab only - exterior (per side) - 1.00 EA	1.00 EA		0.00	60.35	1.31	12.34	74.00
Paint door slab(s) in order to achieve a uniform appearance with door opening(s) and baseboard							
288. Exterior door - 1" x 4" x 1/2" - 1.00 EA	1.00 EA		0.00	149.65	0.57	30.06	180.28
Door will need to be detached and reset to allow painting of slab							
289. Detach & reset door hinges (set of 3) - 1.00 EA	1.00 EA	32.88	0.00	0.00	0.00	6.58	39.46
Door hinges will need to be detached and reset to allow painting of door slab							
290. Door knob/lockset - 1.00 EA	1.00 EA		0.00	25.84	0.00	5.16	31.00
Door knob will need to be detached and reset to allow painting of door slab							
291. Floor protection - 67.08 SF	67.08 SF		0.00	0.39	0.66	5.38	32.20
292. Final cleaning - 67.08 SF	67.08 SF		0.00	0.37	2.46	4.96	32.24
Totals: Entry					94.22	543.76	3,268.02

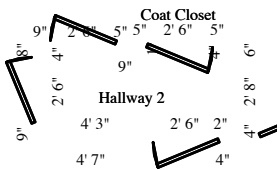

Hallway 2

Height: 12'

226.22 SF Walls
248.40 SF Walls & Ceiling
2.46 SY Flooring
20.33 LF Ceil. Perimeter

22.18 SF Ceiling
22.18 SF Floor
17.67 LF Floor Perimeter

Missing Wall - Goes to Floor

2' 8" X 6' 8"

Opens into ENTRY

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
293. Paint the wall - two coats - 226.22 SF	226.22 SF		0.00	1.29	4.85	59.34	356.01
294. Window blind - 3.00 EA	3.00 EA		0.00	38.72	0.00	23.24	139.40

Blinds will need to be detached and reset to allow for painting of window openings

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com


CONTINUED - Hallway 2

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
295. Concrete grinding 	25.72 SF		0.00	3.88	0.00	19.96	119.75
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
296. HEPA Vacuuming  - (PER SF)	25.72 SF		0.00	0.49	1.25	2.52	16.37
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153							
(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface							
Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions							
OR							
Use machine equipped with dust collection system recommended by the manufacturer							
Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions							
Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism							
When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
297. Floor leveling  - Average	25.72 SF		0.00	2.41	2.67	12.94	77.60
298. Engineered wood flooring  specs from independent analysis	25.72 SF		0.00	13.59	22.09	74.32	445.94
299. Add flooring  down wood flooring application over concrete	25.72 SF		0.00	1.29	2.36	7.12	42.66
300. Baseboard  - 4	17.67 LF		0.00	4.81	3.89	17.78	106.66
301. Quarter round  - 4	17.67 LF		0.00	1.99	1.56	7.36	44.08
302. Seal (1 coat)  & paint (1 coat) baseboard w/cap &/or shoe	17.67 LF		0.00	2.45	0.41	8.74	52.44
303. Paint door/window  jamb - 2 coats (per side)	3.00 EA		0.00	43.21	1.37	26.20	157.20
Paint door opening(s) in order to achieve a uniform appearance with baseboard							
304. Paint door  only - 2 coats (per side)	3.00 EA		0.00	50.63	2.18	30.82	184.89
Paint door slab(s) in order to achieve a uniform appearance with door opening(s) and baseboard							
305. Interior door  - detach & reset - slab only	3.00 EA		0.00	23.00	0.00	13.80	82.80
Door will need to be detached and reset to allow painting of slab							
306. Detach &  Door hinges (set of 3)	3.00 EA	32.88	0.00	0.00	0.00	19.72	118.36
Door hinges will need to be detached and reset to allow painting of door slab							
307. Detach &  Door knob - interior	3.00 EA	25.84	0.00	0.00	0.00	15.50	93.02
Door knob will need to be detached and reset to allow painting of door slab							
308. Floor protection  - 10 mil	22.18 SF		0.00	0.39	0.22	1.78	10.65
309. Final cleaning  - Residential	22.18 SF		0.00	0.37	0.82	1.64	10.67

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Hallway 2

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
Totals: Hallway 2					43.67	342.78	2,058.50

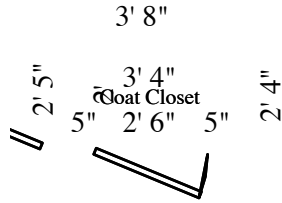

Coat Closet

Height: 12'

128.00 SF Walls	6.67 SF Ceiling
134.67 SF Walls & Ceiling	6.67 SF Floor
0.74 SY Flooring	10.67 LF Floor Perimeter
10.67 LF Ceil. Perimeter	

Hallway 2

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
310. Paint the two coats	128.00 SF		0.00	1.29	2.75	33.58	201.45
311. Concrete grinding	6.67 SF		0.00	3.88	0.00	5.18	31.06

Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation

312. HEPA Vacuuming - (PER SF)	6.67 SF		0.00	0.49	0.32	0.66	4.25
--------------------------------	---------	--	------	------	------	------	------

HEPA vacuum as required by OSHA

<https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153>

(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

OR

Use machine equipped with dust collection system recommended by the manufacturer

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism

When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes

313. Floor leveling - Average	6.67 SF		0.00	2.41	0.69	3.36	20.12
314. Engineered wood flooring - specs from independent analysis	6.67 SF		0.00	13.59	5.73	19.28	115.66
315. Add for down wood flooring application over concrete	6.67 SF		0.00	1.29	0.61	1.84	11.05
316. Baseboard - 4	10.67 LF		0.00	4.81	2.35	10.74	64.41
317. Quarter round	10.67 LF		0.00	1.99	0.94	4.42	26.59
318. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	10.67 LF		0.00	2.45	0.25	5.28	31.67
319. Paint door/window jamb - 2 coats (per side)	2.00 EA		0.00	43.21	0.92	17.46	104.80

Paint door opening(s) in order to achieve a uniform appearance with baseboard

320. Paint door slab - 2 coats (per side)	2.00 EA		0.00	50.63	1.45	20.56	123.27
---	---------	--	------	-------	------	-------	--------

Paint door slab(s) in order to achieve a uniform appearance with door opening(s) and baseboard


CONTINUED - Coat Closet

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
321. Interior door - Detach & reset - slab only	1.00 EA		0.00	23.00	0.00	4.60	27.60
Door will need to be detached and reset to allow painting of slab							
322. Detach & reset Door hinges (set of 3)	1.00 EA	32.88	0.00	0.00	0.00	6.58	39.46
Door hinges will need to be detached and reset to allow painting of door slab							
323. Detach & reset Door knob - interior	1.00 EA	25.84	0.00	0.00	0.00	5.16	31.00
Door knob will need to be detached and reset to allow painting of door slab							
324. Floor protection - 10 mil	6.67 SF		0.00	0.39	0.07	0.54	3.21
325. Final cleaning - Residential	6.67 SF		0.00	0.37	0.24	0.50	3.21
Totals: Coat Closet					16.32	139.74	838.81



Hallway 1

Height: 9'



205.00 SF Walls	30.56 SF Ceiling
235.56 SF Walls & Ceiling	30.56 SF Floor
3.40 SY Flooring	22.00 LF Floor Perimeter
25.00 LF Ceil. Perimeter	

Missing Wall - Goes to Floor

3' X 6' 8"

Opens into FORMAL_LIVIN

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
326. Paint the wall - two coats	205.00 SF		0.00	1.29	4.40	53.78	322.63
327. Concrete grinding	32.25 SF		0.00	3.88	0.00	25.02	150.15
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
328. HEPA Vacuuming - (PER SF)	32.25 SF		0.00	0.49	1.56	3.16	20.52

HEPA vacuum as required by OSHA

<https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153>

(xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions

OR

Use machine equipped with dust collection system recommended by the manufacturer

Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions


Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism

When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes

JDR Restoration & Remodeling
 - Home Re-Imagined -
 E: jdrrestoration.com

CONTINUED - Hallway 1

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
329. Floor leveling - Average	32.25 SF		0.00	2.41	3.35	16.22	97.29
330. Engineered wood flooring - specs from independent analysis	32.25 SF		0.00	13.59	27.70	93.20	559.18
331. Add for glue down wood flooring application over concrete	32.25 SF		0.00	1.29	2.95	8.92	53.47
332. Baseboard - 4	22.00 LF		0.00	4.81	4.85	22.14	132.81
333. Quarter round	22.00 LF		0.00	1.99	1.94	9.14	54.86
334. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	22.00 LF		0.00	2.45	0.51	10.88	65.29
335. Paint door/window jamb - 2 coats (per side)	2.00 EA		0.00	43.21	0.92	17.46	104.80
Paint door opening(s) in order to achieve a uniform appearance with baseboard							
336. Paint door jamb only - 2 coats (per side)	1.00 EA		0.00	50.63	0.73	10.26	61.62
Paint door slab(s) in order to achieve a uniform appearance with baseboard and door opening(s)							
337. Prime & paint door slab only - exterior (per side)	1.00 EA		0.00	60.35	1.31	12.34	74.00
Paint door slab(s) in order to achieve a uniform appearance with door opening(s) and baseboard							
338. Interior door - detach & reset - slab only	1.00 EA		0.00	23.00	0.00	4.60	27.60
Door will need to be detached and reset to allow painting of slab							
339. Exterior door - detach & reset	1.00 EA		0.00	149.65	0.57	30.06	180.28
340. Detach & reset door hinges (set of 3)	2.00 EA	32.88	0.00	0.00	0.00	13.16	78.92
Door hinges will need to be detached and reset to allow painting of door slab							
341. Detach & reset door knob - interior	1.00 EA	25.84	0.00	0.00	0.00	5.16	31.00
Door knob will need to be detached and reset to allow painting of door slab							
342. Door knob/lockset - detach & reset	1.00 EA		0.00	25.84	0.00	5.16	31.00
Door knob will need to be detached and reset to allow painting of door slab							
343. Floor protection - 10 mil	30.56 SF		0.00	0.39	0.30	2.44	14.66
344. Final cleaning - Residential	30.56 SF		0.00	0.37	1.12	2.26	14.69
Totals: Hallway 1					52.21	345.36	2,074.77

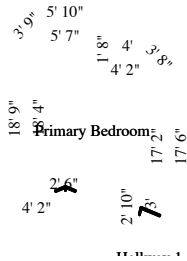

Primary Bedroom

Height: 8'

619.01 SF Walls
947.12 SF Walls & Ceiling
36.46 SY Flooring
77.38 LF Ceil. Perimeter

328.11 SF Ceiling
328.11 SF Floor
77.38 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
345. Paint the walls - two coats	619.01 SF		0.00	1.29	13.28	162.36	974.16
346. Concrete grinding	406.47 SF		0.00	3.88	0.00	315.42	1,892.52
Allowance to remove glue residue and prep concrete substrate for new engineered wood flooring installation							
347. HEPA Vacuuming - (PER SF)	406.47 SF		0.00	0.49	19.72	39.84	258.73
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
348. Floor leveling compound - Average	406.47 SF		0.00	2.41	42.25	204.38	1,226.22
349. Engineered wood flooring - specs from independent analysis	406.47 SF		0.00	13.59	349.09	1,174.60	7,047.62
350. Add for glue down wood flooring application over concrete	406.47 SF		0.00	1.29	37.22	112.32	673.89
351. R&R Baseboard - 1/2"	85.37 LF		0.55	4.81	18.81	95.28	571.67
352. Quarter round - 1/2"	85.37 LF		0.00	1.99	7.54	35.48	212.91
353. Seal (1 coat) & paint (1 coat) baseboard w/cap &/or shoe	85.37 LF		0.00	2.45	1.97	42.24	253.37
354. Paint door/window jamb - 2 coats (per side)	2.00 EA		0.00	43.21	0.92	17.46	104.80
Paint door opening(s) in order to achieve a uniform appearance with baseboard							
355. Paint door slab - 2 coats (per side)	3.00 EA		0.00	50.63	2.18	30.82	184.89
Paint door slab(s) in order to achieve a uniform appearance with door opening(s) and baseboard							
356. Interior door - detach & reset - slab only	3.00 EA		0.00	23.00	0.00	13.80	82.80
Door will need to be detached and reset to allow painting of slab							
357. Detach & reset door hinges (set of 3)	3.00 EA	32.88	0.00	0.00	0.00	19.72	118.36

CONTINUED - Primary Bedroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
Door hinges will need to be detached and reset to allow painting of door slab							
358. Detach & interior Door knob -	3.00 EA	25.84	0.00	0.00	0.00	15.50	93.02
Door knob will need to be detached and reset to allow painting of door slab							
359. Floor protection - 10 mil	328.11 SF		0.00	0.39	3.25	26.26	157.47
360. R&R Ceramic/porcelain tile - High grade	8.67 SF		2.42	15.30	5.46	31.84	190.93
Replace tile border around fireplace opening that was damaged during removal of flooring							
361. Final cleaning - Residential	406.47 SF		0.00	0.37	14.89	30.08	195.36
Totals: Primary Bedroom					516.58	2,367.40	14,238.72
Total: Main Level					3,231.51	19,155.80	115,096.95

Debris Removal

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
362. Dumpster load - approx. 12 yards, 1-3 tons of debris	1.00 EA		650.00	0.00	0.00	130.00	780.00
Totals: Debris Removal					0.00	130.00	780.00

Labor Minimums Applied

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
363. Insulation labor - minimum	1.00 EA		0.00	55.46	0.00	11.10	66.56
Totals: Labor Minimums Applied					0.00	11.10	66.56
Line Item Totals:					3,231.51	19,296.90	115,943.51

JDR Restoration & Remodeling
 - Home Re-Imagined -
 E: jdrrestoration.com

Grand Total Areas:

4,829.79	SF Walls	1,944.78	SF Ceiling	6,774.57	SF Walls and Ceiling
1,802.37	SF Floor	200.26	SY Flooring	473.73	LF Floor Perimeter
0.00	SF Long Wall	0.00	SF Short Wall	616.01	LF Ceil. Perimeter
1,802.37	Floor Area	2,100.80	Total Area	4,829.79	Interior Wall Area
3,216.33	Exterior Wall Area	310.57	Exterior Perimeter of Walls		
0.00	Surface Area	0.00	Number of Squares	0.00	Total Perimeter Length
0.00	Total Ridge Length	0.00	Total Hip Length		





JDR Restoration & Remodeling

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Summary for Dwelling

Line Item Total	93,415.10
Material Sales Tax	3,058.22
Cleaning Mtl Tax	8.81
Subtotal	96,482.13
Overhead	9,648.45
Profit	9,648.45
Cleaning Sales Tax	164.48
Replacement Cost Value	\$115,943.51
Net Claim	\$115,943.51

