







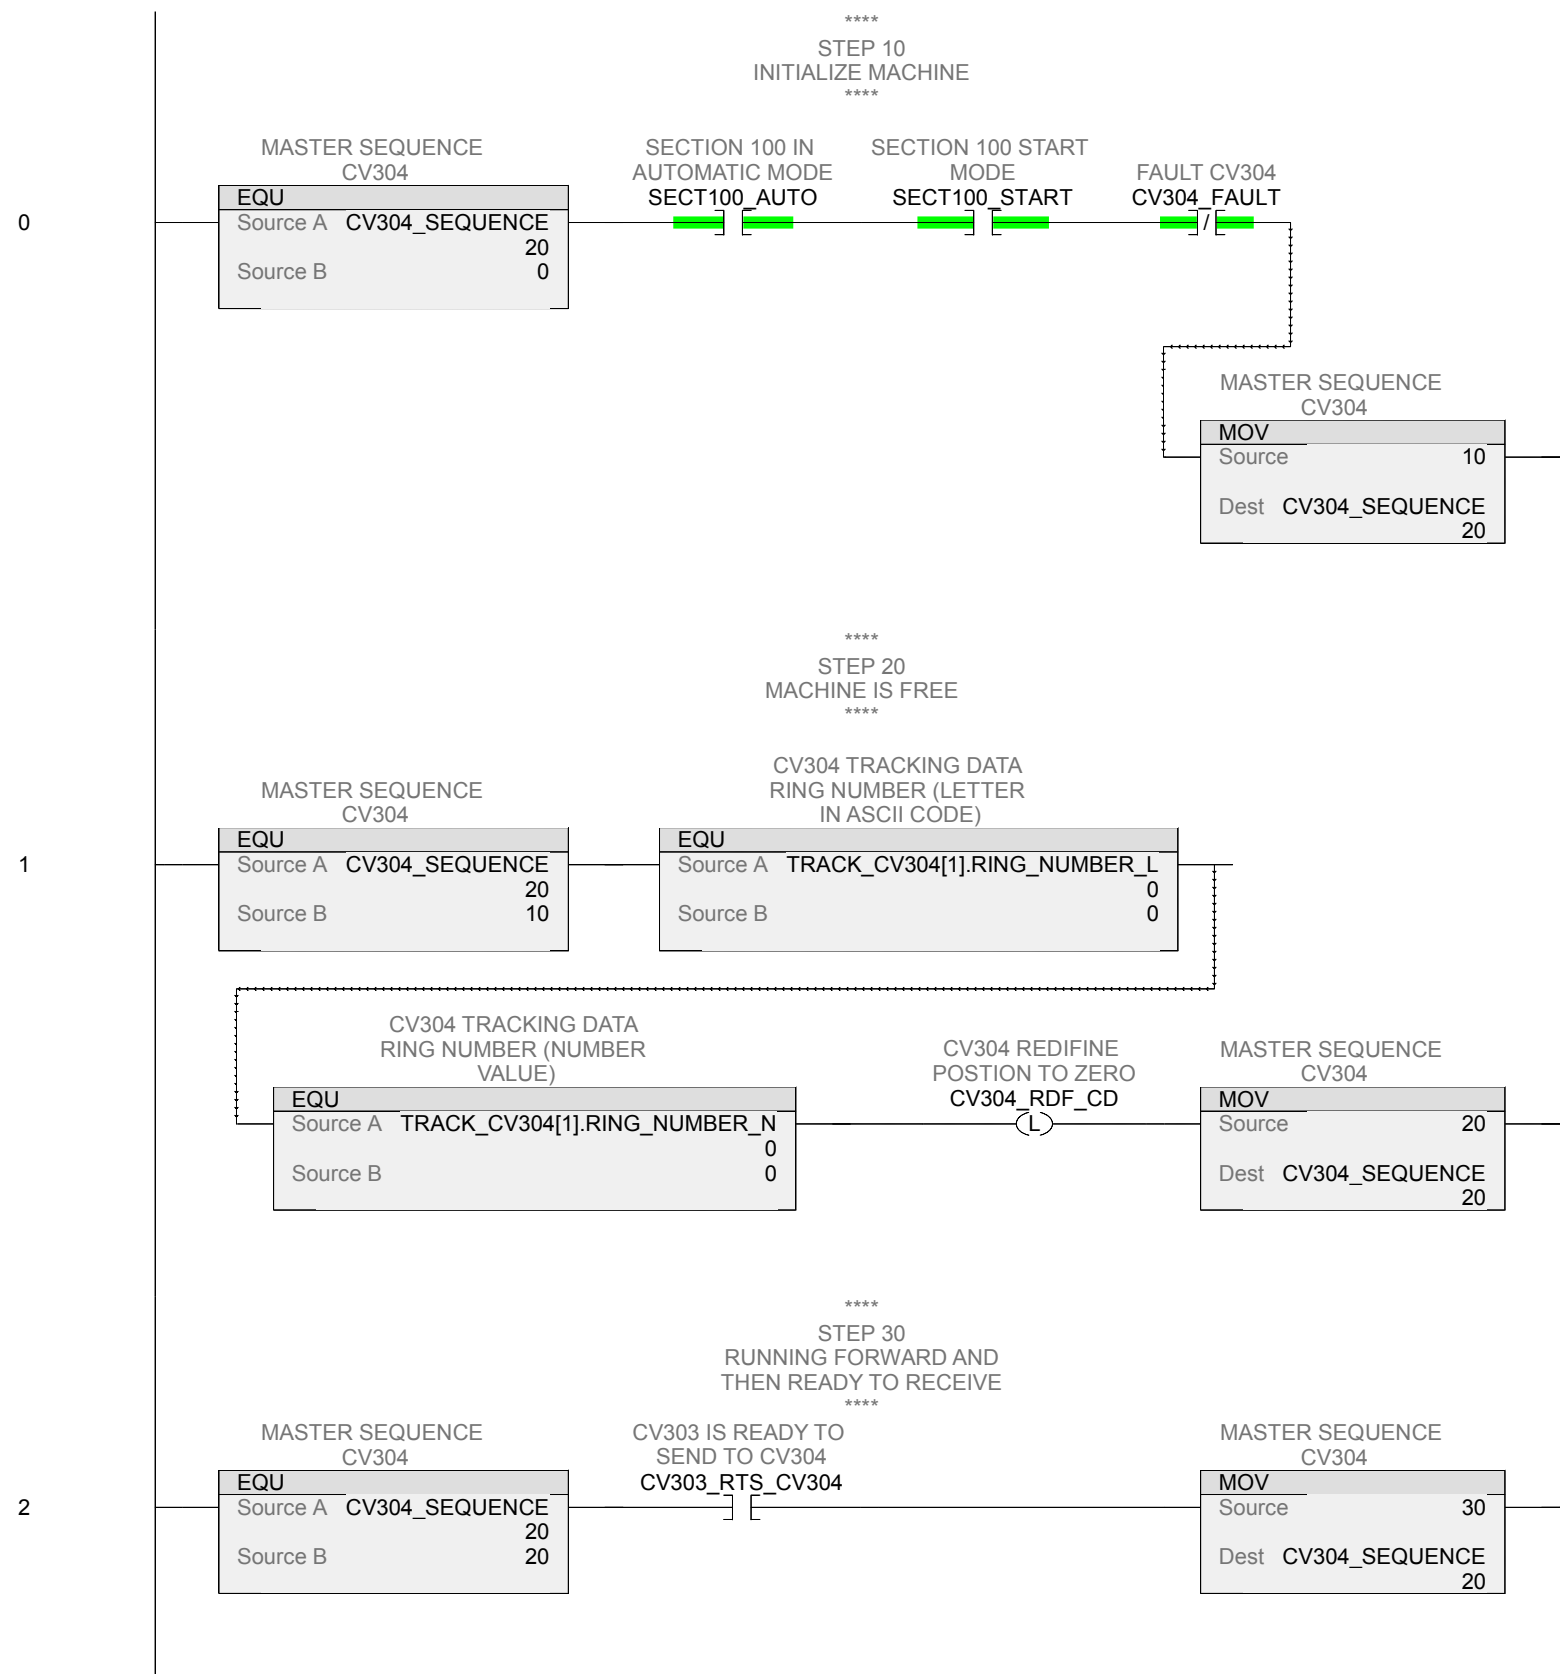

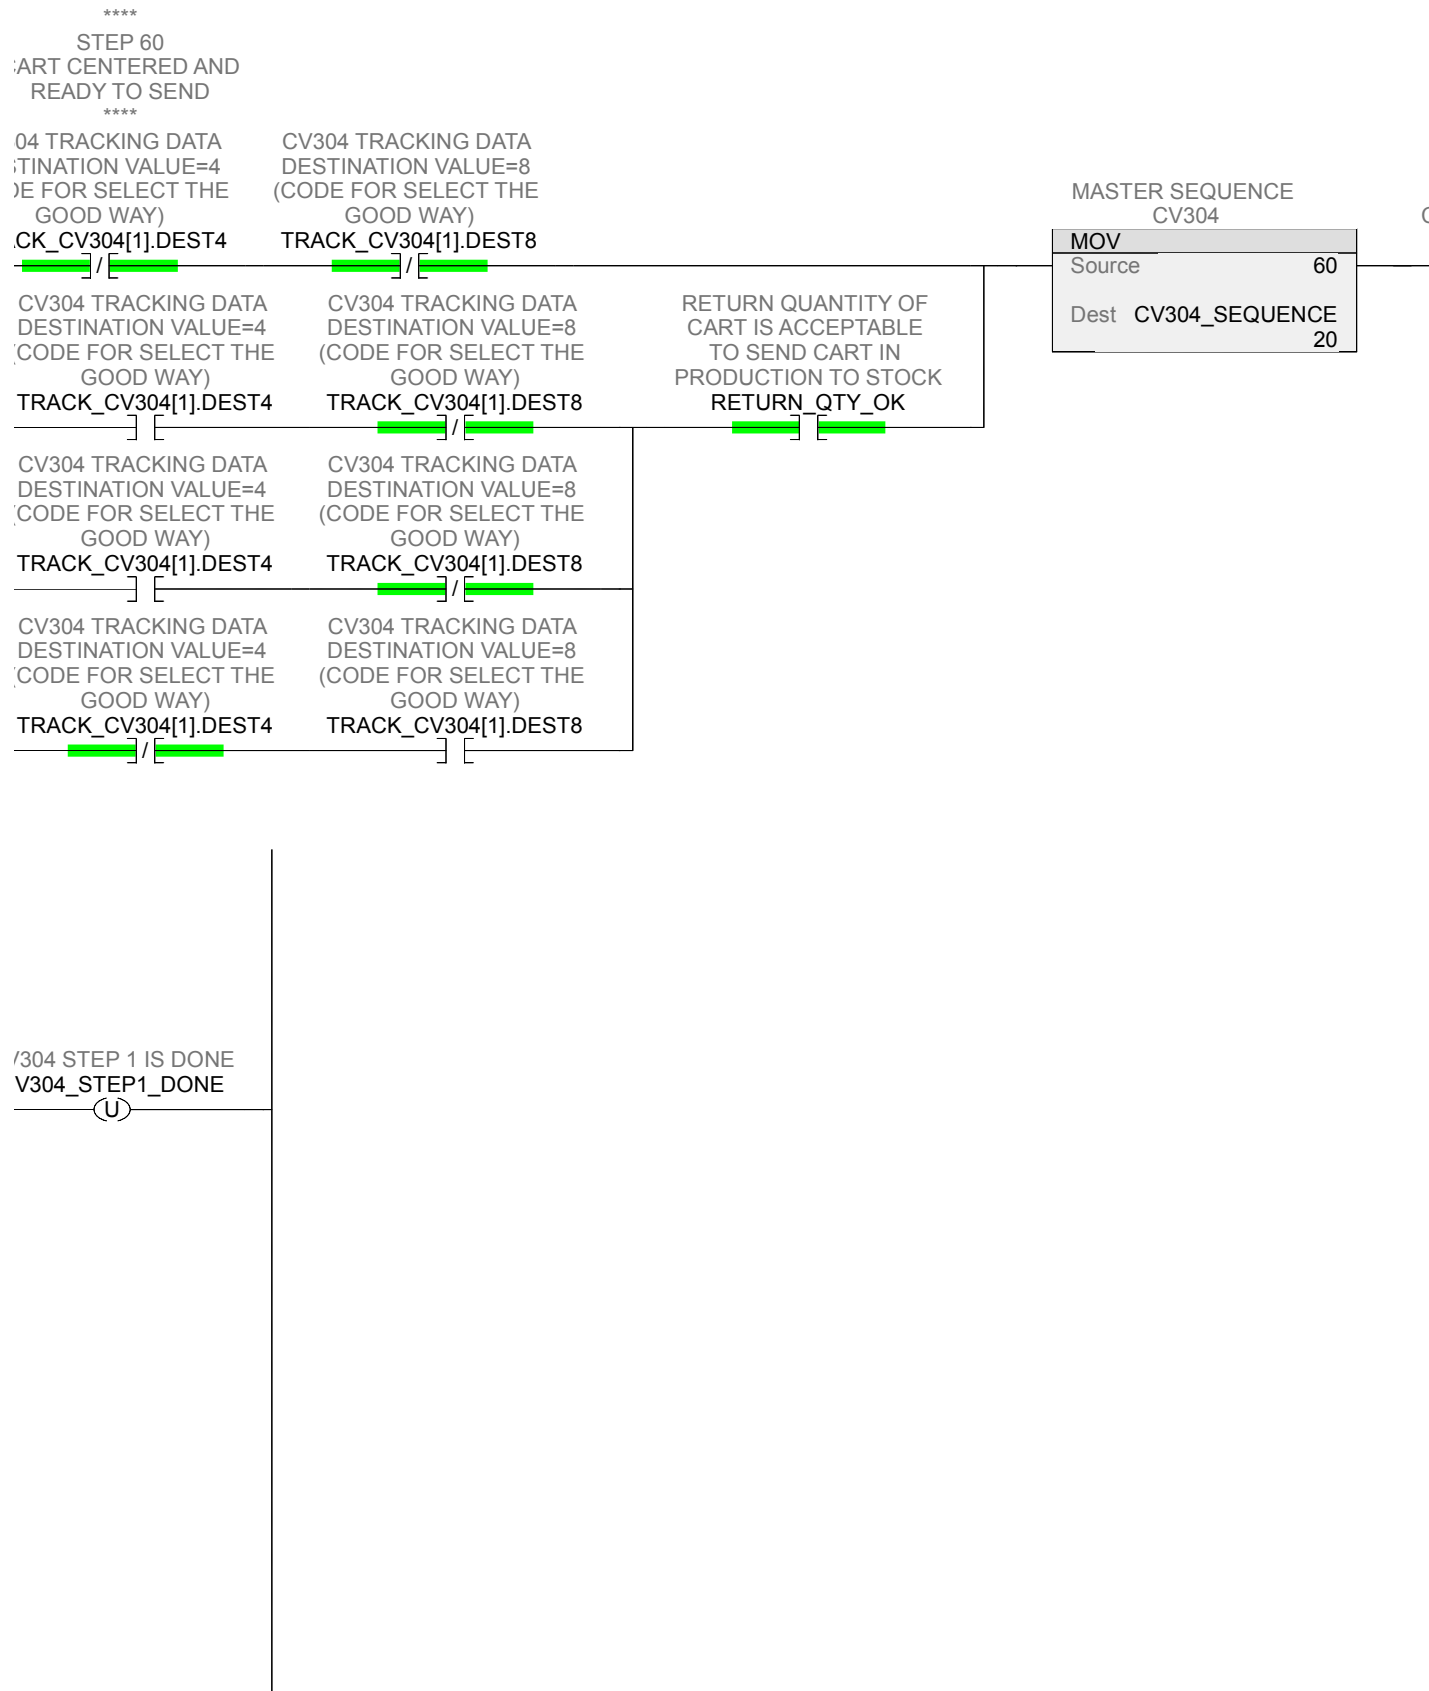

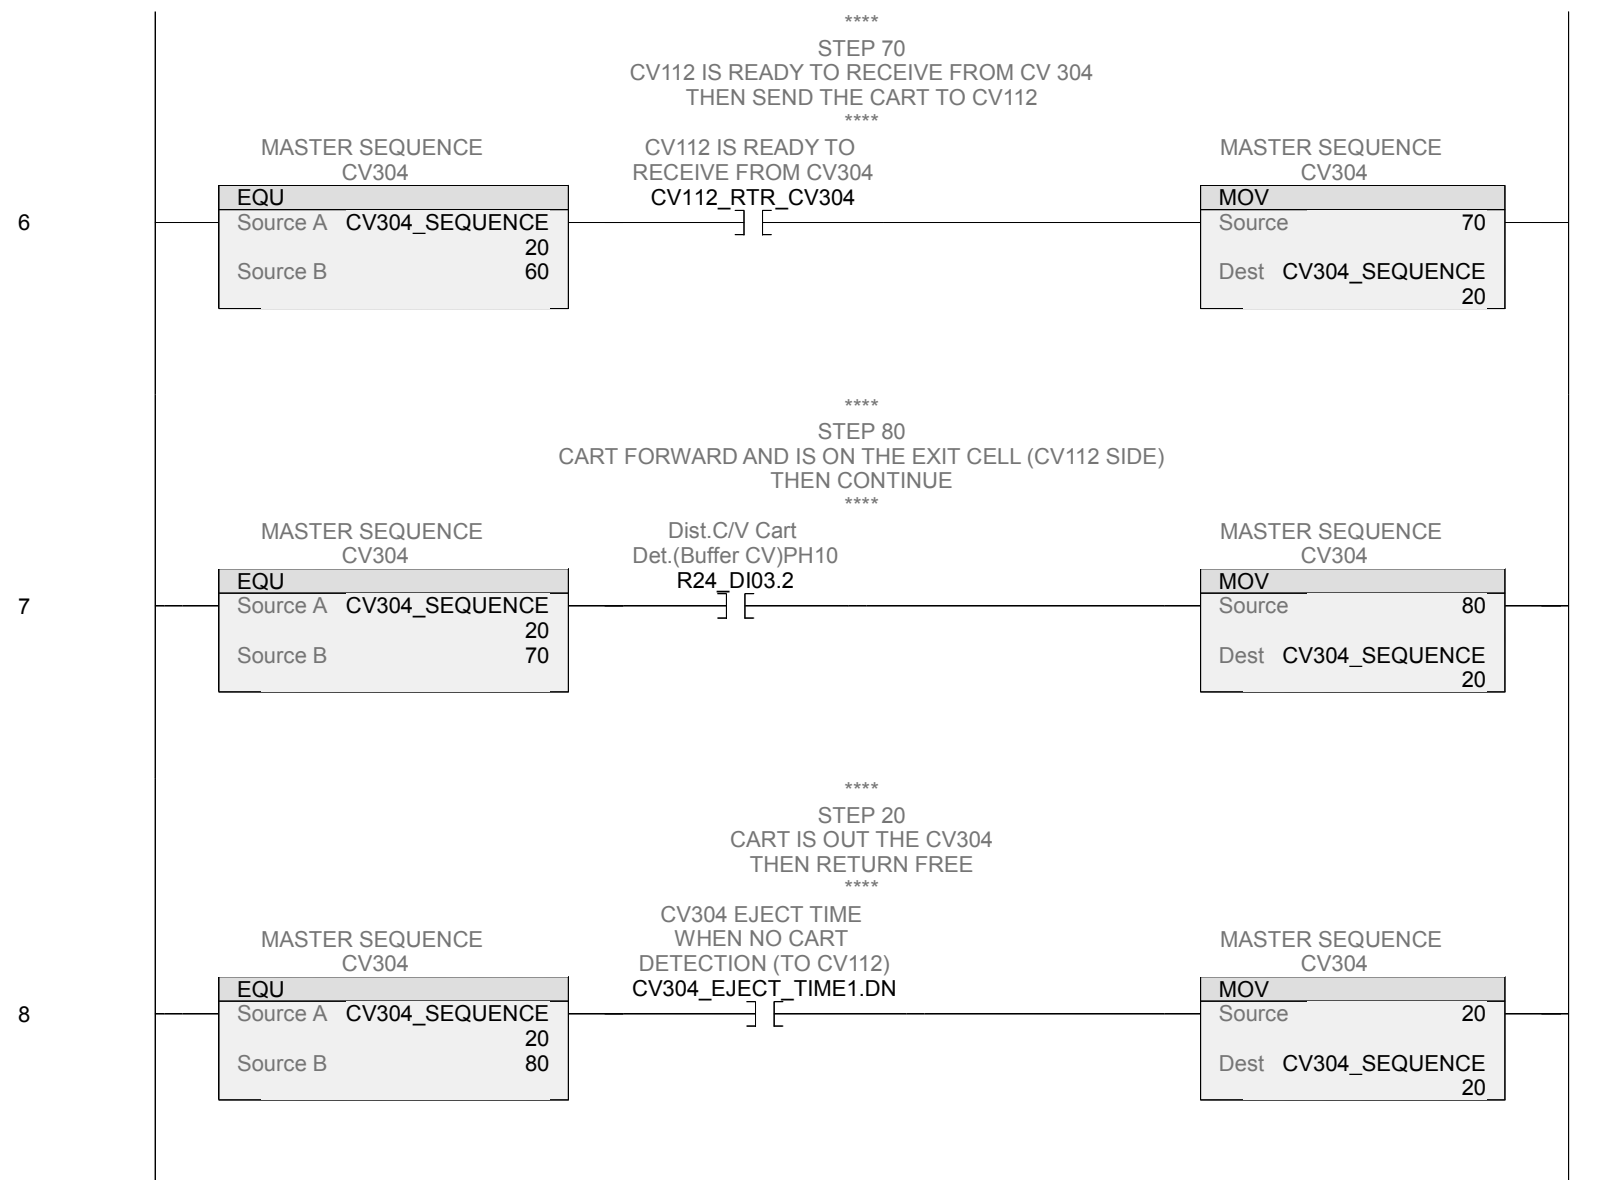

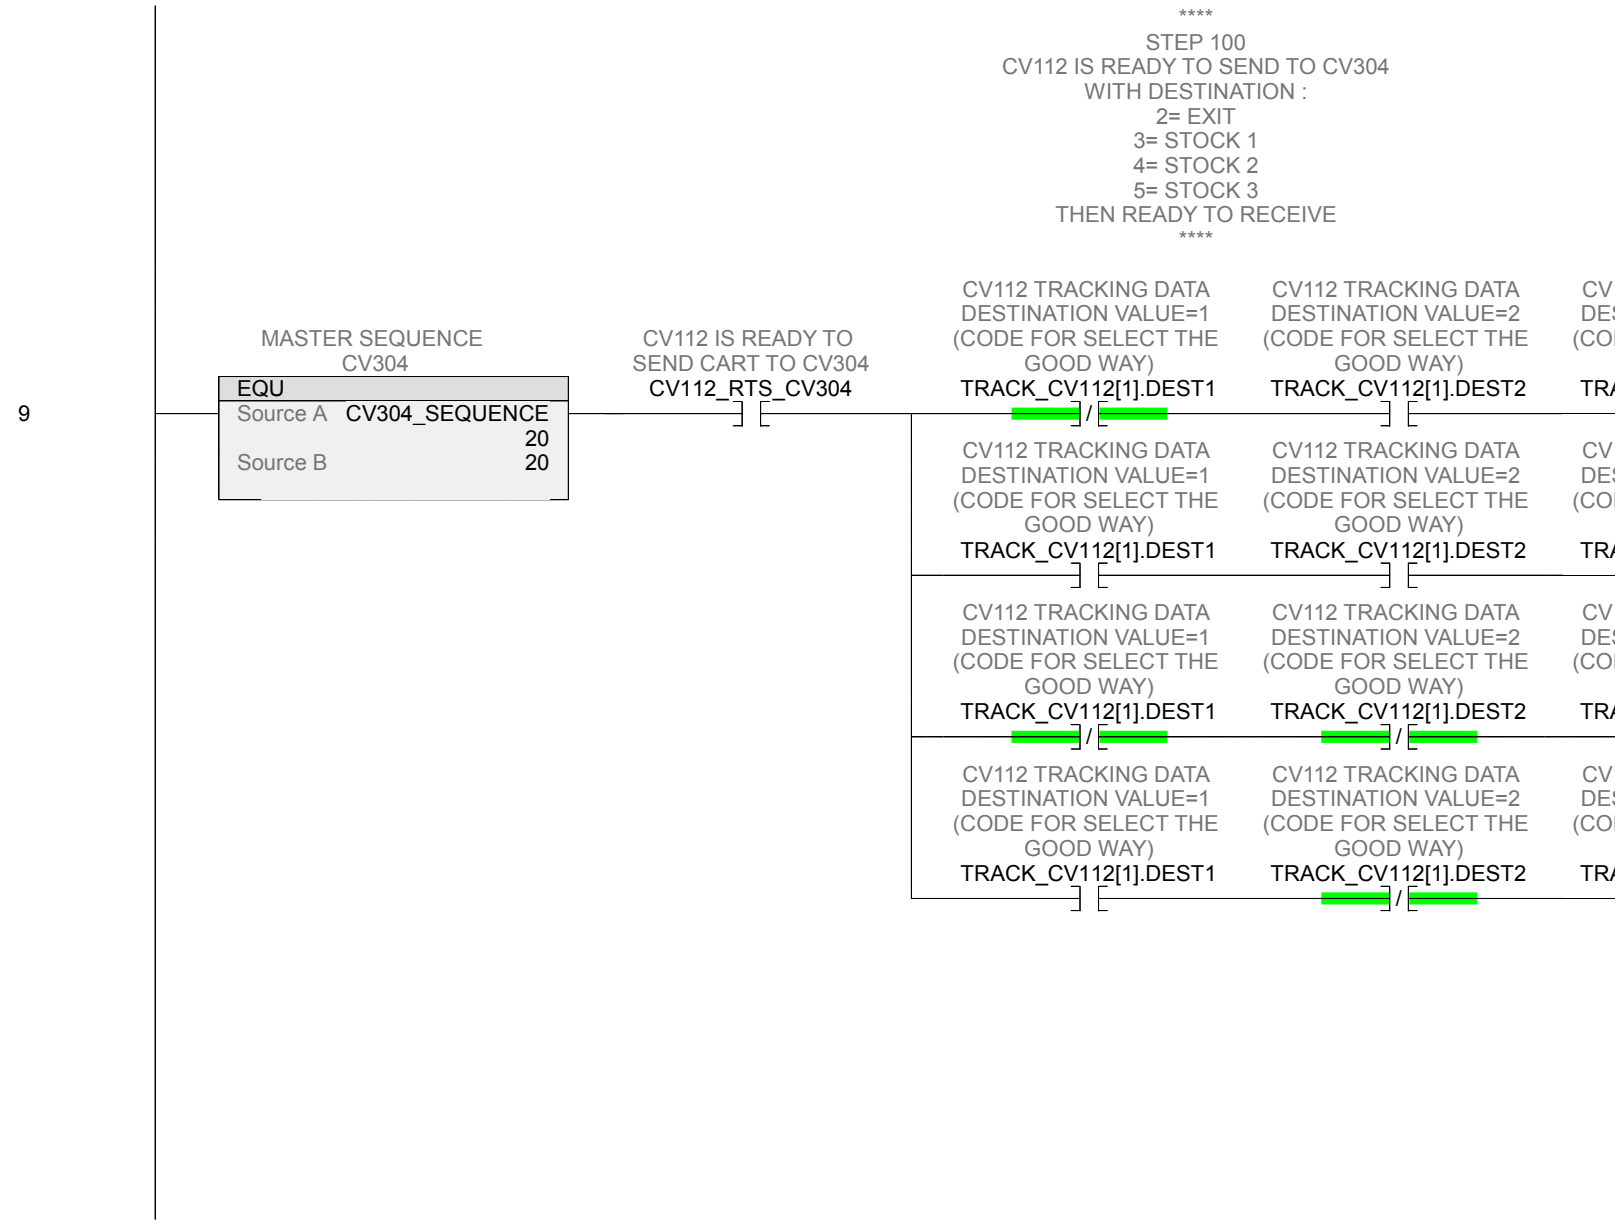

2 TRACKING DATA INATION VALUE=4 E FOR SELECT THE GOOD WAY) K_CV112[1].DEST4 /	CV112 TRACKING DATA DESTINATION VALUE=8 (CODE FOR SELECT THE GOOD WAY) TRACK_CV112[1].DEST8 /
2 TRACKING DATA INATION VALUE=4 E FOR SELECT THE GOOD WAY) K_CV112[1].DEST4 /	CV112 TRACKING DATA DESTINATION VALUE=8 (CODE FOR SELECT THE GOOD WAY) TRACK_CV112[1].DEST8 /
2 TRACKING DATA INATION VALUE=4 E FOR SELECT THE GOOD WAY) K_CV112[1].DEST4 /	CV112 TRACKING DATA DESTINATION VALUE=8 (CODE FOR SELECT THE GOOD WAY) TRACK_CV112[1].DEST8 /
2 TRACKING DATA INATION VALUE=4 E FOR SELECT THE GOOD WAY) K_CV112[1].DEST4 /	CV112 TRACKING DATA DESTINATION VALUE=8 (CODE FOR SELECT THE GOOD WAY) TRACK_CV112[1].DEST8 /

MASTER SEQUENCE
CV304

MOV
Source 100
Dest CV304_SEQUENCE 20

STEP 110
CART ON THE ENTRY CELL
THEN CONTINUE TO BACKWARD

MASTER SEQUENCE
CV304

EQU
Source A CV304_SEQUENCE 20
Source B 100


Dist.C/V Cart
Det.(Buffer CV)PH10
R24_DI03.2


CV304 STEP 2 IS DONE
CV304_STEP2_DONE

CV304 REDIFINE
POSTION TO ZERO
CV304_RDF_CD


MASTER SEQUENCE
CV304

MOV
Source 110
Dest CV304_SEQUENCE 20

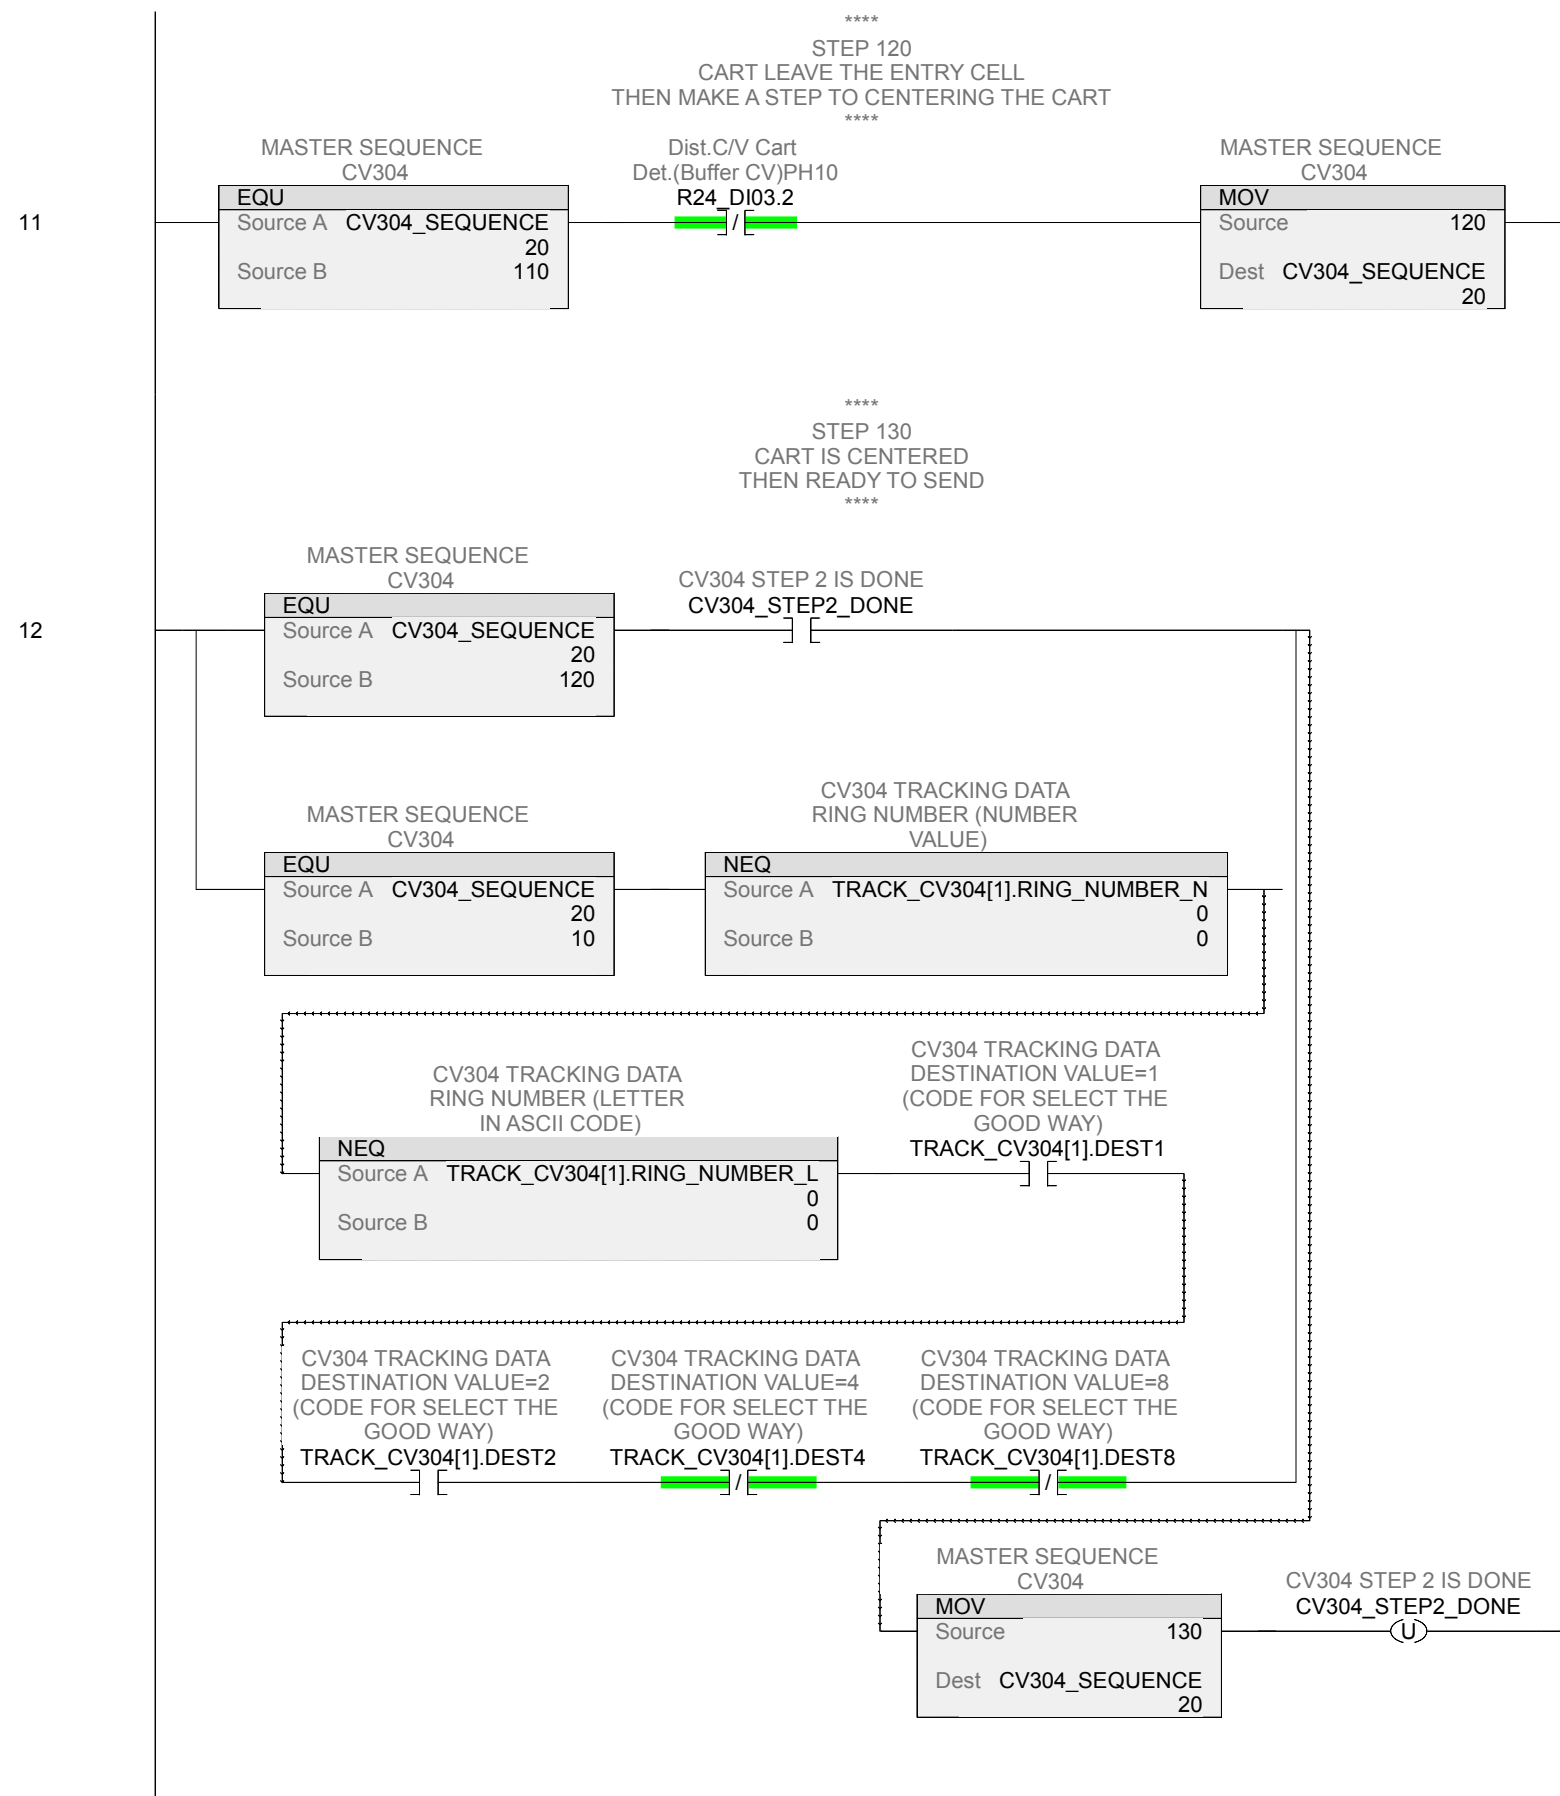


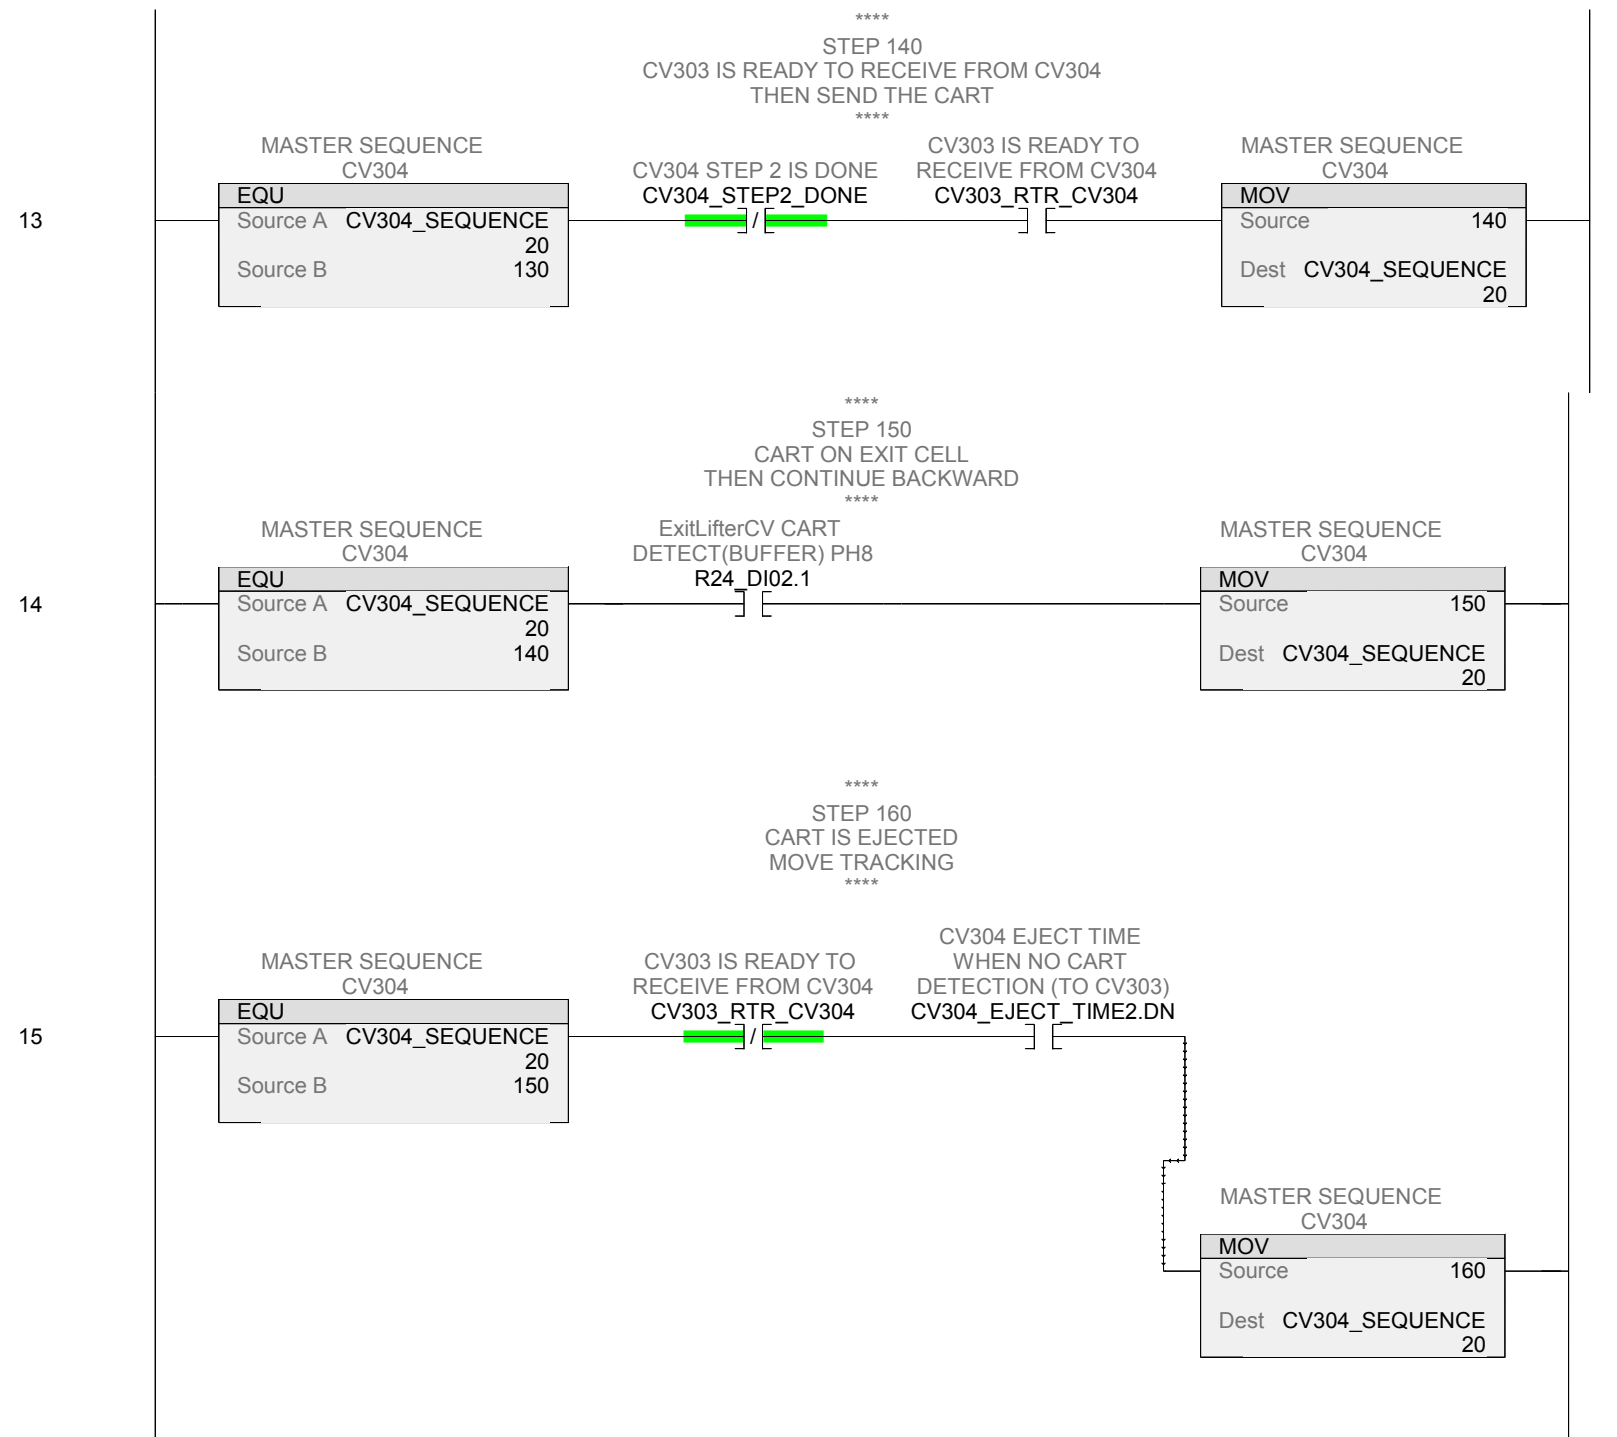


16

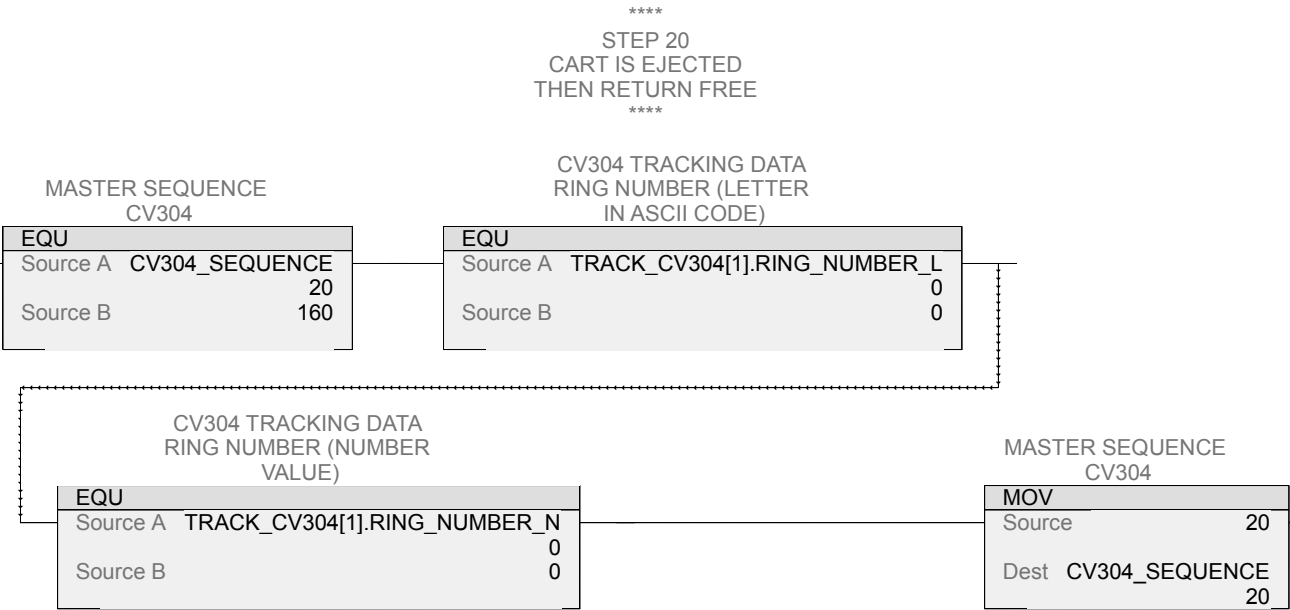

17

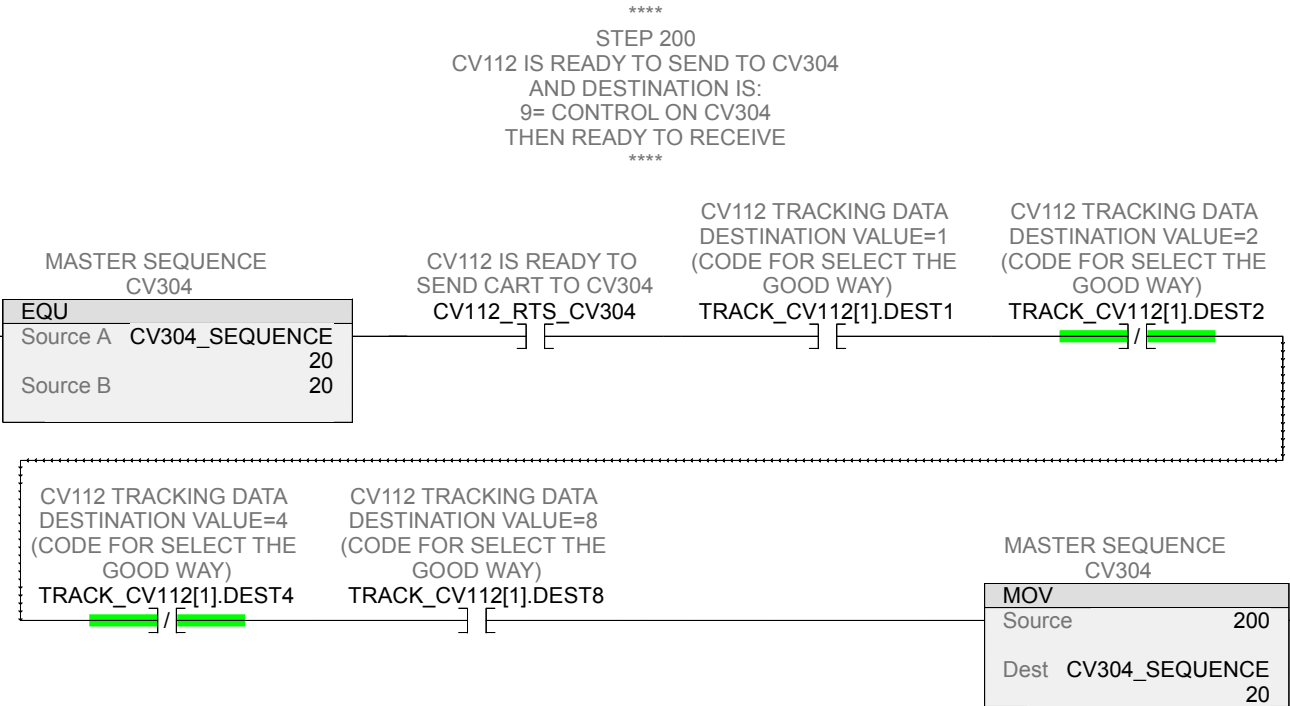

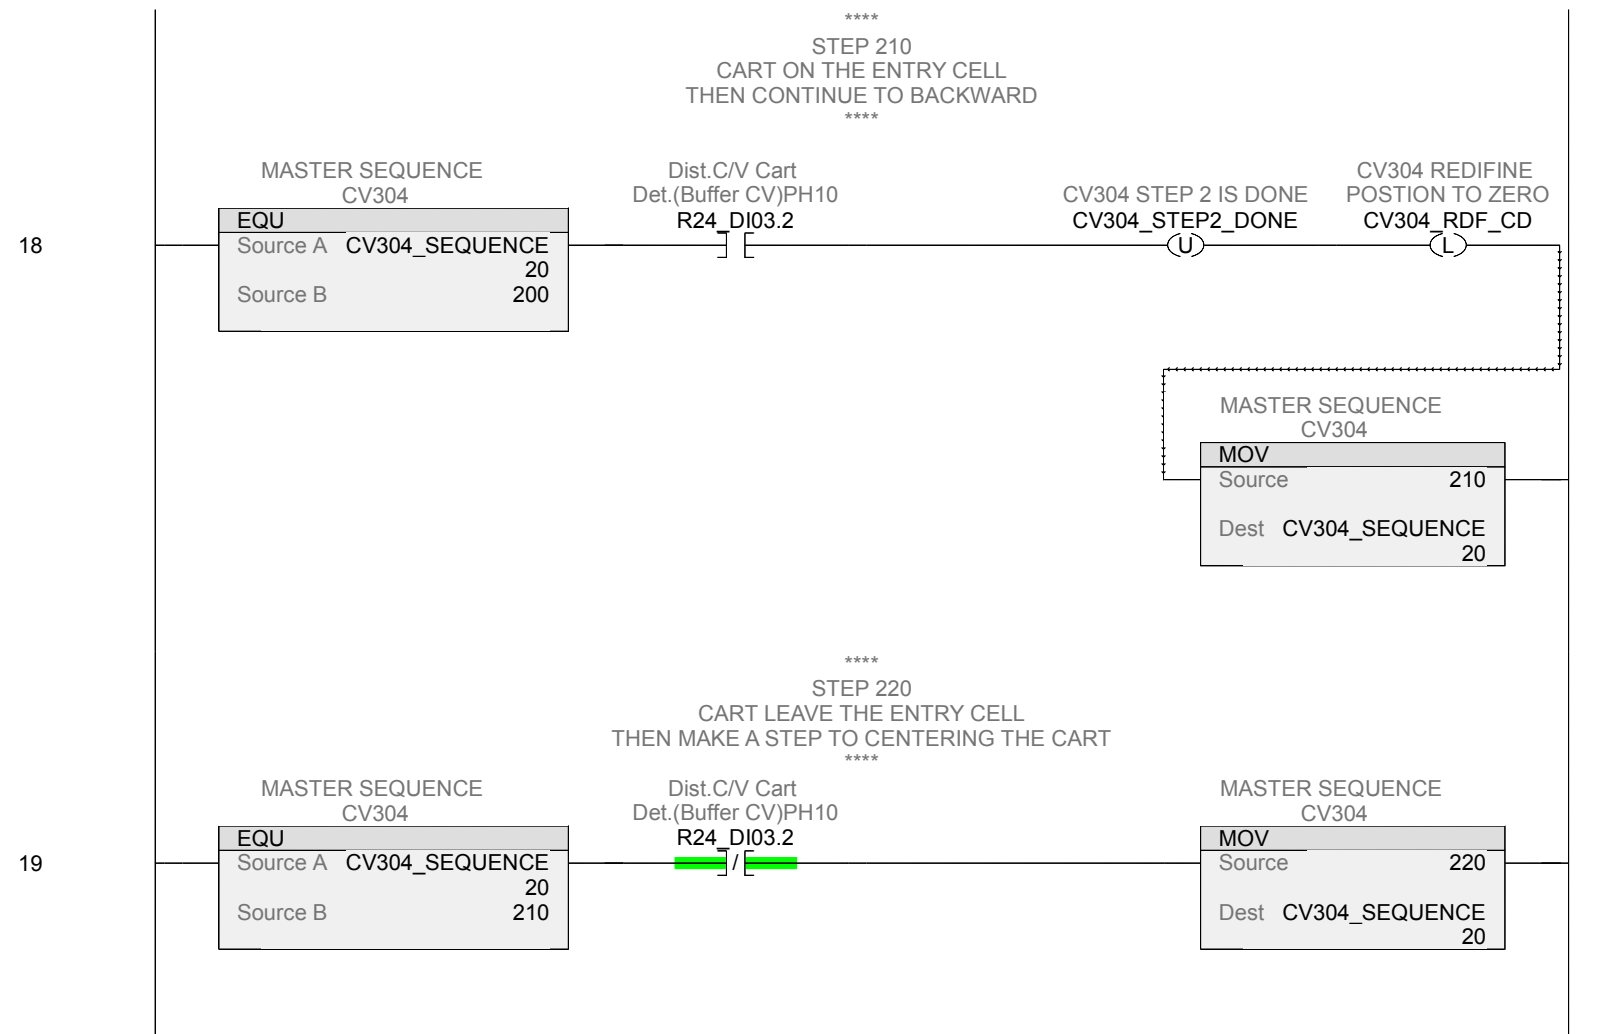

20

STEP 230
CART IS CENTERED
THEN CART IS READY FOR CONTROL

MASTER SEQUENCE
CV304

EQU	
Source A	CV304_SEQUENCE 20
Source B	220

CV304 STEP 2 IS DONE
CV304_STEP2_DONE

MASTER SEQUENCE
CV304

EQU	
Source A	CV304_SEQUENCE 20
Source B	10

CV304 TRACKING DATA
RING NUMBER (LETTER
IN ASCII CODE)

NEQ	
Source A	TRACK_CV304[1].RING_NUMBER_L 0
Source B	0

CV304 TRACKING DATA
RING NUMBER (NUMBER
VALUE)

NEQ	
Source A	TRACK_CV304[1].RING_NUMBER_N 0
Source B	0

MODE SELECTED IS
CHANGE PROD ON STOCK

1


MODE_EXCHANGE_PROD_STOCK1


MASTER SEQUENCE
CV304

MOV	
Source	230
Dest	CV304_SEQUENCE 20


CV304 STEP 2 IS DONE
CV304_STEP2_DONE

(U)

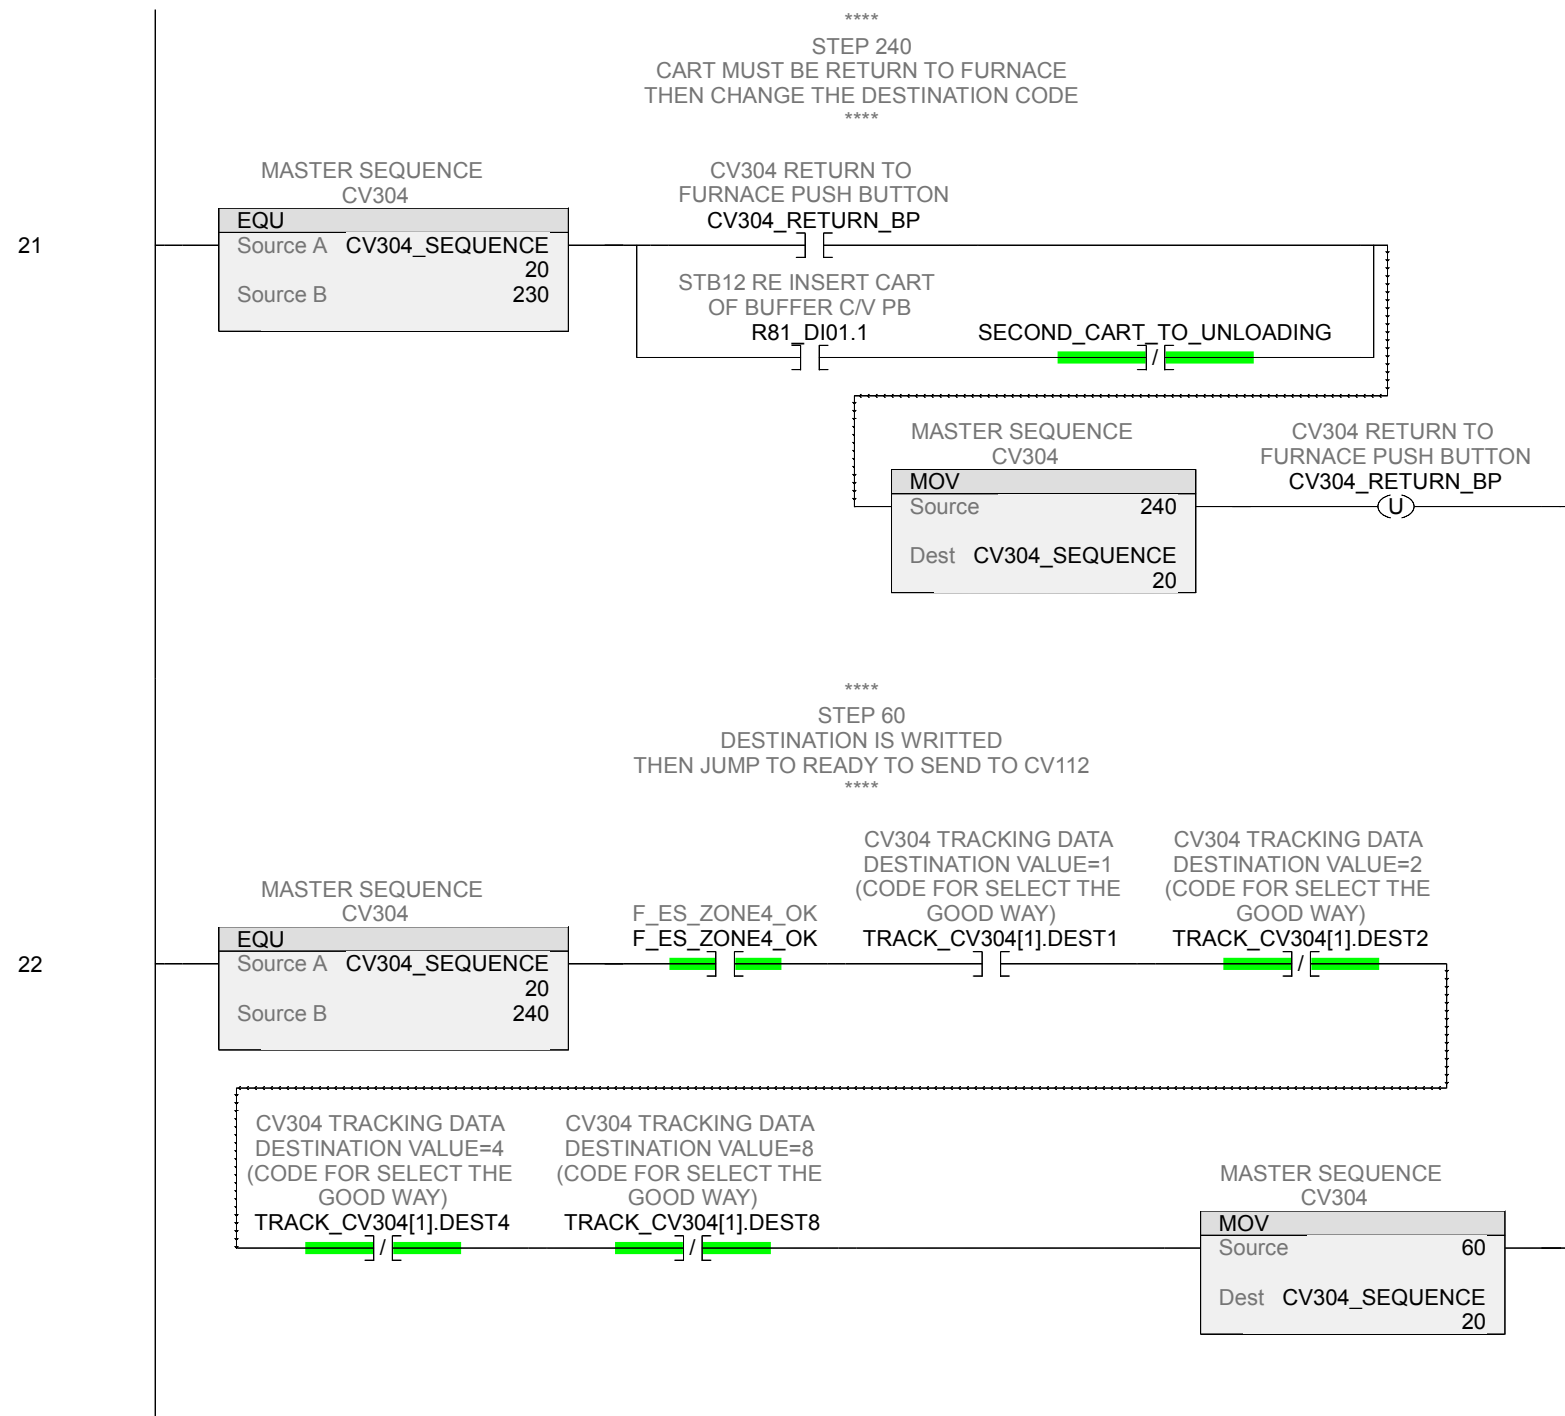


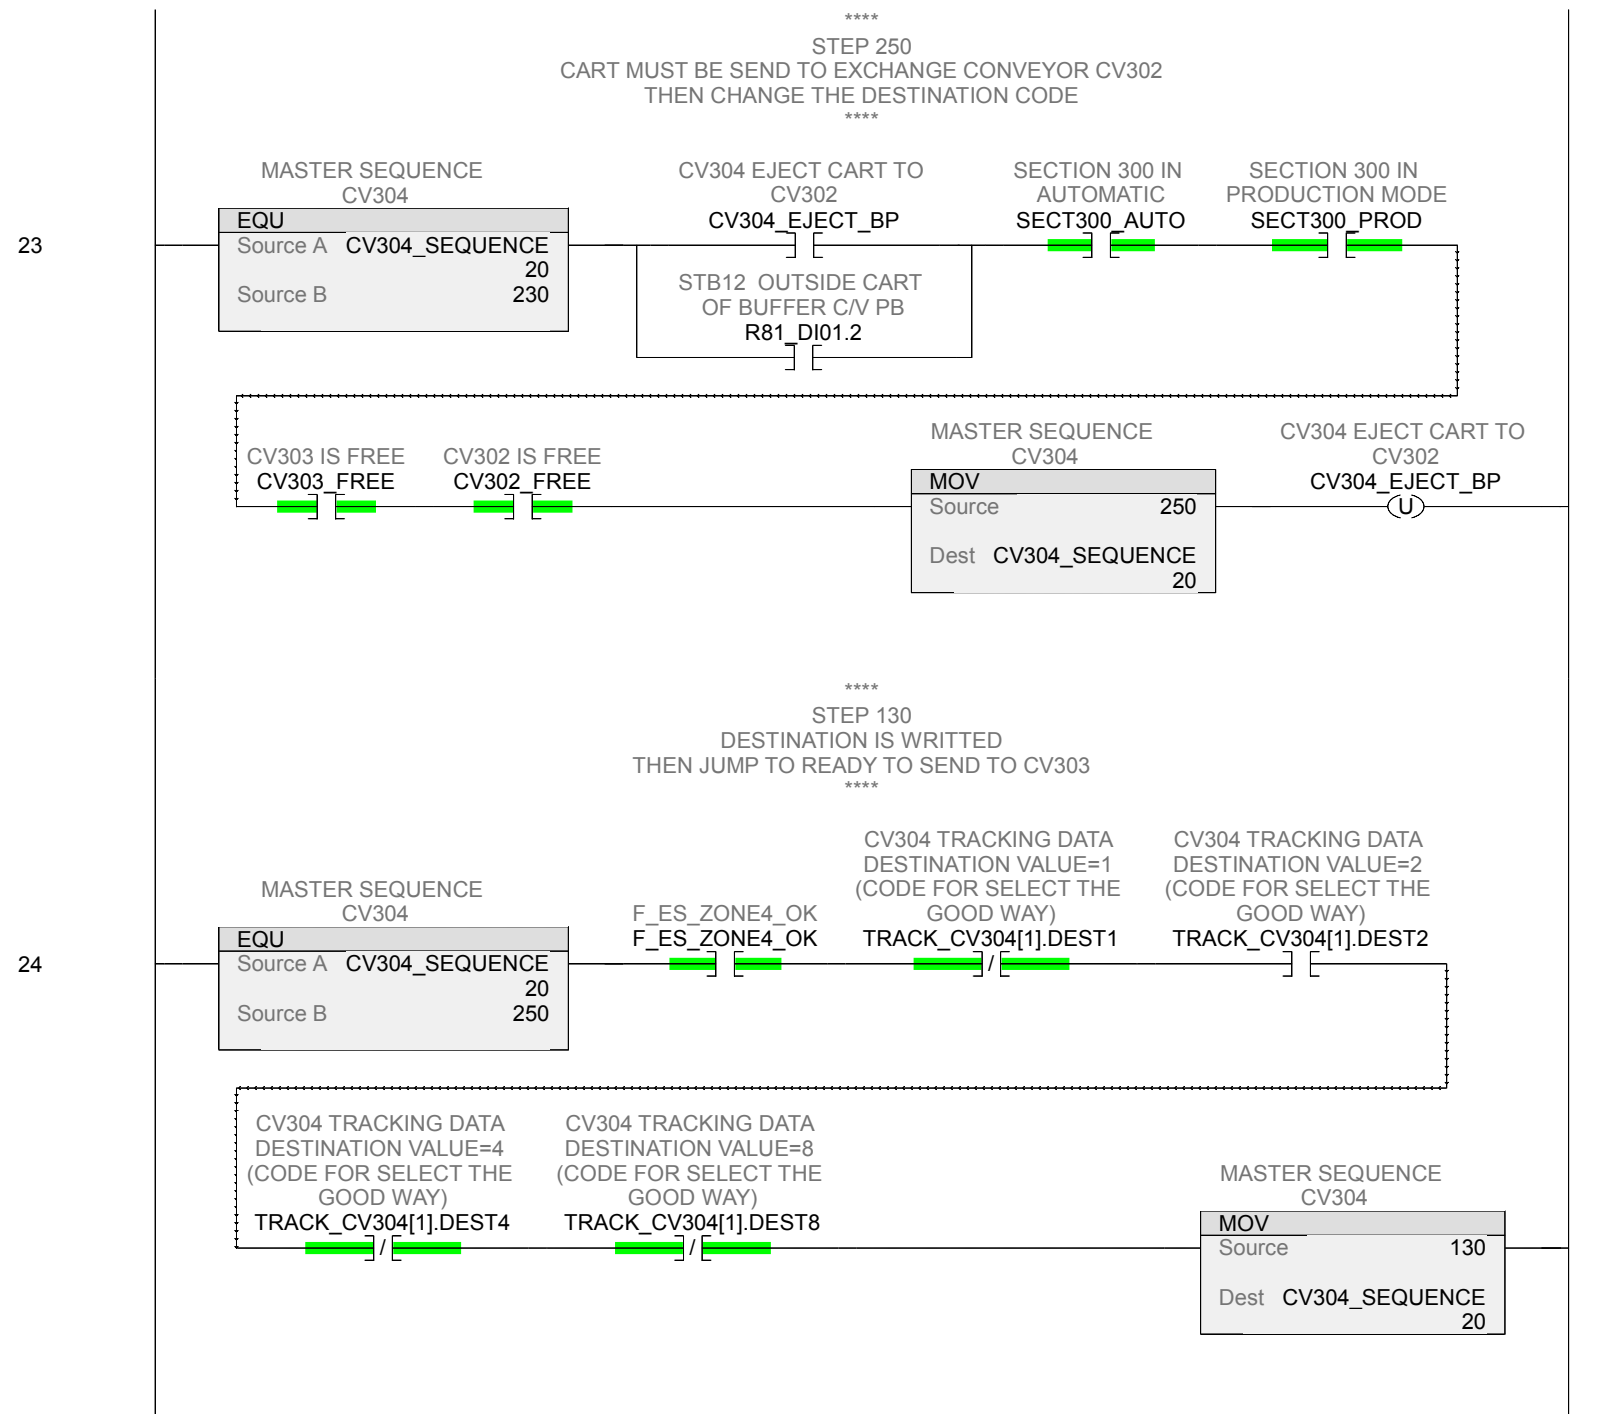



25

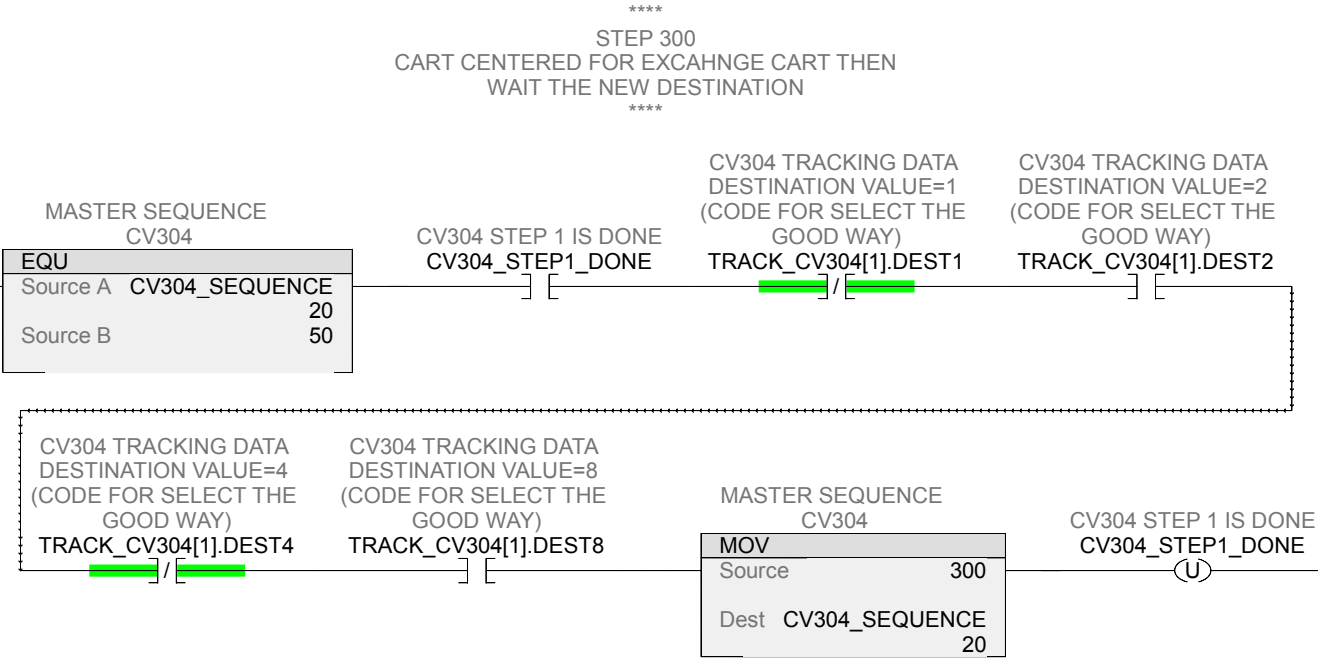



26

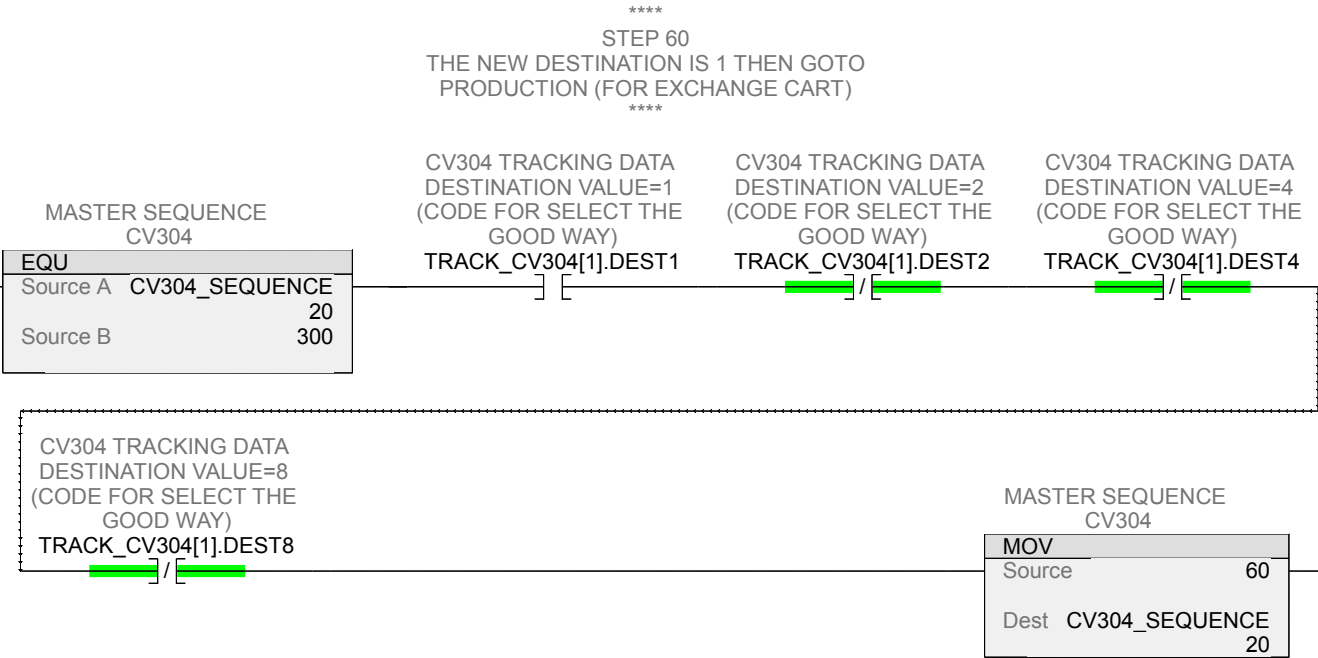


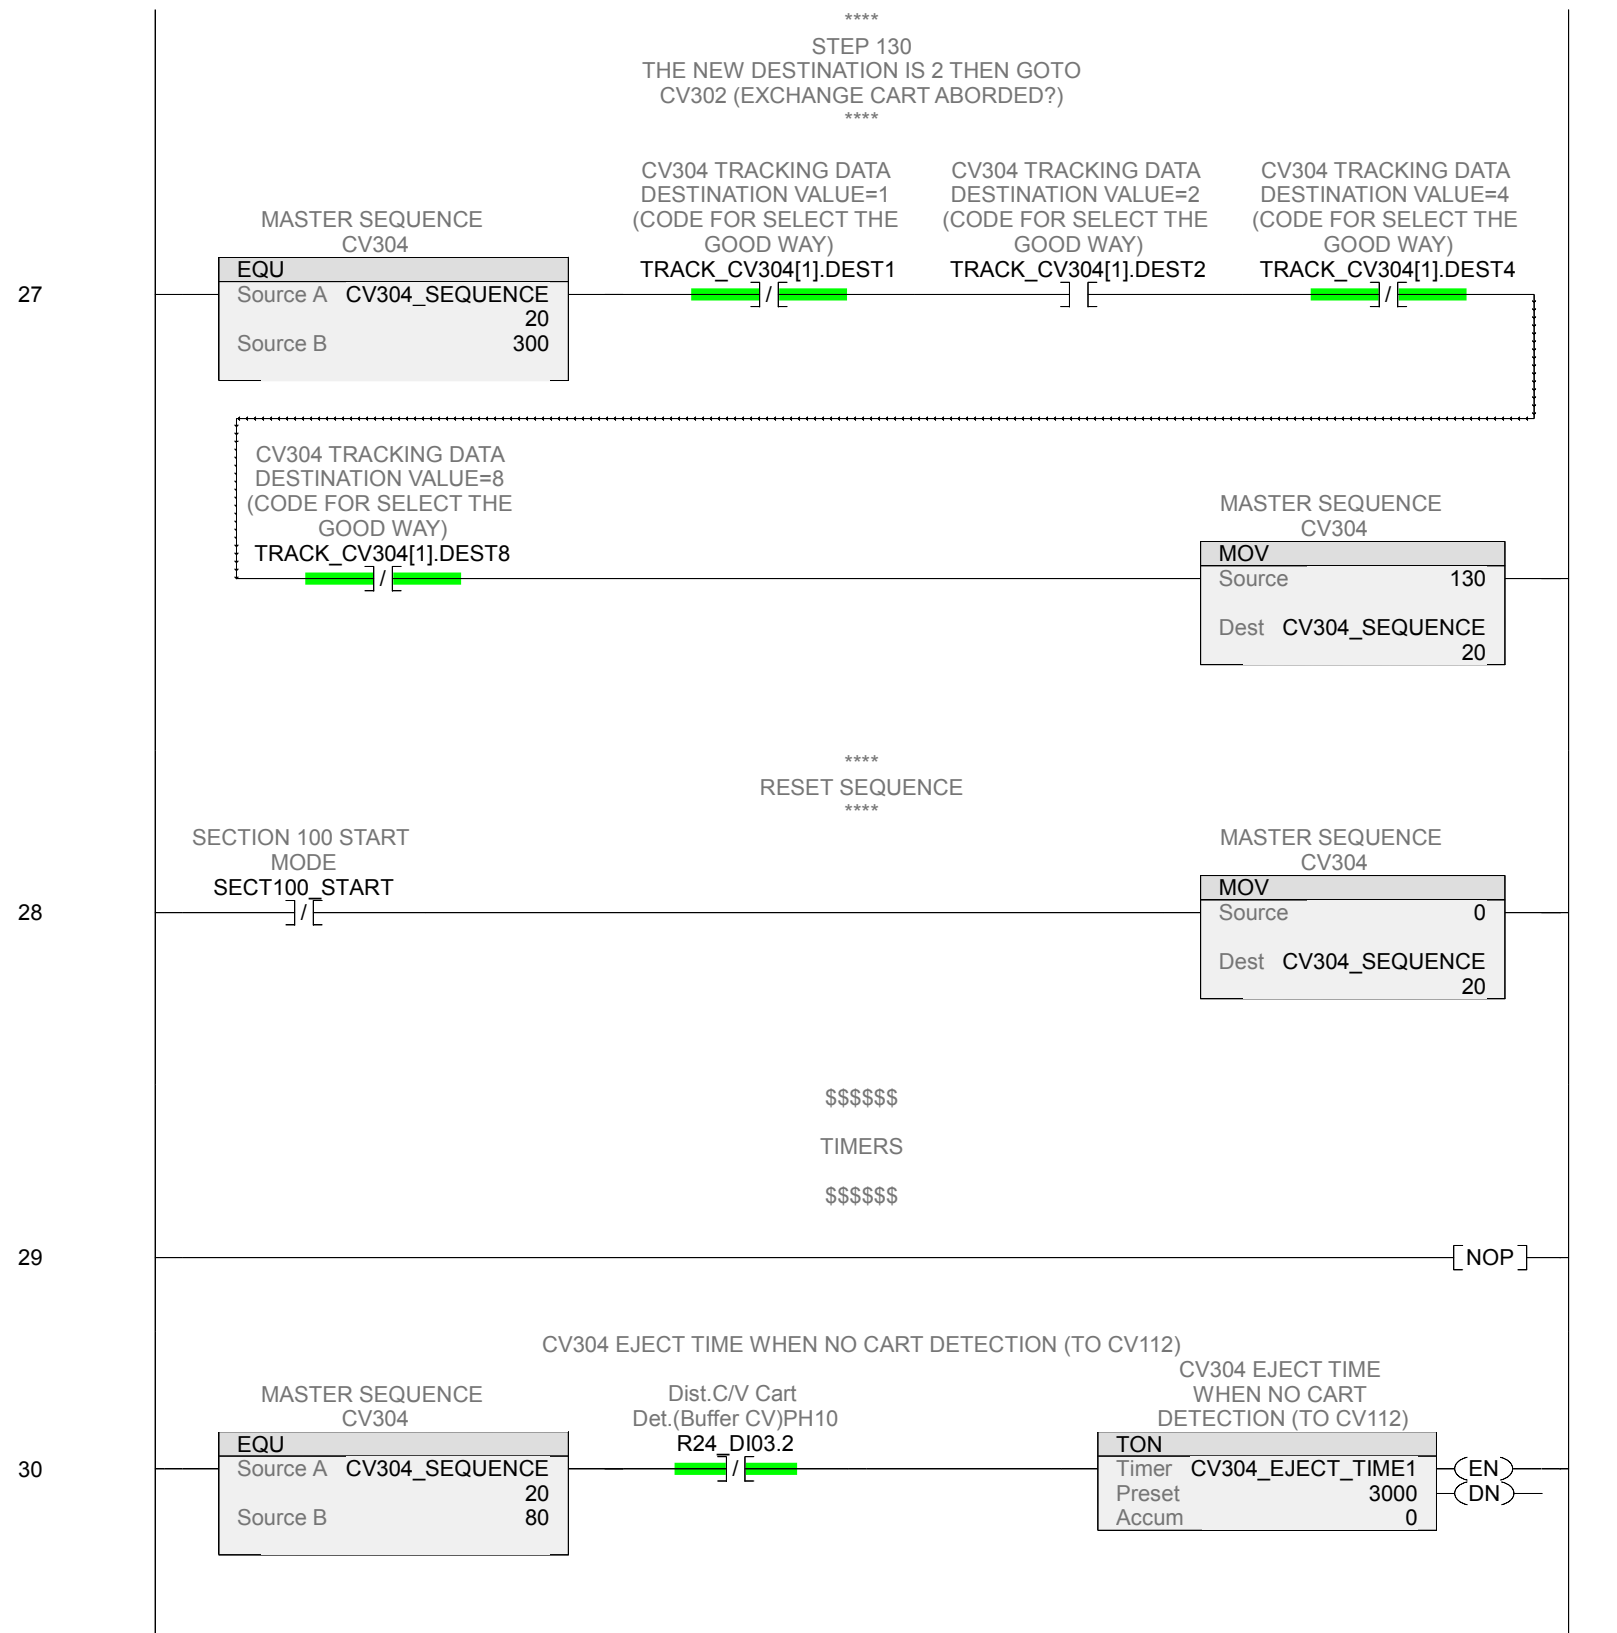


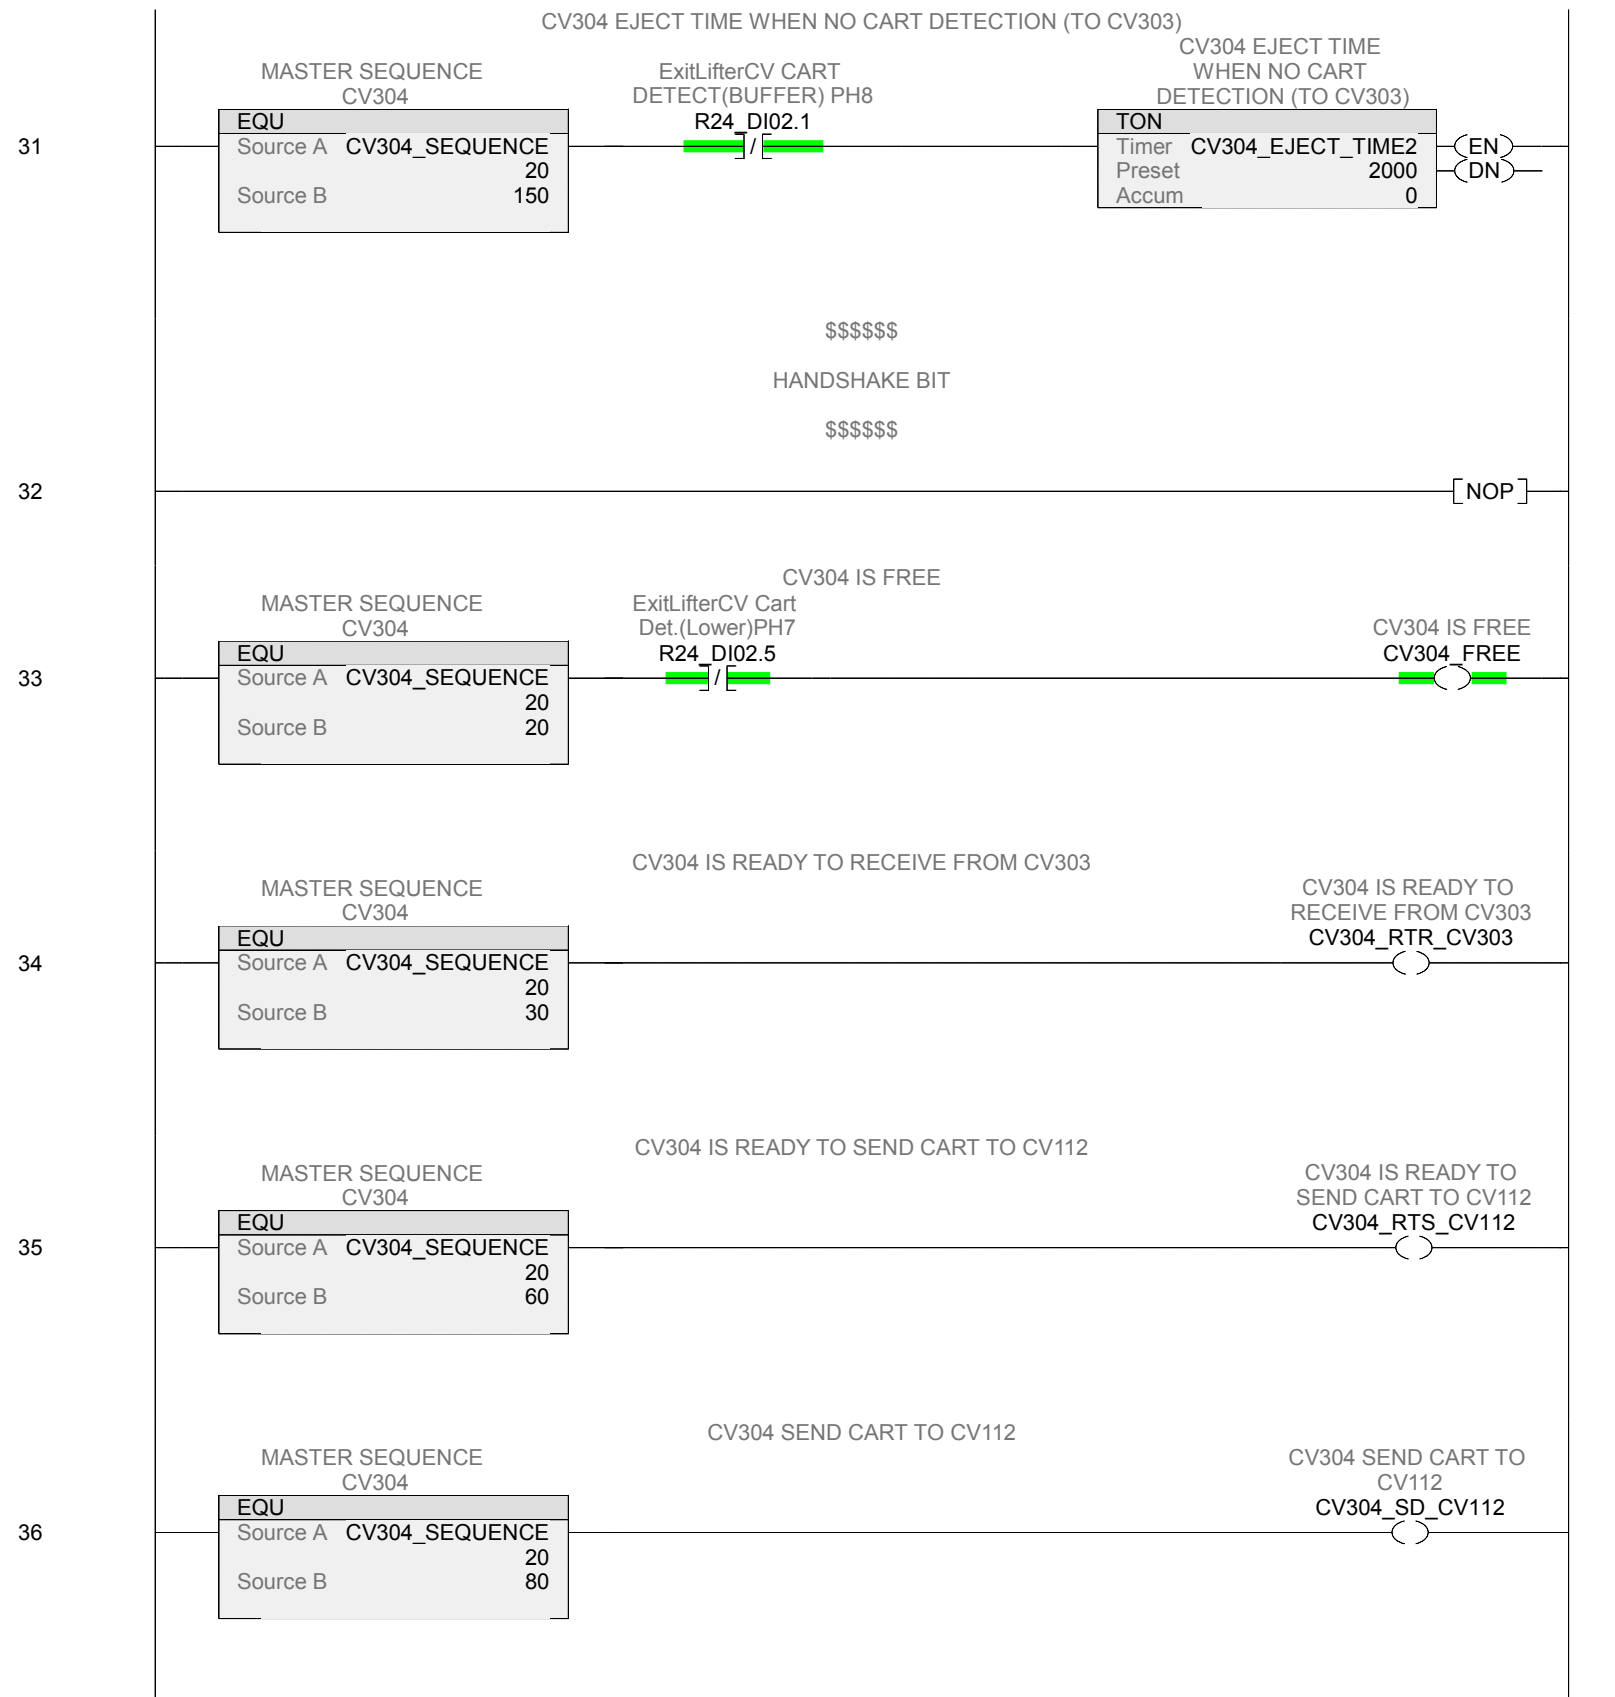

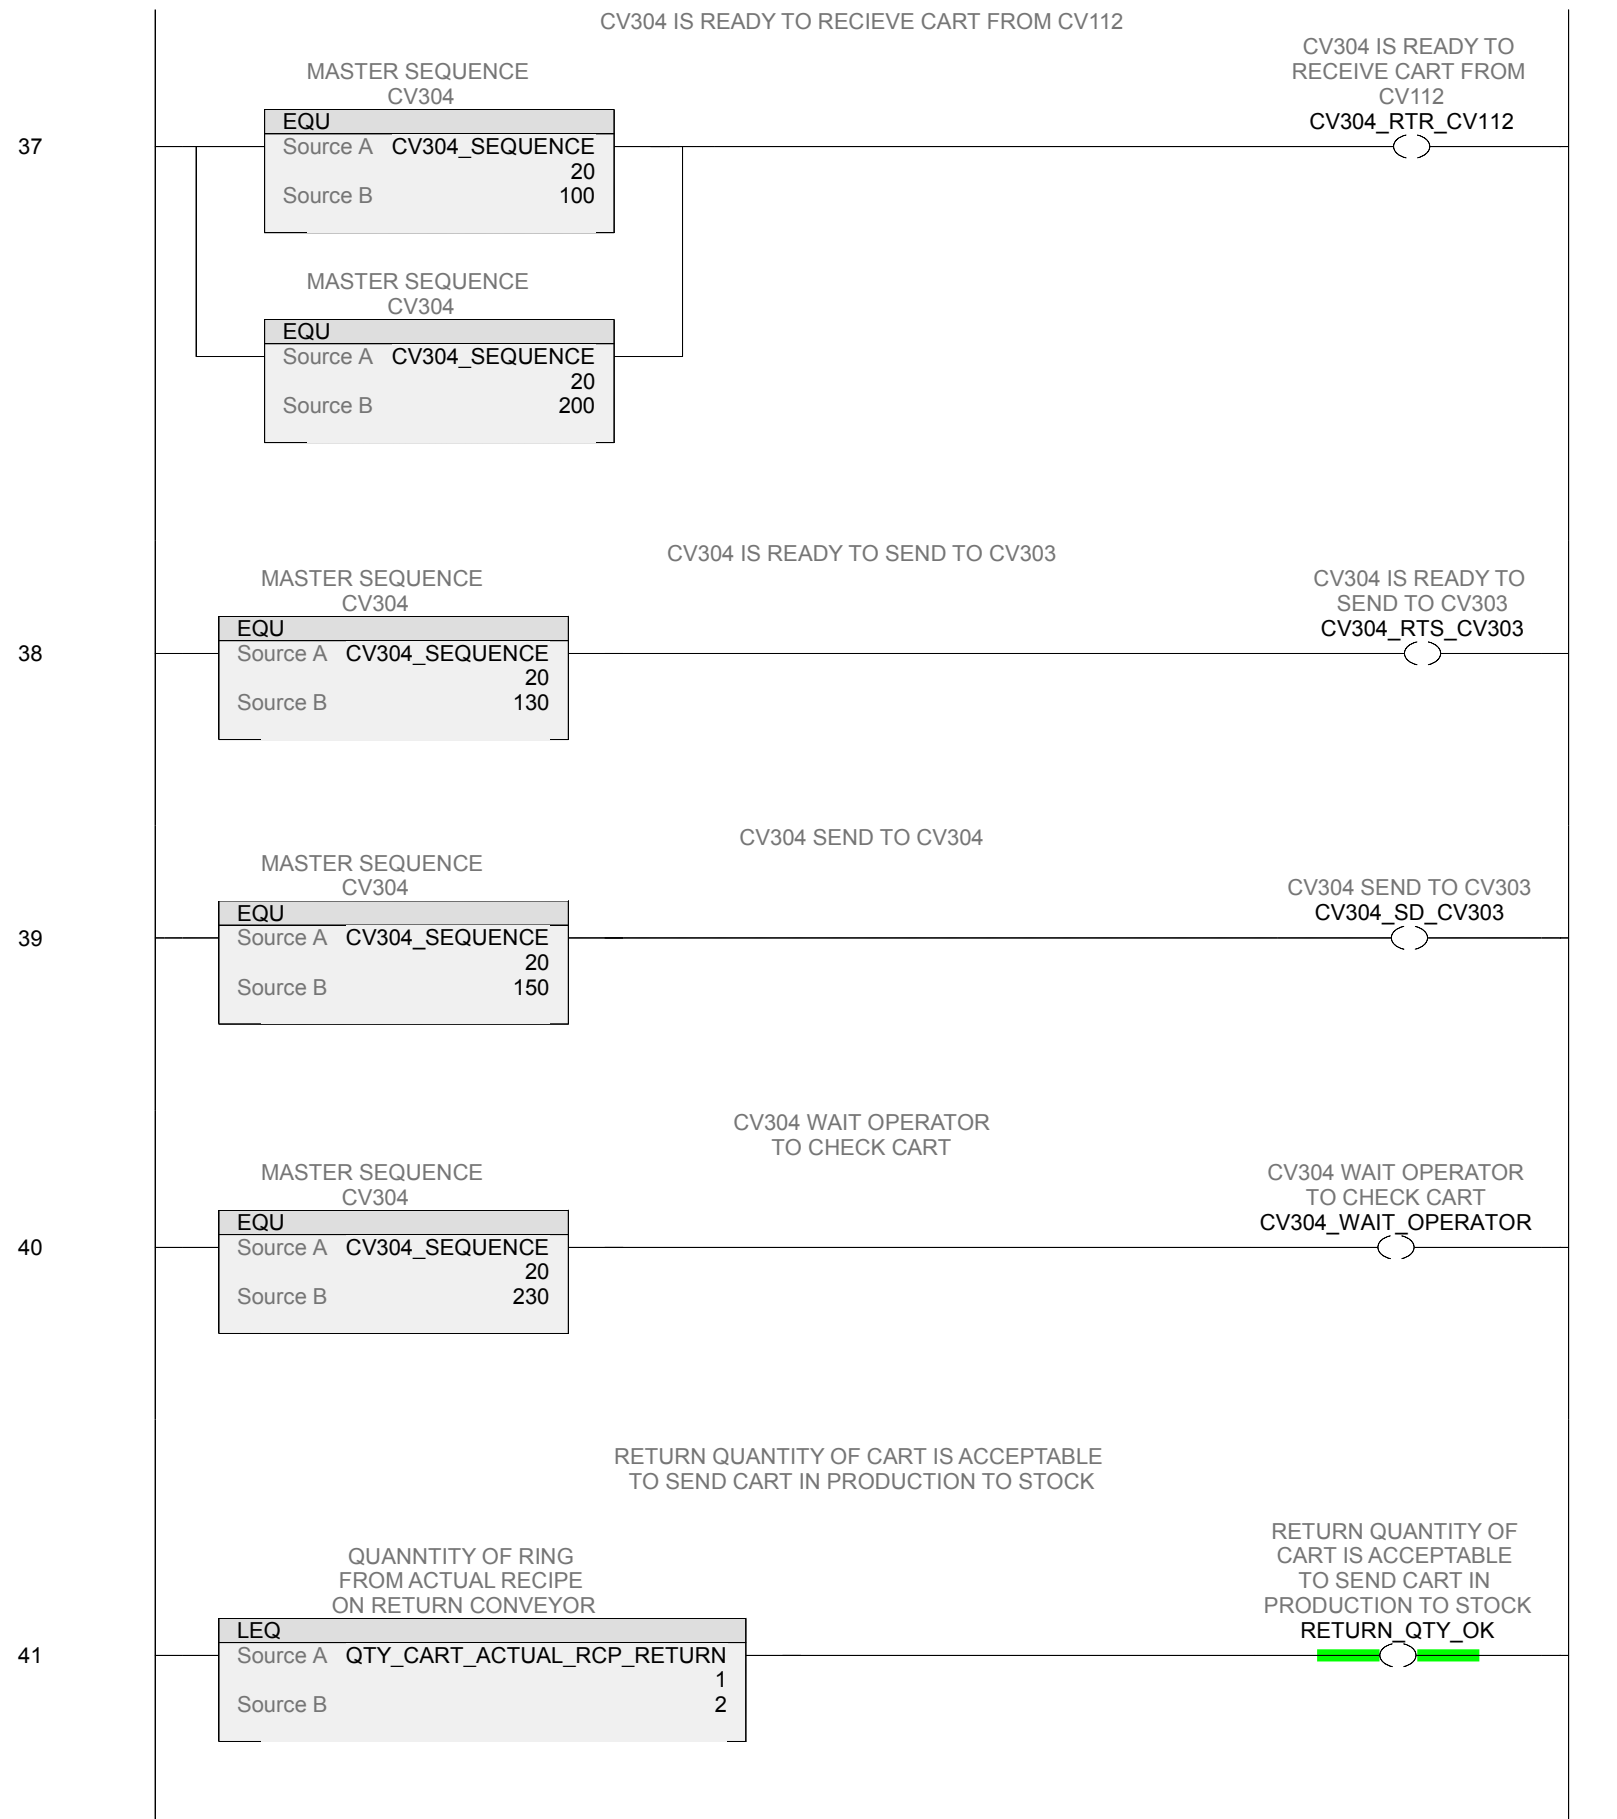

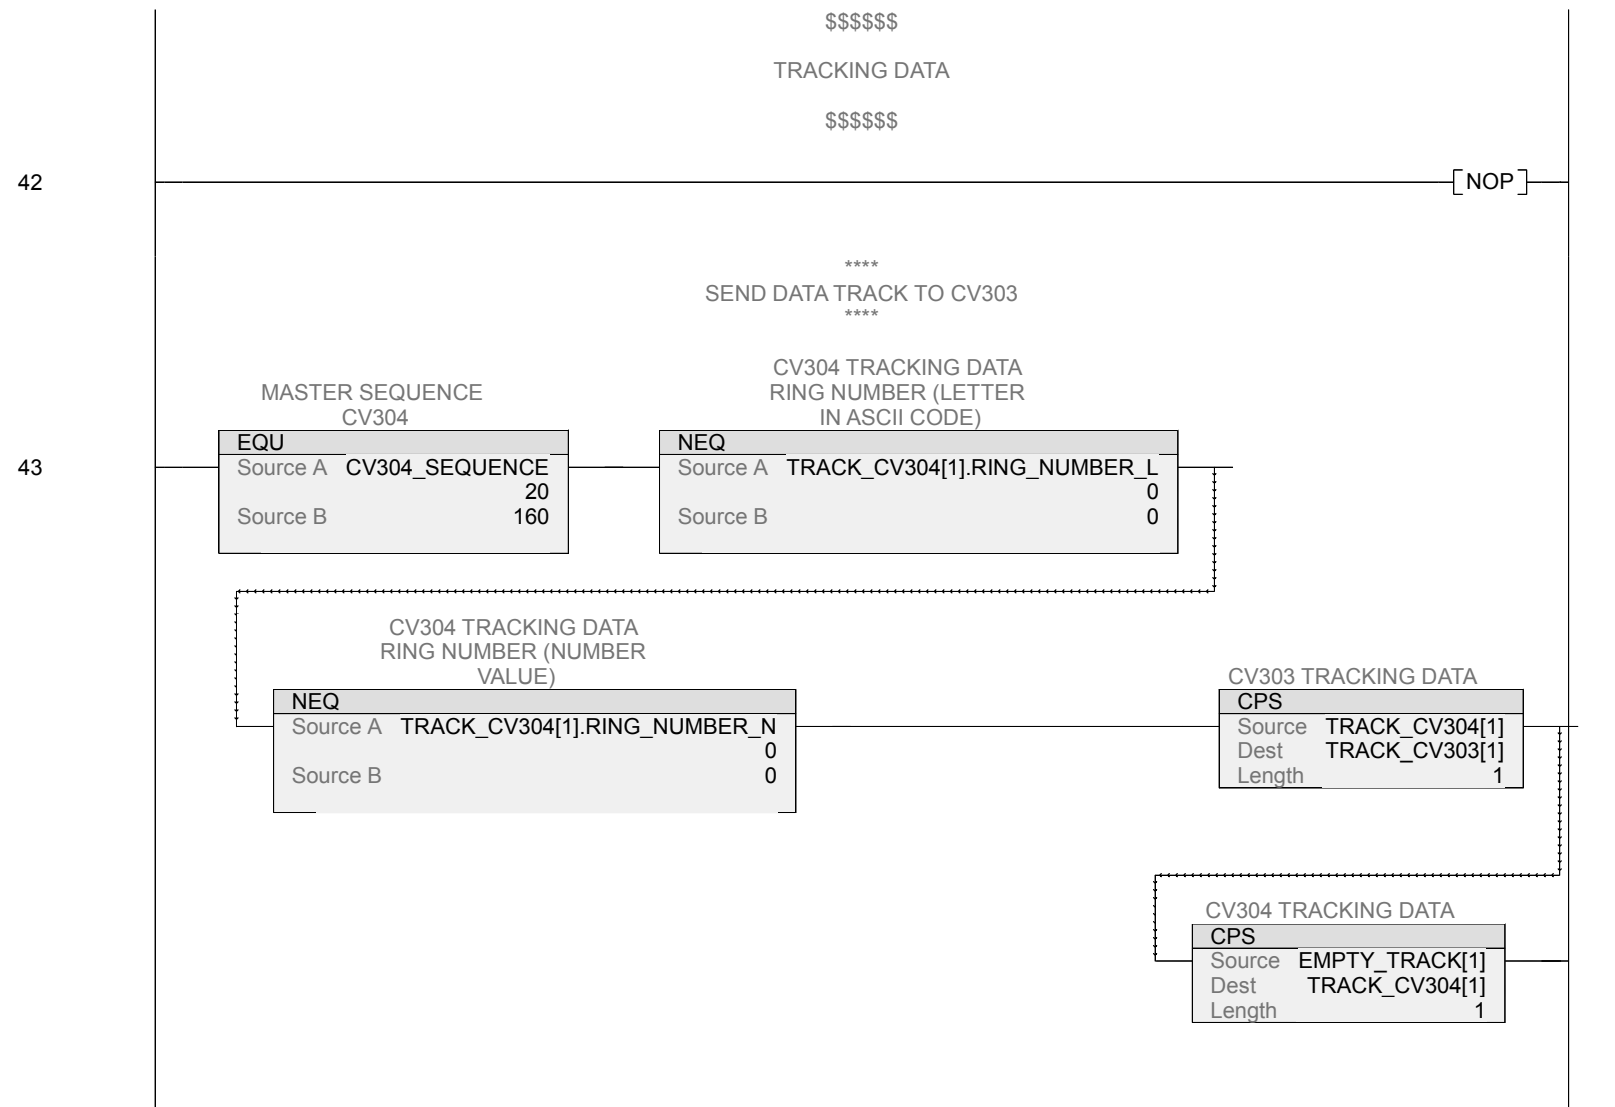

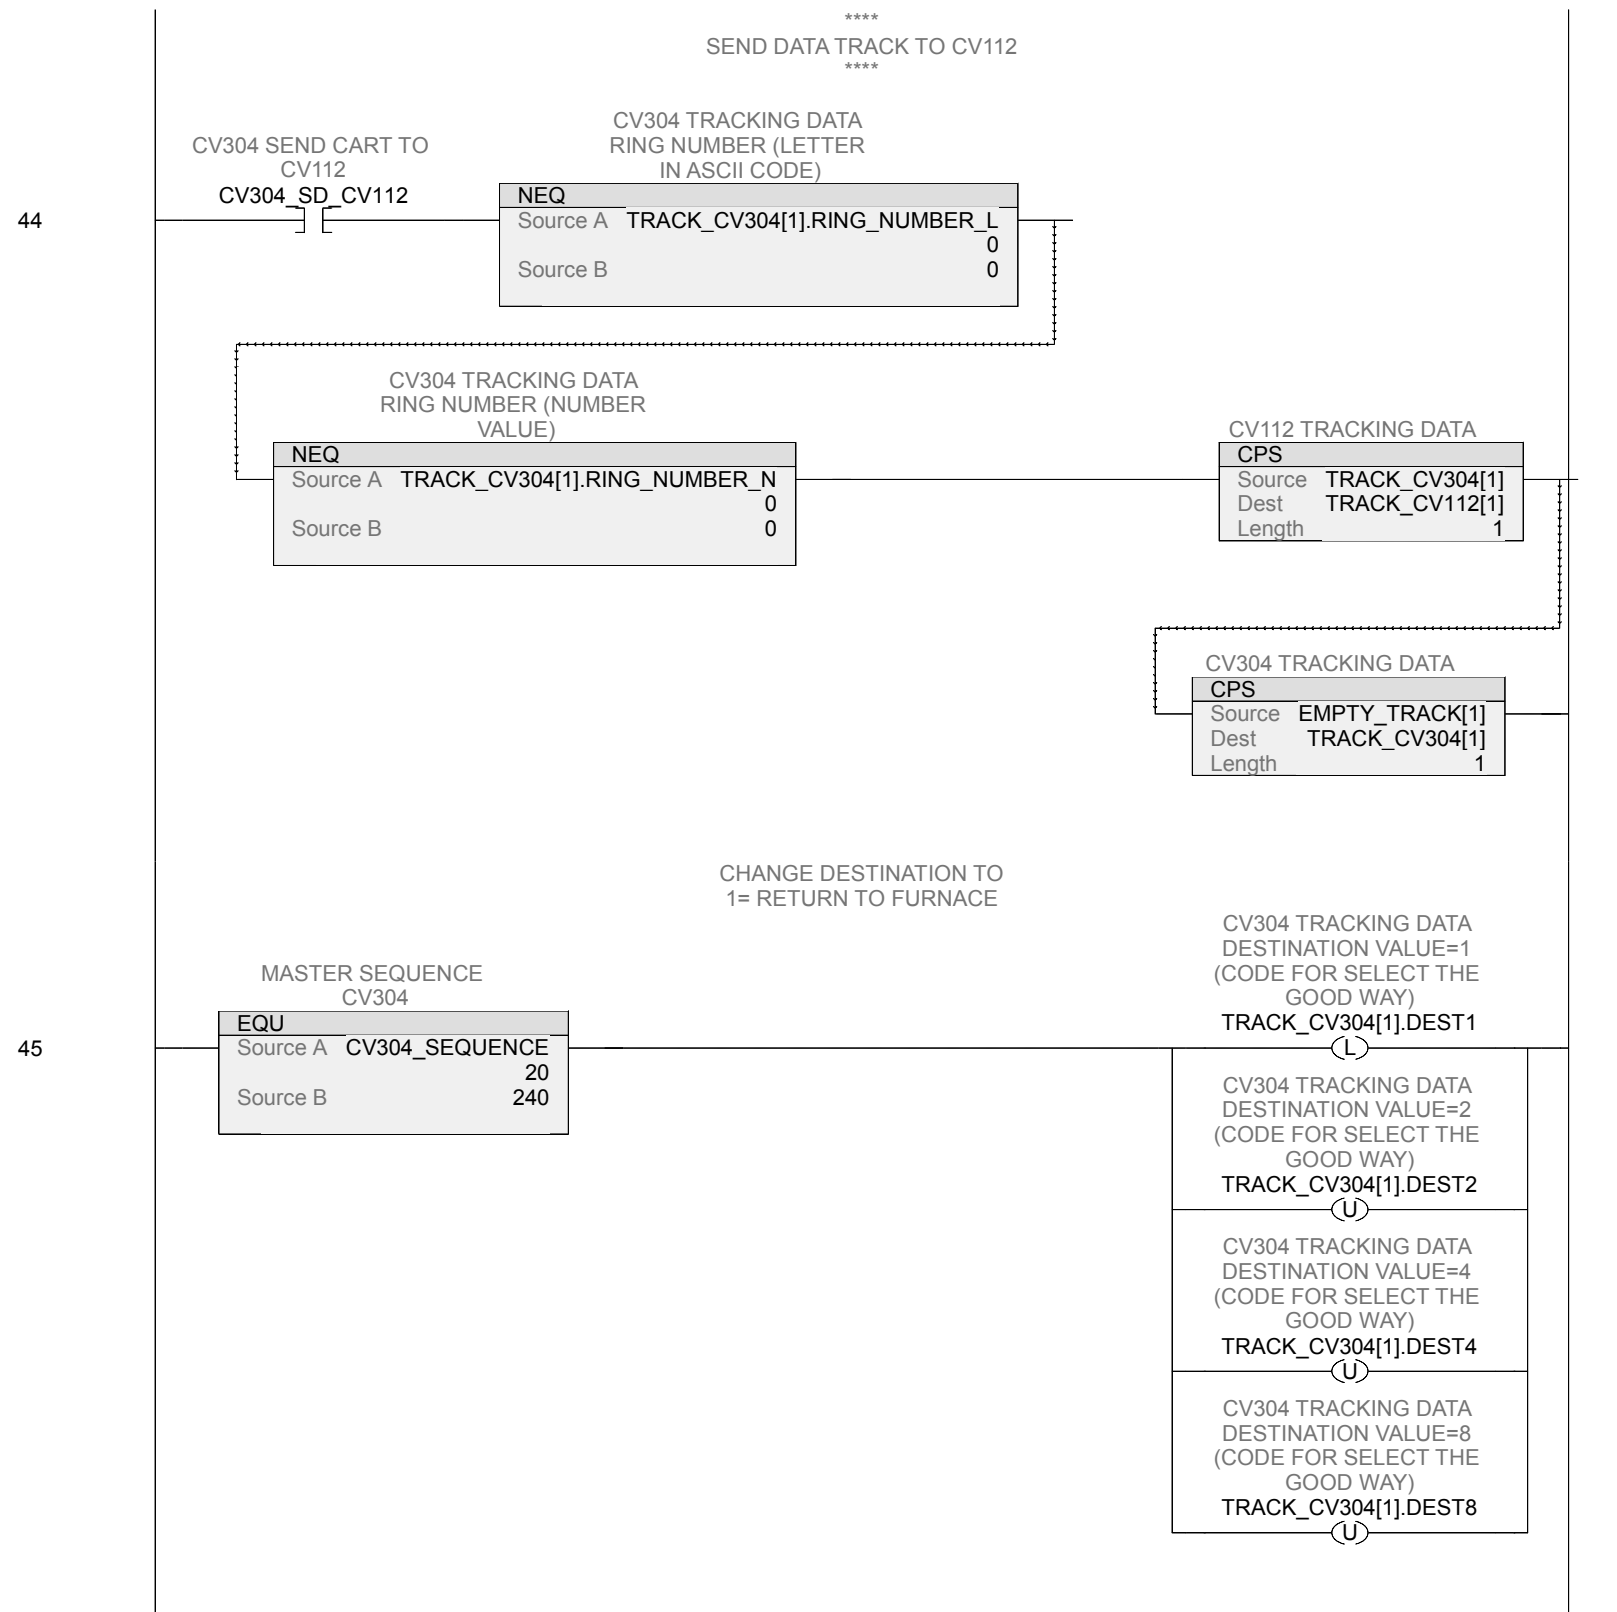

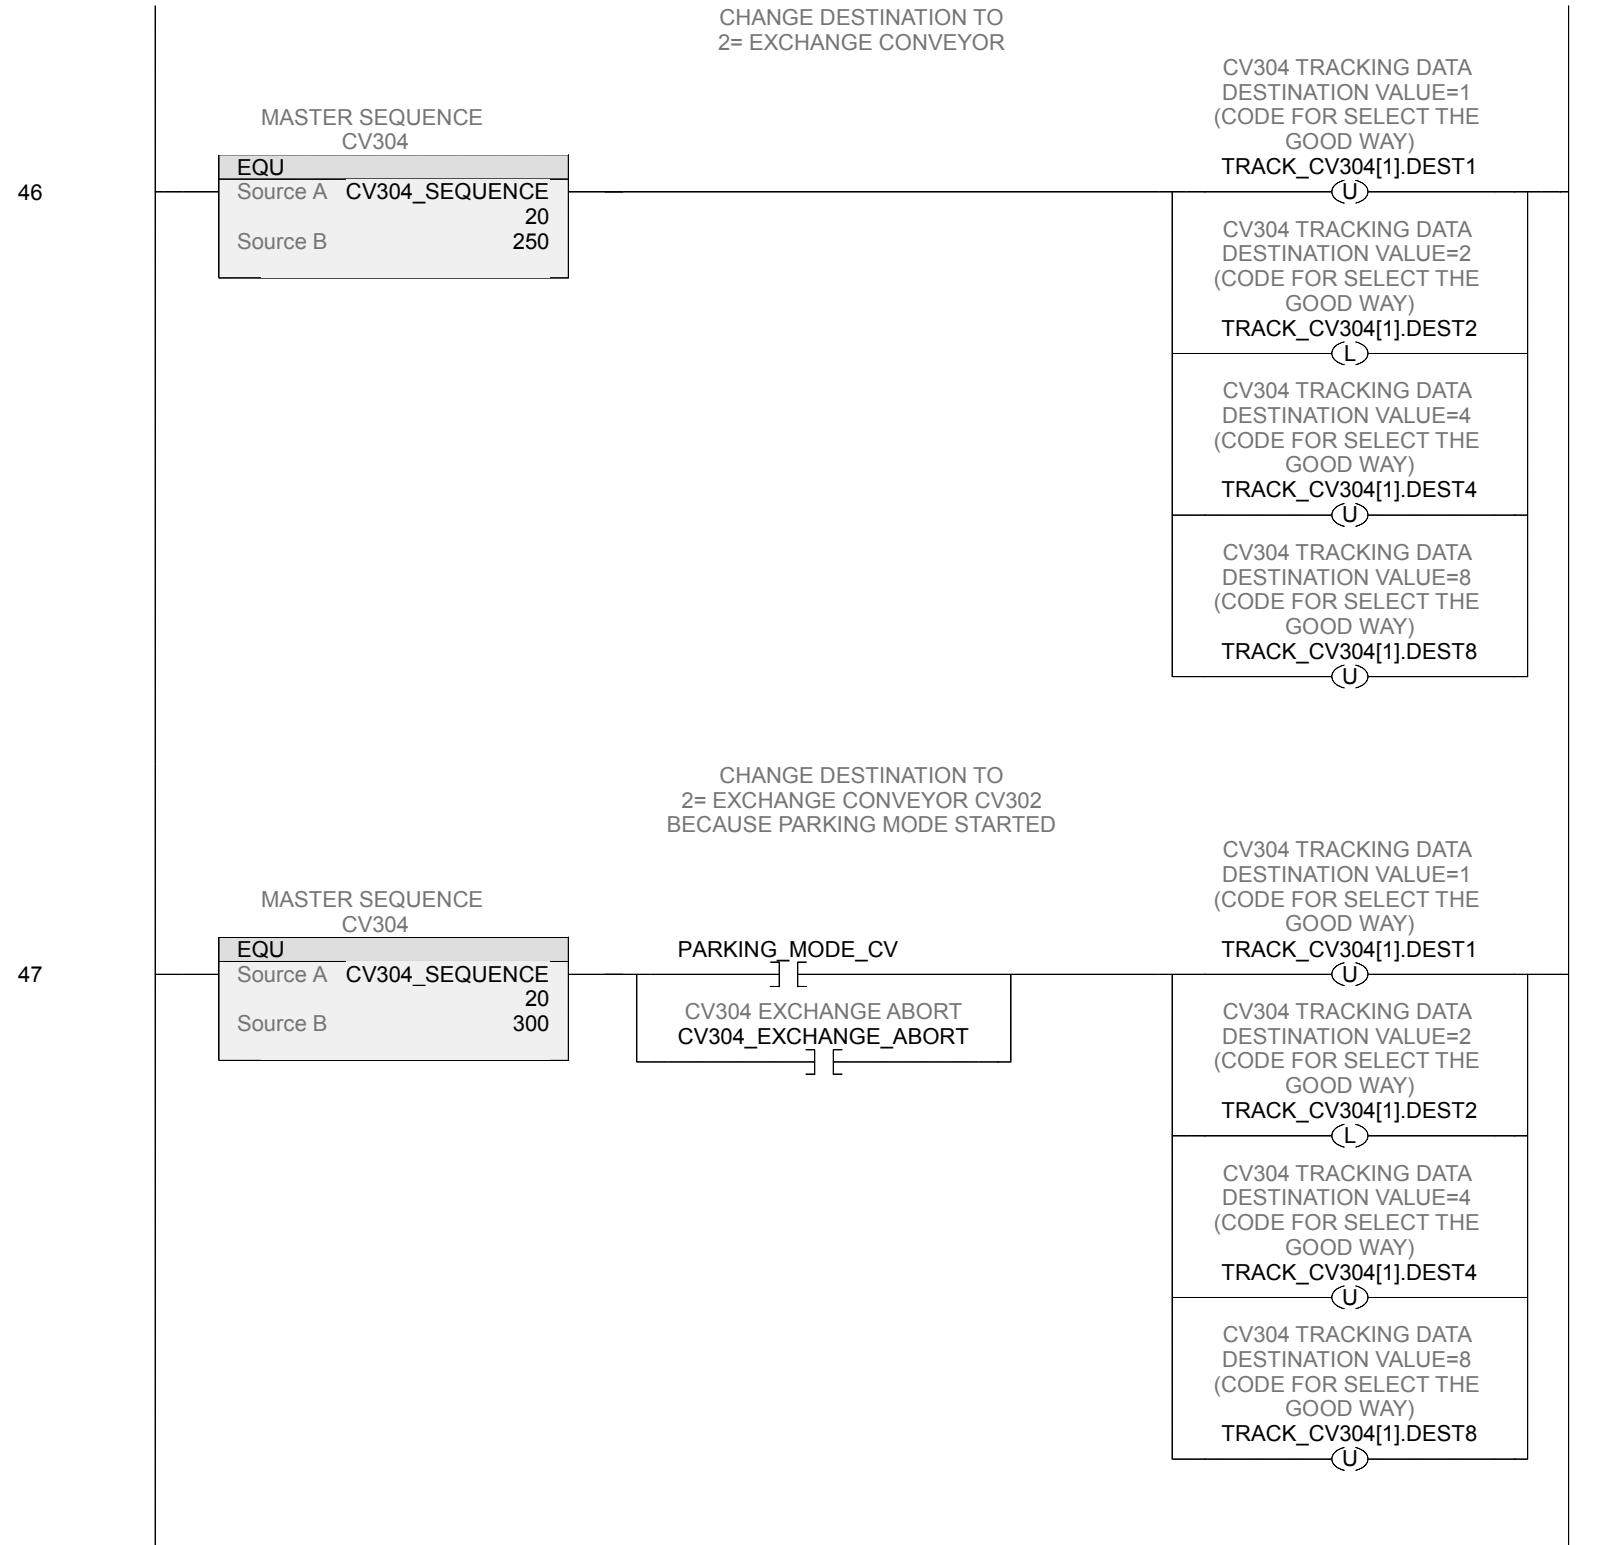

48

CHANGE DESTINATION TO
1= TO PRODUCTION
(CART TO EXCHANGE IS ON THE BRIDGE BR111)

MASTER SEQUENCE
CV304

EQU	
Source A	CV304_SEQUENCE
	20
Source B	300

CV112 IS FREE
CV112_FREE


BR111 TRACKING DATA
RING NUMBER (LETTER
IN ASCII CODE)

EQU	
Source A	TRACK_BR111[1].RING_NUMBER_L
	0
Source B	TRACK_EXCHANGE.RING_NUMBER_L
	0

BR111 TRACKING DATA
RING NUMBER (NUMBER
VALUE)

EQU	
Source A	TRACK_BR111[1].RING_NUMBER_N
	0
Source B	TRACK_EXCHANGE.RING_NUMBER_N
	0

CV112 EXCHANGE CART
IN COURSE
CV112_EXCHANGE_CART

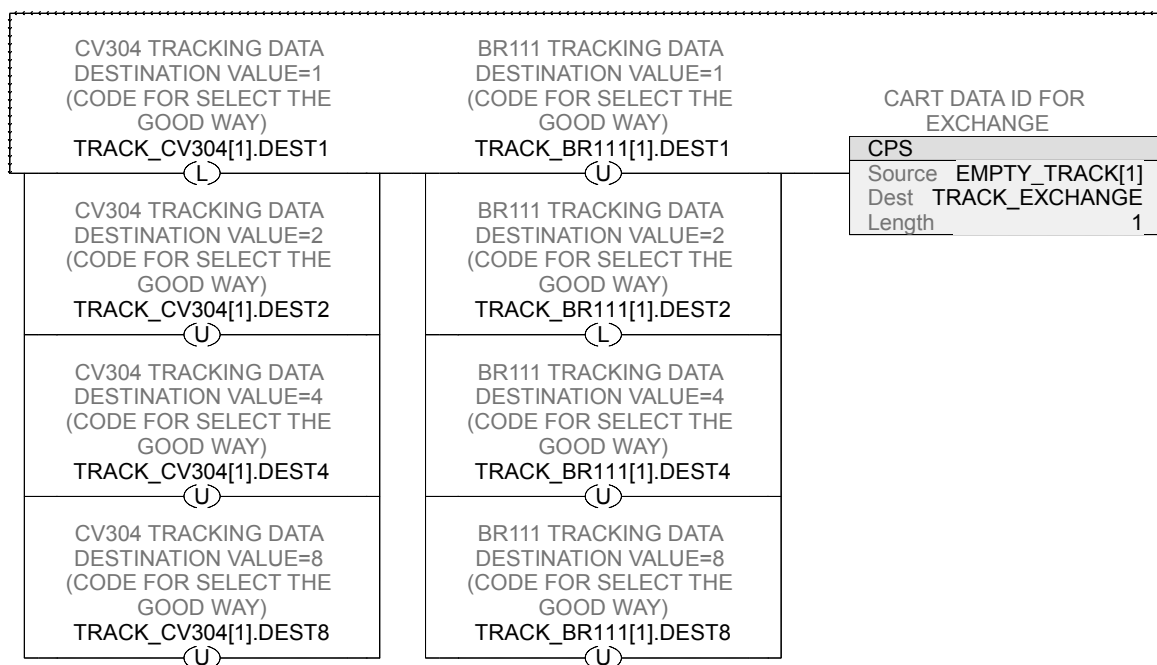

MODE_CART_EXCHANGE MODE_CART_EXCHANGE_TRACKING_VALIDATED

CV304 TRACKING DATA
RING NUMBER (LETTER
IN ASCII CODE)

NEQ	
Source A	TRACK_CV304[1].RING_NUMBER_L
	0
Source B	0

CV304 TRACKING DATA
RING NUMBER (NUMBER
VALUE)

NEQ	
Source A	TRACK_CV304[1].RING_NUMBER_N
	0
Source B	0

CV304 TRACKING DATA
FIRST ROUND IS DONE
TRACK_CV304[1].FIRST_ROUND

49

