1. Description


1.1. Project

Project Name	STM32F103C8x
Board Name	STM32F103C8x
Generated with:	STM32CubeMX 5.4.0
Date	01/13/2020

1.2. MCU

MCU Series	STM32F1
MCU Line	STM32F103
MCU name	STM32F103C8Tx
MCU Package	LQFP48
MCU Pin number	48

2. Pinout Configuration

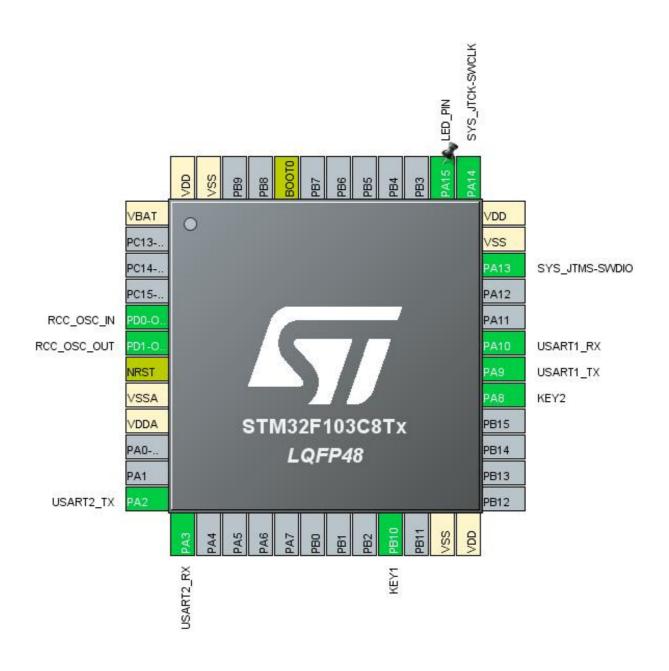


3. Pins Configuration

Pin Number LQFP48	Pin Name (function after reset)	Pin Type	Alternate Function(s)	Label
1	VBAT	Power		
5	PD0-OSC_IN	I/O	RCC_OSC_IN	
6	PD1-OSC_OUT	I/O	RCC_OSC_OUT	
7	NRST	Reset		
8	VSSA	Power		
9	VDDA	Power		
12	PA2	I/O	USART2_TX	
13	PA3	I/O	USART2_RX	
21	PB10 *	I/O	GPIO_Input	KEY1
23	VSS	Power		
24	VDD	Power		
29	PA8 *	I/O	GPIO_Input	KEY2
30	PA9	I/O	USART1_TX	
31	PA10	I/O	USART1_RX	
34	PA13	I/O	SYS_JTMS-SWDIO	
35	VSS	Power		
36	VDD	Power		
37	PA14	I/O	SYS_JTCK-SWCLK	
38	PA15 *	I/O	GPIO_Output	LED_PIN
44	BOOT0	Boot		
47	VSS	Power		
48	VDD	Power		

^{*} The pin is affected with an I/O function

4. Clock Tree Configuration

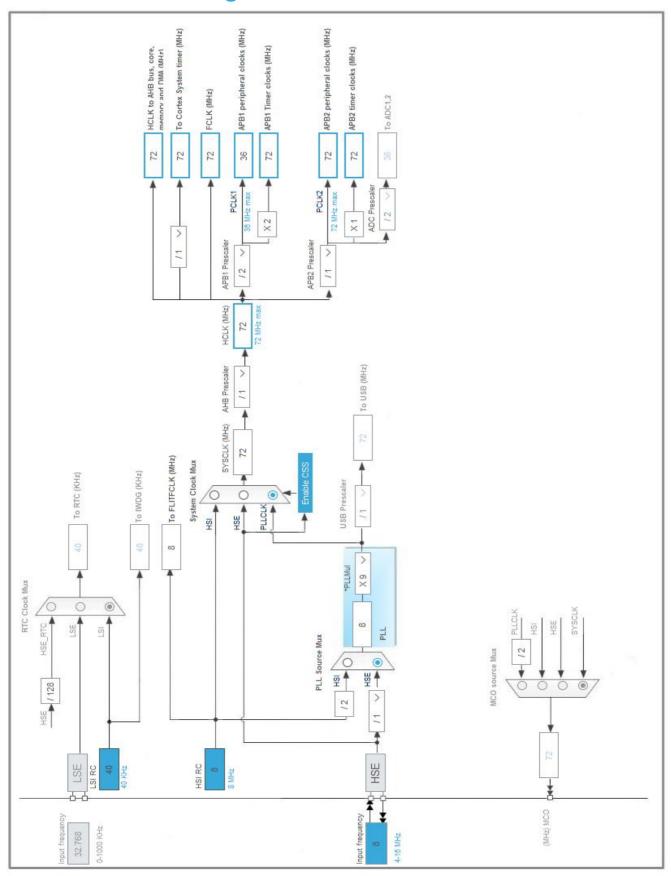

5. Software Project

5.1. Project Settings

Name	Value	
Project Name	STM32F103C8x	
Project Folder	C:\Users\Basums~b~q\Desktop\\TEMP	
Toolchain / IDE	MDK-ARM V5	
Firmware Package Name and Version	STM32Cube FW_F1 V1.6.0	

5.2. Code Generation Settings

Name	Value
STM32Cube MCU packages and embedded software	Copy all used libraries into the project folder
Generate peripheral initialization as a pair of '.c/.h' files	No
Backup previously generated files when re-generating	No
Delete previously generated files when not re-generated	Yes
Set all free pins as analog (to optimize the power	No
consumption)	

6. Power Consumption Calculator report

6.1. Microcontroller Selection

Series	STM32F1
Line	STM32F103
мси	STM32F103C8Tx
Datasheet	13587_Rev17

6.2. Parameter Selection

Temperature	25
Vdd	3.3

7. IPs and Middleware Configuration 7.1. GPIO

7.2. RCC

High Speed Clock (HSE): Crystal/Ceramic Resonator

7.2.1. Parameter Settings:

System Parameters:

VDD voltage (V) 3.3
Prefetch Buffer Enabled

Flash Latency(WS) 2 WS (3 CPU cycle)

RCC Parameters:

HSI Calibration Value 16
HSE Startup Timout Value (ms) 100
LSE Startup Timout Value (ms) 5000

7.3. SYS

Debug: Serial Wire

Timebase Source: SysTick

7.4. TIM2

Clock Source : Internal Clock

7.4.1. Parameter Settings:

Counter Settings:

Prescaler (PSC - 16 bits value) **7200-1** *

Counter Mode Up

Counter Period (AutoReload Register - 16 bits value) 10-1 *

Internal Clock Division (CKD)

No Division

auto-reload preload

Disable

Trigger Output (TRGO) Parameters:

Master/Slave Mode Disable (no sync between this TIM (Master) and its Slaves

Trigger Event Selection Reset (UG bit from TIMx_EGR)

7.5. USART1

Mode: Asynchronous

7.5.1. Parameter Settings:

Basic Parameters:

Baud Rate 115200

Word Length 8 Bits (including Parity)

Parity None Stop Bits 1

Advanced Parameters:

Data Direction Receive and Transmit

Over Sampling 16 Samples

7.6. USART2

Mode: Asynchronous

7.6.1. Parameter Settings:

Basic Parameters:

Baud Rate 9600 *

Word Length 8 Bits (including Parity)

Parity None Stop Bits 1

Advanced Parameters:

Data Direction Receive and Transmit

Over Sampling 16 Samples

^{*} User modified value

8. System Configuration

8.1. GPIO configuration

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
RCC	PD0- OSC_IN	RCC_OSC_IN	n/a	n/a	n/a	
	PD1- OSC_OUT	RCC_OSC_OUT	n/a	n/a	n/a	
SYS	PA13	SYS_JTMS- SWDIO	n/a	n/a	n/a	
	PA14	SYS_JTCK- SWCLK	n/a	n/a	n/a	
USART1	PA9	USART1_TX	Alternate Function Push Pull	n/a	High *	
	PA10	USART1_RX	Input mode	No pull-up and no pull-down	n/a	
USART2	PA2	USART2_TX	Alternate Function Push Pull	n/a	High *	
	PA3	USART2_RX	Input mode	No pull-up and no pull-down	n/a	
GPIO	PB10	GPIO_Input	Input mode	No pull-up and no pull-down	n/a	KEY1
	PA8	GPIO_Input	Input mode	No pull-up and no pull-down	n/a	KEY2
	PA15	GPIO_Output	Output Push Pull	n/a	Low	LED_PIN

8.2. DMA configuration

nothing configured in DMA service

8.3. NVIC configuration

Interrupt Table	Enable	Preenmption Priority	SubPriority	
Non maskable interrupt	true	0	0	
Hard fault interrupt	true	0	0	
Memory management fault	true	0	0	
Prefetch fault, memory access fault	true	0	0	
Undefined instruction or illegal state	true	0	0	
System service call via SWI instruction	true	0	0	
Debug monitor	true	0	0	
Pendable request for system service	true	0	0	
System tick timer	true	0	0	
TIM2 global interrupt	true	0		
USART2 global interrupt	true	0	0	
PVD interrupt through EXTI line 16	unused			
Flash global interrupt	unused			
RCC global interrupt	unused			
USART1 global interrupt	unused			

^{*} User modified value

9. Software Pack Report	9.	Software	Pack	Report
-------------------------	----	-----------------	-------------	--------