

## TERMO DE ACEITE TÉCNICO


Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Eduardo Tadra

GRE/Prodemge: João Antinossi Responsável/cliente: Yara Maria da Silva Vieira

> Consórcio Porta kbps Plataforma **VSAT-ID** EMC/Vodanet **VSAT** SEE-TENI-22976 2Mbps



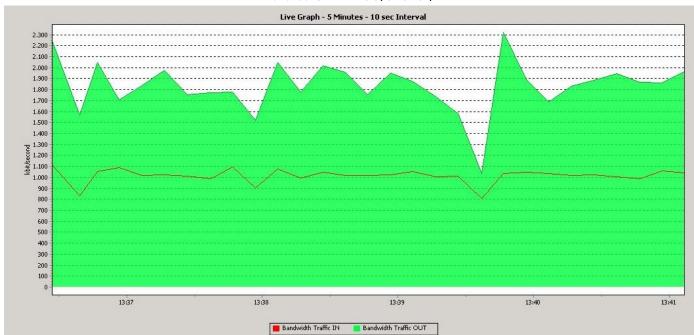

## Satellite (DVB) RX Configuration \_\_\_\_\_

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

\* 0 0 12.176420 DVB-S2 104 0 0.0 E 4.883300

Yes

1 1 16.667000 11.962753 DVB-S2 2 0 0.0 E

Yes

## Satellite (DVB) Receiver Status

\_\_\_\_\_\_

Rx State : On

DVB State : Forward link up

: 65281, Prodemge@Vodanet

: 65261, 1161 : 12.176626 GHz : 4.882885 Msps Frequency Symbol Rate

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On Frame length : Shor DVB S2 Mode : ACM : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 16.1 dB Input Power : -40 dBm

```
Satellite (DVB) TX Configuration
_____
                    : Enabled
Auto start
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode
                    : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : 3.2 dBm
ODU Output Power : 32.2 dBm
EIRP
                    : 45.5 dBW
Es/No
                    : 12.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -330 us (280737 us)
Frequency correction: 50 Hz
System Information:
   Name
                        : SEE-TENI-22976
    Location
                        : TEÓFILO OTONI - MG
    Contact
                       :
    System Up time : 0 days, 00:17:43 CPU Load : 16%
    System time (UTC) : 23 November 2017 13:32:00
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                       : 120033
    Main board ID
                       : 120026 R6.2
MAC addresses:
    Ethernet (LAN) : 00:20:0e:10:60:37
    Satellite (DVB)
                       : 00:20:0e:10:60:37
             State MacAddr
   10.215.175.2 Dynamic b8:70:f4:6e:b3:ab 1
Pinging 10.215.175.1 with 32 bytes of data:
Reply from 10.215.175.1: bytes=32 time=588ms TTL=56
Reply from 10.215.175.1: bytes=32 time=571ms TTL=56
Reply from 10.215.175.1: bytes=32 time=551ms TTL=56
Reply from 10.215.175.1: bytes=32 time=631ms TTL=56
Reply from 10.215.175.1: bytes=32 time=557ms TTL=56
Reply from 10.215.175.1: bytes=32 time=555ms TTL=56
Reply from 10.215.175.1: bytes=32 time=532ms TTL=56
Reply from 10.215.175.1: bytes=32 time=553ms TTL=56
Reply from 10.215.175.1: bytes=32 time=561ms TTL=56
Reply from 10.215.175.1: bytes=32 time=543ms TTL=56
Ping statistics for 10.215.175.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 532ms, Maximum = 631ms, Average = 564ms
```

## Lista de sites acessados:

<u>www.globo.com</u> – ok <u>www.yahoo.com</u> – ok

 $\underline{www.hotmail.com} - ok$ 

<u>www.google.com</u> – ok

www.educacao.mg.gov.br - ok

www.prodemge.gov.br - ok

Responsável pelo teste de navegação: Nome: Yara Maria da Silva Vieira

Função: Diretora MASP: 326820-8

Telefone: 33-98896-8942

Funcionamento: 07:00h às 16:30h