


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Eduardo Tadra

GRE/Prodemge: João Antinossi Responsável/cliente: Keilla Kapuciny Gonçalves Oliveira

> Porta kbps Plataforma Consórcio **VSAT-ID VSAT** EMC/Vodanet SEE-MATA-22884 2Mbps

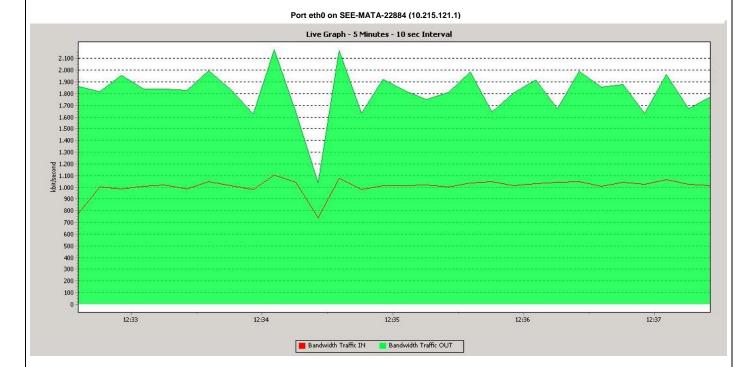

Satellite (DVB) RX Configuration _____

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

* 0 0 12.176420 DVB-S2 104 0 0.0 E 4.883300

Yes

16.667000 11.962753 DVB-S2 2 0 0.0 E 1 1

Yes

Satellite (DVB) Receiver Status ______

Rx State : On

DVB State : Forward link up

: 65281, Prodemge@Vodanet Network

: 65281, Proder : 12.176549 GHz Frequency Symbol Rate : 4.883099 Msps

S2 ModCod

- receiving : 21 16APSK-5/6 - current max : 21 16APSK-5/6

Pilot : On Frame length : Shor DVB S2 Mode : ACM : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 16.8 dB Input Power : -30 dBm

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -18.6 dBm
ODU Output Power : 32.9 dBm
EIRP
                    : 46.2 dBW
Es/No
                    : 14.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -196 us (280977 us)
Frequency correction: 170 Hz
System Information:
    Name
                       : SEE-MATA-22884
    Location
                        : Malacacheta - MG
    Contact
    System Up time : 0 days, 00:12:06 CPU Load : 16%
    System time(UTC) : 21 November 2017 18:35:14
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                       : 120026 R6.2
MAC addresses:
    Ethernet (LAN) : 00:20:0e:10:54:8e
Satellite (DVB) : 00:20:0e:10:54:8e
    Ethernet (LAN)
NetAddr
          State MacAddr
   10.215.121.2 Dynamic b8:70:f4:6e:b3:ab 1
Pinging 10.215.121.1 with 32 bytes of data:
Reply from 10.215.121.1: bytes=32 time=553ms TTL=56
Reply from 10.215.121.1: bytes=32 time=562ms TTL=56
Reply from 10.215.121.1: bytes=32 time=641ms TTL=56
Reply from 10.215.121.1: bytes=32 time=550ms TTL=56
Reply from 10.215.121.1: bytes=32 time=528ms TTL=56
Reply from 10.215.121.1: bytes=32 time=551ms TTL=56
Reply from 10.215.121.1: bytes=32 time=531ms TTL=56
Reply from 10.215.121.1: bytes=32 time=529ms TTL=56
Reply from 10.215.121.1: bytes=32 time=519ms TTL=56
Reply from 10.215.121.1: bytes=32 time=531ms TTL=56
Ping statistics for 10.215.121.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 519ms, Maximum = 641ms, Average = 549ms
```

Lista de sites acessados: <u>www.globo.com</u> – ok www.yahoo.com - ok www.hotmail.com - ok www.google.com - ok www.educacao.mg.gov.br - ok www.prodemge.gov.br - ok Responsável pelo teste de navegação: Nome: Keilla Kapuciny Gonçalves Oliveira Função: Diretora MASP: 1167045-2 Telefone: 33991994593 Funcionamento: 07:00h às 18:30h