


## TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Gilvan Junior

GRE/Prodemge: João Antinossi Responsável/cliente: Ronan Nunes Pereira

> Porta kbps Plataforma Consórcio **VSAT-ID** EMC/Vodanet SEE-SAES-22244 **VSAT** 2Mbps

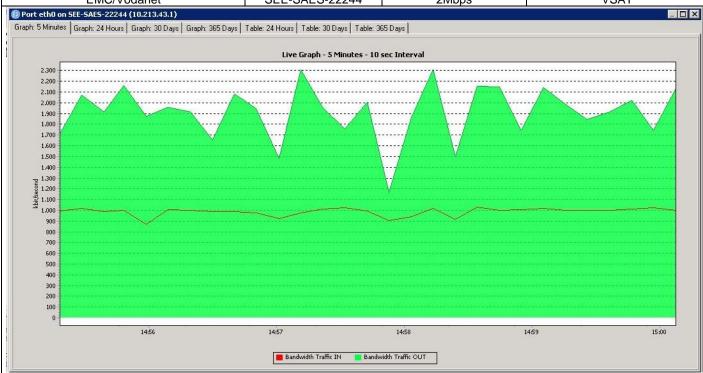

Satellite (DVB) RX Configuration

: Enabled Auto start

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

4.883300 12.176420 DVB-S2 104 0 0.0 E \* 0 0

Yes

16.667000 11.962753 DVB-S2 2 0 0.0 E 1 1

Yes

Satellite (DVB) Receiver Status

Rx State : On

: Forward link up DVB State

: 65281, Prodemge@Vodanet Network

: 12.176436 GHz Frequency Symbol Rate : 4.882926 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On Frame length : Short DVB S2 Mode : ACM DVB S2 Stream type : MPEG-TS Roll off : 0.20 : 16.5 dB SNR Input Power : -29 dBm

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.5 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : 2.0 dBm
ODU Output Power : 30.2 dBm
EIRP
                    : 43.2 dBW
Es/No
                    : 12.0 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -392 us (281171 us)
Frequency correction: 90 Hz
System Information:
                       : SEE-SAES-22244
    Name
    Location
                        : SÃO JOÃO DAS MISSÕES - MG
    Contact
    System Up time : 0 days, 00:43:58 CPU Load : 15%
    System time (UTC) : 30 October 2017 14:09:08
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                       : 120026 R6.2
    conernet (LAN) : 00:20:0e:10:5d:4a
Satellite (DVB) : 00:20:0a:10:5
MAC addresses:
    Ethernet (LAN)
NetAddr
            State MacAddr
    10.213.43.2 Dynamic e8:9a:8f:b7:bd:4a 1
Pinging 10.213.43.1 with 32 bytes of data:
Reply from 10.213.43.1: bytes=32 time=558ms TTL=56
Reply from 10.213.43.1: bytes=32 time=595ms TTL=56
Reply from 10.213.43.1: bytes=32 time=521ms TTL=56
Reply from 10.213.43.1: bytes=32 time=599ms TTL=56
Reply from 10.213.43.1: bytes=32 time=544ms TTL=56
Reply from 10.213.43.1: bytes=32 time=585ms TTL=56
Reply from 10.213.43.1: bytes=32 time=854ms TTL=56
Reply from 10.213.43.1: bytes=32 time=562ms TTL=56
Reply from 10.213.43.1: bytes=32 time=629ms TTL=56
Reply from 10.213.43.1: bytes=32 time=538ms TTL=56
Ping statistics for 10.213.43.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 521ms, Maximum = 854ms, Average = 598ms
```

Lista de sites acessados:
www.globo.com – ok
www.hotmail.com – ok
www.google.com – ok
www.educacao.mg.gov.br – ok
www.prodemge.gov.br – ok
Responsável pelo teste de navegação: Nome: Ronan Nunes Pereira Função: Diretor Identidade: MASP 1200509-6
Telefone: 38-99813-5888
Horário de funcionamento – 07hrs às 17:20hrs