

TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE


NOC/Operadora: Ermínio Junior Operadora/Cliente: Ederson Martins

GRE/Prodemge: João Antinossi

Porta khas Plataforma

Responsável/cliente: Maria José de Souza Barbosa

ConsórcioVSAT-IDPorta kbpsPlataformaEMC/VodanetSEE-MIAS-219252MbpsVSAT

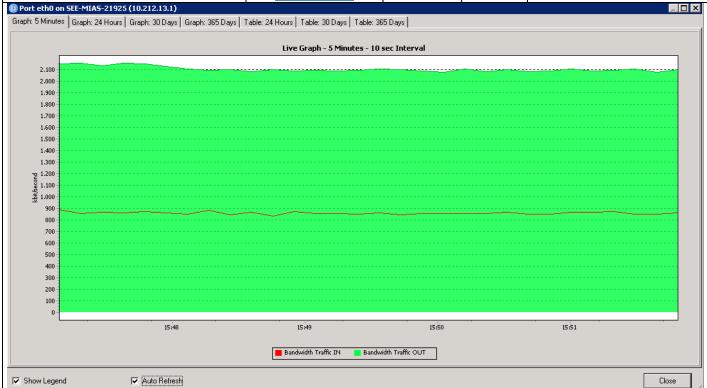

Satellite (DVB) TX Configuration

Auto start : Enabled
IDU Output Power : -21 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.5 dBm

EIRP : 46.5 dBW

Default CW Frequency: 0.000000 GHz

ATM mode : VC-Mux Header Compression : None

Satellite (DVB) Transmitter Status

State : On (DVB-RCS2)
IDU Output Power : -18.2 dBm
ODU Output Power : 32.4 dBm

EIRP : 45.4 dBW Es/No : 14.5 dB

Header Compression: Disabled - HC for RCS2 not supported by HUB

Timing correction: -354 us (281021 us)

Frequency correction: 80 Hz

Satellite (DVB) RX Configuration

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Enable Name

* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E Yes 1 1 16.667000 11.962753 DVB-S2 2 0 0.0 E Yes

Satellite (DVB) Receiver Status

Rx State : On

DVB State : Forward link up
Network : 65281, Prodemge@Vodanet

: 12.176180 GHz Frequency Symbol Rate : 4.883027 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On

Frame length : Short DVB S2 Mode : ACM

DVB S2 Stream type: MPEG-TS

Roll off : 0.20 SNR : 15.4 dB Input Power : -31 dBm

device show

System Information:

: SEE-MIAS-21925 Name Location : MINAS NOVAS

Contact

System Up time : 0 days, 00:43:14

CPU Load : 6%

System time(UTC) : 08 October 2017 14:59:55

Broadcast Message : not set

HW:

Model : SatLink 2000 HW ID : 120033

Main board ID : 120026 R6.2

MAC addresses:

Ethernet (LAN) : 00:20:0e:10:5d:e6 Satellite (DVB) : 00:20:0e:10:5d:e6

Disparando 10.148.0.40 com 32 bytes de dados: Resposta de 10.148.0.40: bytes=32 tempo=968ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=896ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=865ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=614ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=610ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=631ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=709ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=605ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=593ms TTL=62 Resposta de 10.148.0.40: bytes=32 tempo=617ms TTL=62 Estatísticas do Ping para 10.148.0.40: Pacotes: Enviados = 10, Recebidos = 10, Perdidos = 0 (0% de perda), Aproximar um número redondo de vezes em milissegundos: Mínimo = 593ms, Máximo = 968ms, Média = 710ms Lista de sites acessados: www.globo.com - ok www.hotmail.com - ok www.google.com - ok www.educacao.mg.gov.br - ok Responsável pelo teste de navegação: Nome: Maria José de Souza Barbosa Função: Vice Diretora Identidade: M8583062