

TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Ermínio Junior Operadora/Cliente: Gustavo Oliveira


GRE/Prodemge: João Antinossi

Responsável/cliente: Edilaci Toledo de Sousa

Freitas

ConsórcioVSAT-IDPorta kbpsPlataformaEMC/VodanetSEE-BURE-23138VSAT

Port eth 0 SEE-BURE-23138(10.214.133.1)

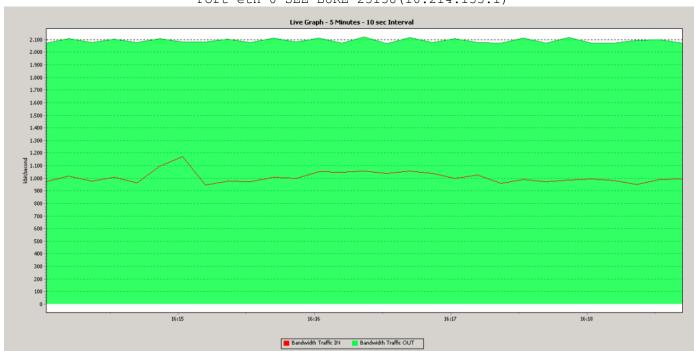

dvb tx show

Satellite (DVB) TX Configuration

Auto start : Enabled IDU Output Power : -20 dBm IDU Max Output Power: 0.0 dBm ODU Output Power : 33.2 dBm EIRP : 46.5 dBW Default CW Frequency: 0.000000 GHz

ATM mode : VC-Mux Header Compression : UDP/IP

Satellite (DVB) Transmitter Status

State : On (DVB-RCS2)

IDU Output Power : -15.4 dBm

ODU Output Power : 33.6 dBm

EIRP : 46.9 dBW

Es/No : 15.5 dB

Header Compression : Disabled - HC for RCS2 not supported by HUB

Timing correction : -289 us (281302 us)

Frequency correction: 160 Hz

dvb rx show

Satellite (DVB) RX Configuration
----Auto start : Enabled

```
Max Traffic MODCOD : 23 16APSK-9/10
                    : 15 minute
RX watchdog
Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName
                                                                              Name
Enable
* 0 0
         4.883300
                       12.176420 DVB-S2 104
                                                  0 0.0 E
Yes
                                                  0 0.0 E
 1 1
         8.883000
                       12.176420 DVB-S2 104
Yes
Satellite (DVB) Receiver Status
              : On
: Forward link up
: 65281, Prodemge@Vodanet
: 12.176462 GHz
: 4.883066 M
_____
Rx State
DVB State
Network
Frequency
Symbol Rate
S2 ModCod
     - receiving : 21 16APSK-5/6
     - current max : 21
                        16APSK-5/6
                  : On
Pilot
Frame length
                  : Short
                   : ACM
DVB S2 Stream type : MPEG-TS
Roll off : 0.20
                  : 16.2 dB
SNR
Input Power
                  : -35 dBm
# arp show
               State MacAddr
  NetAddr
                                          Ιf
  10.214.133.2 Dynamic 64:1c:67:61:83:29 1
# device show
System Information:
   Name
                      : SEE-BURE-23138
   Location
                      : BUGRE
   Contact
   System Up time : 0 days, 00:13:53 CPU Load : 15%
   System time (UTC) : 08 December 2017 17:34:46
   Broadcast Message : not set
HW:
   Model
                      : SatLink 2000
   HW ID
                      : 120033
   Main board ID
                      : 120026 R6.2
MAC addresses:
   Ethernet (LAN) : 00:20:0e:10:52:74
Satellite (DVB) : 00:20:0e:10:52:74
# Pinging 10.214.133.1 with 32 bytes of data:
Reply from 10.214.133.1: bytes=32 time=564ms TTL=56
Reply from 10.214.133.1: bytes=32 time=528ms TTL=56
Reply from 10.214.133.1: bytes=32 time=526ms TTL=56
Reply from 10.214.133.1: bytes=32 time=544ms TTL=56
Reply from 10.214.133.1: bytes=32 time=577ms TTL=56
Reply from 10.214.133.1: bytes=32 time=584ms TTL=56
Reply from 10.214.133.1: bytes=32 time=602ms TTL=56
Reply from 10.214.133.1: bytes=32 time=532ms TTL=56
Reply from 10.214.133.1: bytes=32 time=526ms TTL=56
Reply from 10.214.133.1: bytes=32 time=604ms TTL=56
Ping statistics for 10.214.133.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
```

Minimum = 526ms, Maximum = 604ms, Average = 558ms Nome do responsável: Edilaci Toledo de Sousa Freitas MASP: 1334256-3 Telefone: (33) 9 9943-8016 Cargo: ATB Expediente 07:00 as 18:00 Onde o equipamento se encontra na unidade? Secretaria Sites acessados www.globo.com www.google.com www.hotmail.com www.yahoo.com www.prodemge.gov.br www.educacao.mg.gov.br