


## TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Ermínio Junior Operadora/Cliente: João Paulo Oliveira

GRE/Prodemge: João Antinossi Responsável/cliente: Eunice Pereira Santos Silva

ConsórcioVSAT-IDPorta kbpsPlataformaEMC/VodanetSEE-BURO-220592MbpsVSAT

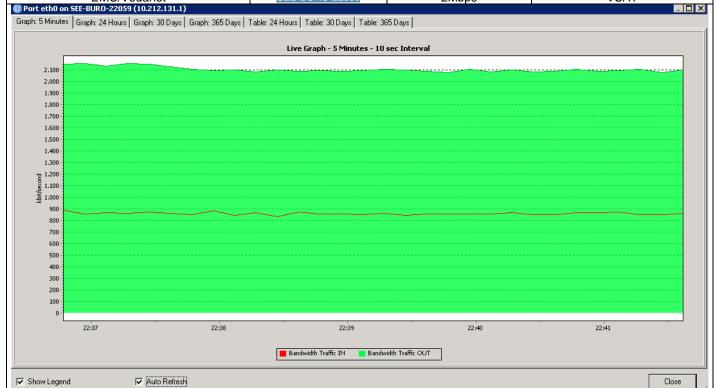

## SatLink 2000

- Main board ID 120026, Revision R6.2
- SW ID 120208, Revision 16.0.1 Build 57

# dvb tx show

## Satellite (DVB) TX Configuration

-----

Auto start : Enabled
IDU Output Power : -15 dBm
IDU Max Output Power: 20.0 dBm
ODU Output Power : 33.2 dBm

EIRP : 46.5 dBW

Default CW Frequency: 0.000000 GHz

ATM mode : VC-Mux Header Compression : None Satellite (DVB) Transmitter Status

\_\_\_\_\_

State : On (DVB-RCS2) IDU Output Power : -15.0 dBm ODU Output Power : 33.0 dBm

**EIRP** : 46.3 dBW Es/No : 14.0 dB

Header Compression: Disabled - HC for RCS2 not supported by HUB

Timing correction: -448 us (282390 us)

Frequency correction: 50 Hz

# dvb rx show

Satellite (DVB) RX Configuration

: Enabled Auto start

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name Enable

\* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E Yes 1 1 16.667000 11.962753 DVB-S2 2 0 0.0 E Yes

Satellite (DVB) Receiver Status

-----

Rx State : On

DVB State : Forward link up
Network : 65281, Prodemge@Vodanet

: 12.176369 GHz Frequency Symbol Rate : 4.882985 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On

: Short Frame length DVB S2 Mode : ACM

DVB S2 Stream type: MPEG-TS

: 0.20 Roll off SNR : 15.3 dB Input Power : -36 dBm # device show

System Information:

Name : SEE-BURO-22059 Location : BURITIZEIRO

Contact :

System Up time : 0 days, 00:25:09

CPU Load : 6%

System time(UTC) : 07 October 2017 22:06:56

Broadcast Message : not set

HW:

Model : SatLink 2000 HW ID : 120033

Main board ID : 120026 R6.2

MAC addresses:

Ethernet (LAN) : 00:20:0e:10:4b:07 Satellite (DVB) : 00:20:0e:10:4b:07

Disparando 10.148.0.37 com 32 bytes de dados:

Resposta de 10.148.0.37: bytes=32 tempo=627ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=613ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=796ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=612ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=628ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=886ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=935ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=630ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=943ms TTL=62 Resposta de 10.148.0.37: bytes=32 tempo=620ms TTL=62

Estatísticas do Ping para 10.148.0.37:

Pacotes: Enviados = 10, Recebidos = 10, Perdidos = 0 (0% de perda),

Aproximar um número redondo de vezes em milissegundos: Mínimo = 612ms, Máximo = 943ms, Média = 729ms

Lista de sites acessados:

www.globo.com - ok www.hotmail.com - ok www.google.com - ok www.educacao.mg.gov.br - ok

Responsável pelo teste de navegação:

Nome: Eunice Pereira Santos Silva

Função: Secretária

Identidade: MASP: 1366174-9