

# TERMO DE ACEITE TÉCNICO

Name

Solicitante: PRODEMGE / SEE

NOC/Operadora: Ermínio Junior

GRE/Prodemge: João Antinossi


Consórcio
EMC/Vodanet

VSAT-ID
SEE-BELO-22764

Porta kbps
2Mbps

Plataforma
VSAT



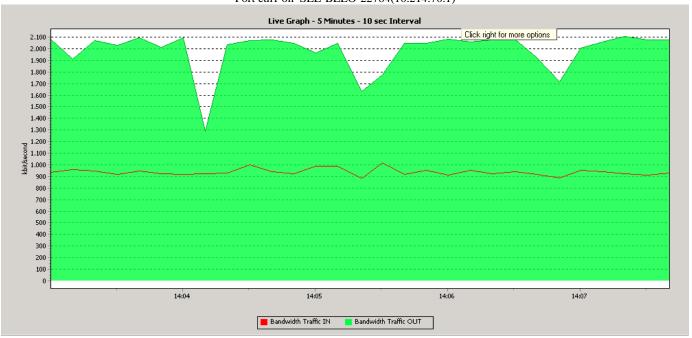

## SatLink 2000

- Main board ID 120026, Revision R6.2
- SW ID 120208, Revision 16.0.1 Build 57

# dvb rx show

## Satellite (DVB) RX Configuration

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName

Enable

\* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E Yes 1 1 16.667000 11.962753 DVB-S2 2 0 0.0 E Yes

#### Satellite (DVB) Receiver Status

Rx State : On

DVB State : Forward link up

Network : 65281, Prodemge@Vodanet

Frequency : 12.176674 GHz Symbol Rate : 4.883026 Msps

S2 ModCod

- receiving : 20 16APSK-4/5 - current max : 21 16APSK-5/6

Pilot : On
Frame length : Short
DVB S2 Mode : ACM
DVB S2 Stream type : MPEG-TS

Roll off : 0.20

**SNR** : 15.6 dB Input Power : -36 dBm

# dvb tx show

#### Satellite (DVB) TX Configuration

Auto start : Enabled IDU Output Power : -20 dBm IDU Max Output Power: 0.0 dBm ODU Output Power : 33.2 dBm : 46.5 dBW

Default CW Frequency: 0.000000 GHz

ATM mode : VC-Mux Header Compression: UDP/IP

#### Satellite (DVB) Transmitter Status

State : On (DVB-RCS2) IDU Output Power : -20.6 dBm ODU Output Power : 33.3 dBm : 46.6 dBW **EIRP** 

Es/No : 13.5 dB

Header Compression: Disabled - HC for RCS2 not supported by HUB

Timing correction : -452 us (281581 us)

Frequency correction: 40 Hz

#### # arp show

State MacAddr NetAddr 10.214.70.2 Dynamic 80:ee:73:a4:e2:ba 1

# device show

**System Information:** 

: SEE-BELO-22764 Name

: BERILO Location

Contact

: 0 days, 00:15:34 : 16% System Up time

CPU Load

System time(UTC) : 14 November 2017 19:55:01

Broadcast Message : not set

### HW:

Model : SatLink 2000 HW ID : 120033 Main board ID : 120026 R6.2

## MAC addresses:

: 00:20:0e:10:51:c9 Ethernet (LAN) Satellite (DVB) : 00:20:0e:10:51:c9

#### Pinging 10.214.70.1 with 32 bytes of data:

Reply from 10.214.70.1: bytes=32 time=689ms TTL=56 Reply from 10.214.70.1: bytes=32 time=541ms TTL=56 Reply from 10.214.70.1: bytes=32 time=673ms TTL=56 Reply from 10.214.70.1: bytes=32 time=547ms TTL=56 Reply from 10.214.70.1: bytes=32 time=535ms TTL=56 Reply from 10.214.70.1: bytes=32 time=548ms TTL=56 Reply from 10.214.70.1: bytes=32 time=529ms TTL=56 Reply from 10.214.70.1: bytes=32 time=531ms TTL=56 Reply from 10.214.70.1: bytes=32 time=568ms TTL=56 Reply from 10.214.70.1: bytes=32 time=535ms TTL=56

### Ping statistics for 10.214.70.1:

Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),

Approximate round trip times in milli-seconds:

Minimum = 529ms, Maximum = 689ms, Average = 569ms

www.yahoo.com.br

www.hotmail.com

www.google.com

www.prodemge.gov.br

Responsável	Gerci Ferreira de Souza
Cargo	Secretária
Identidade	979458-7
Telefone	033-9-8822-2609
Funcionamento	07:00- 21:00
Onde ficou	Na secretaria