

## TERMO DE ACEITE TÉCNICO


Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Ederson Martins

GRE/Prodemge: João Antinossi Responsável/cliente: João Aldeir Ferreira Chagas

> Consórcio **VSAT-ID** Porta kbps **Plataforma** EMC/Vodanet SEE-JEAS-22780 2Mbps **VSAT**

## Port eth0 on SEE-JEAS-22780 (10.214.90.1)

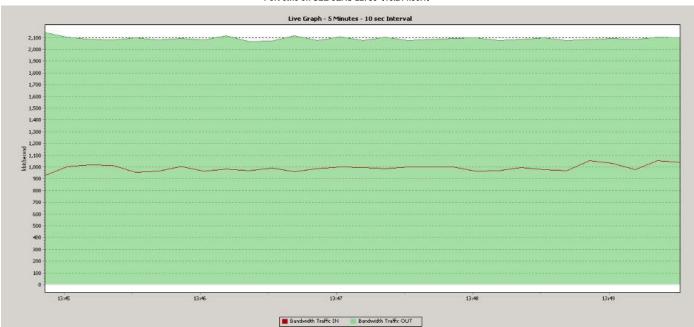

Satellite (DVB) RX Configuration \_\_\_\_\_\_ Max Traffic MODCOD : 23 16APSK-9/10 RX watchdog : 15

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

\* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E

Yes

1 1 16.667000 11.962753 DVB-S2 2 0.0 E

Yes

Satellite (DVB) Receiver Status

Rx State : On

: Forward link up DVB State

Network : 65281, Prodemge@Vodanet

Frequency

: 12.176408 GHz : 4.883004 Msps Symbol Rate

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On
Frame length : Shor
DVB S2 Mode : ACM : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 16.5 dB Input Power : -30 dBm

```
Satellite (DVB) TX Configuration
_____
Auto start
                   : Enabled
IDU Output Power : -21 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
                   : 46.5 dBW
EIRP
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
                    : On (DVB-RCS2)
: On (DVB-I
IDU Output Power : -18.2 dBm
ODU Output Power : 32.8 dBm
State
EIRP
                    : 46.1 dBW
Es/No
                    : 13.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{: Disabled} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -264 us (280818 us)
Frequency correction: 120 Hz
System Information:
                       : SEE-JEAS-22780
   Name
    Location
                        : Jenipapo de Minas - MG
    Contact
   System Up time : 0 days, 00:34:25 CPU Load : 6%
    System time(UTC)
                       : 19 November 2017 17:13:49
    Broadcast Message : not set
HW:
   Model
                       : SatLink 2000
                       : 120033
    HW ID
    Main board ID
                       : 120026 R6.2
MAC addresses:
   Ethernet (LAN) : 00:20:0e:10:54:61
Satellite (DVB) : 00:20:0e:10:54:61
NetAddr
          State MacAddr
    10.214.90.3 Dynamic 48:ee:0c:c3:3e:39 1
Pinging 10.214.90.1 with 32 bytes of data:
Reply from 10.214.90.1: bytes=32 time=575ms TTL=56
Reply from 10.214.90.1: bytes=32 time=555ms TTL=56
Reply from 10.214.90.1: bytes=32 time=594ms TTL=56
Reply from 10.214.90.1: bytes=32 time=582ms TTL=56
Reply from 10.214.90.1: bytes=32 time=570ms TTL=56
Reply from 10.214.90.1: bytes=32 time=573ms TTL=56
Reply from 10.214.90.1: bytes=32 time=592ms TTL=56
Reply from 10.214.90.1: bytes=32 time=588ms TTL=56
Reply from 10.214.90.1: bytes=32 time=572ms TTL=56
Reply from 10.214.90.1: bytes=32 time=568ms TTL=56
Ping statistics for 10.214.90.1:
   Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 555ms, Maximum = 594ms, Average = 576ms
```

## Lista de sites acessados: www.globo.com – ok www.yahoo.com – ok <u>www.hotmail.com</u> – ok www.google.com - ok www.educacao.mg.gov.br - ok www.prodemge.gov.br - ok Responsável pelo teste de navegação: Nome: João Aldeir Ferreira Chagas Função: Diretor MASP: 114.9701-3 Telefone: 33-99137-4878 Funcionamento: 07:00 as 18:00