


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Paulo de Tarso Operadora/Cliente: Ronaldo Candido

GRE/Prodemge: João Antinossi Responsável/cliente: Peterson Santos Pimenta

> Porta kbps Plataforma Consórcio **VSAT-ID** EMC/Vodanet SEE-CORO-22018 **VSAT** 2Mbps

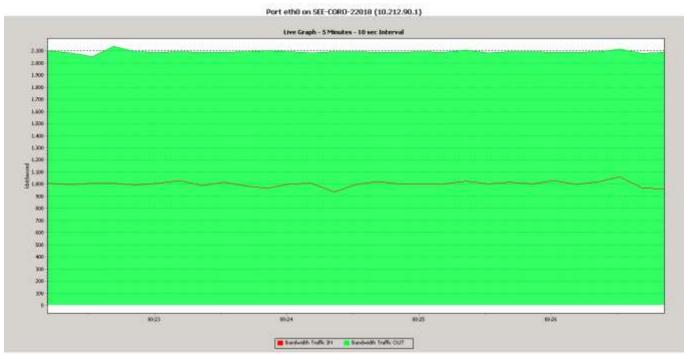

PPITO Traffic Shapher VS.20,007 - 18/18/2017 90:27:84

Satellite (DVB) RX Configuration _____

Auto start : Enabled
Max Traffic MODCOD : 23 16APSK-9/10
RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E

Yes

Satellite (DVB) Receiver Status

: On Rx State

DVB State : On

PVB State : Forward link up

Network : 65281, Prodemge@Vodanet

Frequency : 12.176477 GHz

Symbol Rate : 4.882906 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On Frame length : Short DVB S2 Mode : ACM DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 15.4 dB Input Power : -36 dBm

```
Satellite (DVB) TX Configuration
 : Enabled
Auto start
Auto start : Enabled IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
                    : VC-Mux
ATM mode
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
                    : On (DVB-RCS2)
State
IDU Output Power : -19.2 dBm
ODU Output Power : 33.7 dBm
EIRP
                    : 47.0 dBW
Es/No
                     : 14.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -362 us (281721 us)
Frequency correction: -70 Hz
System Information:
    Name
                        : SEE-CORO-22018
    Location
                        : Conceição do Mato Dentro - MG
    Contact
    System Up time : 0 days, 04:44:58 CPU Load : 5%
    System time(UTC) : 10 October 2017 10:15:47
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
                        : 120026 R6.2
    Main board ID
    ______(LAN) : 00:20:0e:10:64:de 
Satellite (DVB) : 00:20:0e:10
MAC addresses:
Pinging 10.212.90.1 with 32 bytes of data:
Reply from 10.212.90.1: bytes=32 time=531ms TTL=56
Reply from 10.212.90.1: bytes=32 time=611ms TTL=56
Reply from 10.212.90.1: bytes=32 time=615ms TTL=56
Reply from 10.212.90.1: bytes=32 time=589ms TTL=56
Reply from 10.212.90.1: bytes=32 time=656ms TTL=56
Reply from 10.212.90.1: bytes=32 time=566ms TTL=56
Reply from 10.212.90.1: bytes=32 time=575ms TTL=56
Reply from 10.212.90.1: bytes=32 time=587ms TTL=56
Reply from 10.212.90.1: bytes=32 time=598ms TTL=56
Reply from 10.212.90.1: bytes=32 time=662ms TTL=56
Ping statistics for 10.212.90.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 531ms, Maximum = 662ms, Average = 599ms
```

Lista de sites acessados: www.globo.com – ok www.hotmail.com – ok	
<u>www.hotmail.com</u> – ok	
<u>www.hotmail.com</u> – ok	
$\mu \mu \mu \mu \mu \mu \mu \nu \mu \nu \mu \nu \nu \nu \nu \nu \nu \nu \nu \nu$	
www.google.com – ok	
<u>www.educacao.mg.gov.br</u> – ok	
Responsável pelo teste de navegação: Nome: Maryslene de Freitas Ribeiro Função: Diretora Identidade:	
	⅃