

TERMO DE ACEITE TÉCNICO

13:40


13:41

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Gilvan Junior

GRE/Prodemge: João Antinossi Responsável/cliente: Gilmar Gonçalves Pereira

> Consórcio Porta kbps Plataforma **VSAT-ID** EMC/Vodanet SEE-UBGA-23388 2Mbps **VSAT**

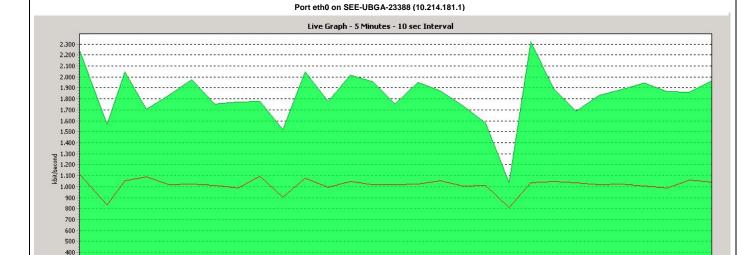

Satellite (DVB) RX Configuration -----

Auto start : Enabled

13:37

: 23 16APSK-9/10 Max Traffic MODCOD

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Bandwidth Traffic IN Bandwidth Traffic OUT

13:39

Enable

300 200 100

* 0 0 8.883000 12.176420 DVB-S2 104 0 0.0 E

Yes

4.883300 12.176420 DVB-S2 2 0 0.0 E 1 1

Yes

Satellite (DVB) Receiver Status

Rx State : On

: Forward link up DVB State

Network : 65281, Prodemge@Vodanet Frequency : 12.176382 GHz Symbol Rate : 8.883019 Msps

S2 ModCod

- receiving : 14 8PSK-3/4 - current max : 22 16APSK-8/9

Pilot : On Frame length : Shor DVB S2 Mode : ACM : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 16.3 dB Input Power : -28 dBm

```
Satellite (DVB) TX Configuration
_____
Auto start
                    : Enabled
Auto start : Enabled IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : max
EIRP
                     : max
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -15.9 dBm
ODU Output Power : 35.1 dBm
EIRP
                     : 48.4 dBW
Es/No
                     : 15.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -342 us (266182 us)
Frequency correction: 20 Hz
System Information:
                        : SEE-UBGA-23388
    Name
    Location
                         : Ubaporanga - MG
    Contact
    System Up time : 0 days, 00:11:05
CPU Load : 26%
System time(UTC) : 20 December 2017 13:15:29
    Broadcast Message : not set
HW:
    Model
                         : SatLink 2000
    HW ID
                         : 120033
    Main board ID
                        : 120026 R6.2
MAC addresses:
    Ethernet (LAN) : 00:20:0e:10:5c:07
Satellite (DVB) : 00:20:0e:10:5c:07
    Ethernet (LAN)
NetAddr
           State MacAddr
   10.214.181.2 Dynamic e8:9a:8f:b7:bd:4a 1
Pinging 10.214.181.1 with 32 bytes of data:
Reply from 10.214.181.1: bytes=32 time=576ms TTL=56
Reply from 10.214.181.1: bytes=32 time=551ms TTL=56
Reply from 10.214.181.1: bytes=32 time=541ms TTL=56
Reply from 10.214.181.1: bytes=32 time=524ms TTL=56
Reply from 10.214.181.1: bytes=32 time=517ms TTL=56
Reply from 10.214.181.1: bytes=32 time=597ms TTL=56
Reply from 10.214.181.1: bytes=32 time=518ms TTL=56
Reply from 10.214.181.1: bytes=32 time=515ms TTL=56
Reply from 10.214.181.1: bytes=32 time=526ms TTL=56
Reply from 10.214.181.1: bytes=32 time=553ms TTL=56
Ping statistics for 10.214.181.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 515ms, Maximum = 597ms, Average = 541ms
```

Lista de sites acessados:
www.globo.com – ok
www.yahoo.com – ok
www.hotmail.com – ok
www.google.com – ok
<u>www.educacao.mg.gov.br</u> – ok
www.prodemge.gov.br – ok
Responsável pelo teste de navegação:
Nome: Gilmar Gonçalves Pereira
Função: Diretor
MASP: 1061485-7
Telefone: 33-991977202
Funcionamento: 07:00h às 18:00h