


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Ronaldo Candido

GRE/Prodemge: João Antinossi Responsável/cliente: Tais Cristina Pinheiro dos Santos

> Consórcio Porta kbps Plataforma **VSAT-ID** EMC/Vodanet **VSAT** SEE-JAIA-22140 2Mbps

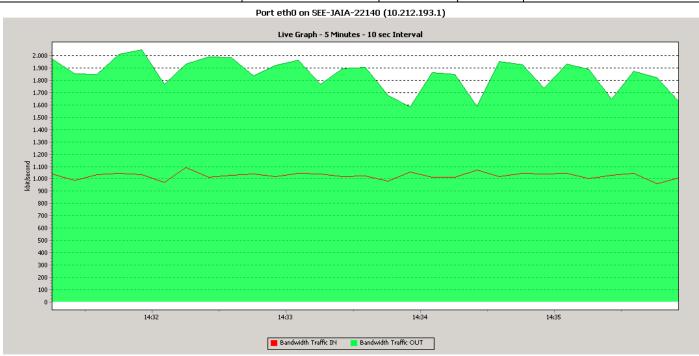

PRTG Traffic Grapher V6.2.0.907 - 23/10/2017 14:36:08

Satellite (DVB) RX Configuration _____

: Enabled Auto start

Max Traffic MODCOD : 23 16APSK-9/10
RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

4.883300 12.176420 DVB-S2 104 0 0.0 E * 0 0

Yes

Satellite (DVB) Receiver Status _____

Rx State : On

DVB State

Network

: 65281, Prodemge@Vodanet : 12.176133 GHz Frequency Symbol Rate : 4.883083 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

: On Pilot Frame length : Short : ACM DVB S2 Stream type : MPEG-TS Roll off : 0.20 : 17.5 dB SNR Input Power : -29 dBm

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -19.3 dBm
ODU Output Power : 33.1 dBm
EIRP
                     : 46.4 dBW
Es/No
                     : 14.0 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -406 us (281373 us)
Frequency correction: 70 Hz
System Information:
    Name
                        : SEE-JAIA-22140
    Location
                         : JANUARIA - MG
    Contact
    System Up time : 0 days, 00:15:40

CPU Load : 12%

System time(UTC) : 23 October 2017 13:25:09
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                        : 120026 R6.2
MAC addresses:
   Ethernet (LAN) : 00:20:0e:10:55:36
Satellite (DVB) : 00:20:0e:10:55:36
NetAddr
             State MacAddr
   10.212.193.2 Dynamic 80:ee:73:a4:e2:ba 1
Pinging 10.212.193.1 with 32 bytes of data:
Reply from 10.212.193.1: bytes=32 time=551ms TTL=56
Reply from 10.212.193.1: bytes=32 time=523ms TTL=56
Reply from 10.212.193.1: bytes=32 time=543ms TTL=56
Reply from 10.212.193.1: bytes=32 time=563ms TTL=56
Reply from 10.212.193.1: bytes=32 time=585ms TTL=56
Reply from 10.212.193.1: bytes=32 time=579ms TTL=56
Reply from 10.212.193.1: bytes=32 time=580ms TTL=56
Reply from 10.212.193.1: bytes=32 time=582ms TTL=56
Reply from 10.212.193.1: bytes=32 time=566ms TTL=56
Reply from 10.212.193.1: bytes=32 time=589ms TTL=56
Ping statistics for 10.212.193.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 523ms, Maximum = 589ms, Average = 566ms
```

Lista de sites acessados:
www.globo.com - ok www.hotmail.com - ok www.google.com - ok www.educacao.mg.gov.br - ok www.prodemge.gov.br - ok
Responsável pelo teste de navegação: Nome: Tais Cristina Pinheiro dos Santos Função: Secretaria Identidade: MASP 1240153-5
Telefone: 31-99930-1578
Horário de funcionamento – 06hrs às 18hrs