


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Sergio Almeida

GRE/Prodemge: João Antinossi Responsável/cliente: Alex Sandro Feliciano

> Plataforma Porta kbps Consórcio **VSAT-ID** SEE-COUS-23002 **VSAT** EMC/Vodanet 2Mbps

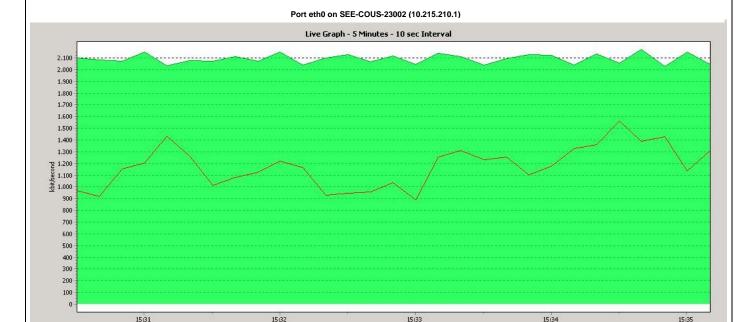

Satellite (DVB) RX Configuration

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Bandwidth Traffic IN Bandwidth Traffic OUT

Enable

* 0 0 12.176420 DVB-S2 104 0 0.0 E 4.883300

Yes

16.667000 11.962753 DVB-S2 2 0 0.0 E 1 1

Yes

Satellite (DVB) Receiver Status ______

Rx State : On

DVB State : Forward link up

Network : 65281, Prodemge@Vodanet

: 65281, Prodei : 12.176261 GHz Frequency Symbol Rate : 4.882949 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On Frame length : Short Frame length : Shown DVB S2 Mode : ACM DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 15.5 dB Input Power : -28 dBm

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
: On (DVB-RCS2)

IDU Output Power : -19.6 dBm

ODU Output Power : 33.0 dBm

EIRP
_____
Es/No
                    : 13.0 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -261 us (281525 us)
Frequency correction: 240 Hz
System Information:
    Name
                        : SEE-COUS-23002
    Location
                        : Coração de Jesus - MG
    Contact
    System Up time : 0 days, 00:01:22 CPU Load : 16%
    System time(UTC) : 23 November 2017 19:12:51
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                        : 120026 R6.2
MAC addresses:
    Ethernet (LAN) : 00:20:0e:10:5c:15
Satellite (DVB) : 00:20:0e:10:5c:15
    Ethernet (LAN)
NetAddr
            State MacAddr
   10.215.210.2 Dynamic 58:10:8c:83:5e:21 1
Pinging 10.215.210.1 with 32 bytes of data:
Reply from 10.215.210.1: bytes=32 time=571ms TTL=56
Reply from 10.215.210.1: bytes=32 time=575ms TTL=56
Reply from 10.215.210.1: bytes=32 time=551ms TTL=56
Reply from 10.215.210.1: bytes=32 time=554ms TTL=56
Reply from 10.215.210.1: bytes=32 time=548ms TTL=56
Reply from 10.215.210.1: bytes=32 time=588ms TTL=56
Reply from 10.215.210.1: bytes=32 time=562ms TTL=56
Reply from 10.215.210.1: bytes=32 time=568ms TTL=56
Reply from 10.215.210.1: bytes=32 time=572ms TTL=56
Reply from 10.215.210.1: bytes=32 time=593ms TTL=56
Ping statistics for 10.215.210.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 548ms, Maximum = 593ms, Average = 568ms
```

Lista de sites acessados:
www.globo.com - ok
www.yahoo.com – ok
<u>www.hotmail.com</u> – ok
www.google.com – ok
www.educacao.mg.gov.br – ok
<u>www.prodemge.gov.br</u> – ok
Responsável pelo teste de navegação:
Nome: Alex Sandro Feliciano
Função: Vice-Diretor
MASP: 11461878
Telefone: 38-998710018
Funcionamento: 07:00h às 17:00h