

TERMO DE ACEITE TÉCNICO


Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Gustavo de Oliveira

GRE/Prodemge: João Antinossi Responsável/cliente: Fasuleide Soares Cardoso

> Porta kbps Plataforma Consórcio **VSAT-ID** EMC/Vodanet **VSAT** SEE-MOOS-22796 2Mbps



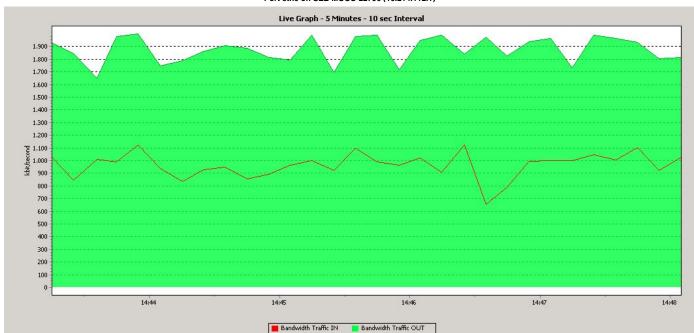

Satellite (DVB) RX Configuration _____

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdoo

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

* 0 0 12.176420 DVB-S2 104 0 0.0 E 4.883300

Yes

16.667000 11.962753 DVB-S2 2 0 0.0 E 1 1

Yes

Satellite (DVB) Receiver Status

Rx State : On

DVB State : Forward link up

Network : 65281, Prodemge@Vodanet

: 65281, Prodei : 12.176161 GHz Frequency Symbol Rate : 4.882971 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On Frame length : Shor DVB S2 Mode : ACM : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 15.4 dB Input Power : -37 dBm

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
Auto start : Enabled IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -14.6 dBm
ODU Output Power : 33.0 dBm
EIRP
                    : 46.3 dBW
Es/No
                    : 13.0 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -356 us (280752 us)
Frequency correction: 20 Hz
System Information:
                    : SEE-MOOS-22796
    Name
    Location
                        : MONTES CLAROS - MG
    Contact
    System Up time : 0 days, 00:12:17 CPU Load : 12%
    System time(UTC) : 17 November 2017 12:16:42
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                        : 120026 R6.2
MAC addresses:
    Ethernet (LAN) : 00:20:0e:10:58:67
Satellite (DVB) : 00:20:0e:10:58:67
    Ethernet (LAN)
NetAddr
          State MacAddr
   10.214.112.2 Dynamic 64:1c:67:61:83:29 1
Pinging 10.214.112.1 with 32 bytes of data:
Reply from 10.214.112.1: bytes=32 time=562ms TTL=56
Reply from 10.214.112.1: bytes=32 time=631ms TTL=56
Reply from 10.214.112.1: bytes=32 time=530ms TTL=56
Reply from 10.214.112.1: bytes=32 time=702ms TTL=56
Reply from 10.214.112.1: bytes=32 time=534ms TTL=56
Reply from 10.214.112.1: bytes=32 time=755ms TTL=56
Reply from 10.214.112.1: bytes=32 time=538ms TTL=56
Reply from 10.214.112.1: bytes=32 time=534ms TTL=56
Reply from 10.214.112.1: bytes=32 time=525ms TTL=56
Reply from 10.214.112.1: bytes=32 time=534ms TTL=56
Ping statistics for 10.214.112.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 525ms, Maximum = 755ms, Average = 584ms
```

Lista de sites acessados:
www.globo.com – ok
www.yahoo.com – ok
www.hotmail.com – ok
www.google.com – ok
www.educacao.mg.gov.br – ok
<u>www.prodemge.gov.br</u> – ok
Responsável pelo teste de navegação:
Nome: Fasuleide Soares Cardoso
Função: Diretora
MASP: 638779-9
Telefone: 33-98730-3120
Telefolic. 33-76730-3120
Funcionamento: 07:00 às 16:40h