


## TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Jean Polini

GRE/Prodemge: João Antinossi Responsável/cliente: Janete Licia de Lima Teixeira

> Porta kbps Plataforma Consórcio **VSAT-ID** EMC/Vodanet **VSAT** SEE-CONA-23182 2Mbps

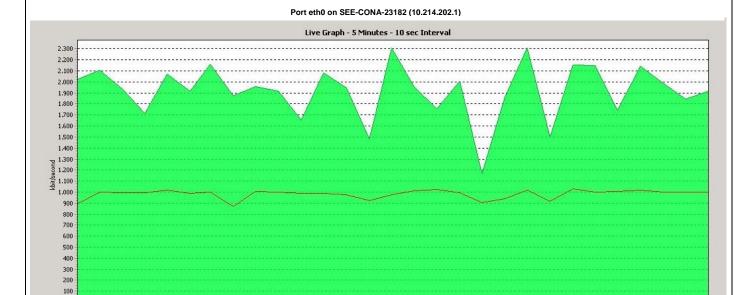

18:36

18:37

## Satellite (DVB) RX Configuration \_\_\_\_\_

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

18:34

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Bandwidth Traffic IN Bandwidth Traffic OUT

18:35

Enable

\* 0 0 8.883000 12.176420 DVB-S2 104 0 0.0 E

Yes

4.883300 12.176420 DVB-S2 2 0 0.0 E 1 1

Yes

## Satellite (DVB) Receiver Status \_\_\_\_\_

Rx State : On

DVB State : Forward link up

: 65281, Prodemge@Vodanet Network

: 65281, Proder : 12.176532 GHz Frequency Symbol Rate : 8.883002 Msps

S2 ModCod

- receiving : 21 16APSK-5/6 - current max : 21 16APSK-5/6

Pilot : On Frame length : Shor DVB S2 Mode : ACM : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 15.0 dB Input Power : -27 dBm

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
: On (DVB-RCS2)

IDU Output Power : -17.6 dBm

ODU Output Power : 33.1 dBm

EIRP
_____
Es/No
                    : 14.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -482 us (265810 us)
Frequency correction: 0 Hz
System Information:
    Name
                       : SEE-CONA-23182
    Location
                        : CONSELHEIRO PENA - MG
    Contact
    System Up time : 0 days, 00:35:31 CPU Load : 22%
    System time(UTC) : 11 December 2017 13:34:12
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                        : 120026 R6.2
MAC addresses:
    Ethernet (LAN) : 00:20:0e:10:61:03
Satellite (DVB) : 00:20:0e:10:61:03
    Ethernet (LAN)
NetAddr
            State MacAddr
   10.214.202.2 Dynamic 64:1c:67:62:2e:12 1
Pinging 10.214.202.1 with 32 bytes of data:
Reply from 10.214.202.1: bytes=32 time=534ms TTL=56
Reply from 10.214.202.1: bytes=32 time=716ms TTL=56
Reply from 10.214.202.1: bytes=32 time=615ms TTL=56
Reply from 10.214.202.1: bytes=32 time=556ms TTL=56
Reply from 10.214.202.1: bytes=32 time=584ms TTL=56
Reply from 10.214.202.1: bytes=32 time=521ms TTL=56
Reply from 10.214.202.1: bytes=32 time=553ms TTL=56
Reply from 10.214.202.1: bytes=32 time=546ms TTL=56
Reply from 10.214.202.1: bytes=32 time=559ms TTL=56
Reply from 10.214.202.1: bytes=32 time=551ms TTL=56
Ping statistics for 10.214.202.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 521ms, Maximum = 716ms, Average = 573ms
```

## Lista de sites acessados: <u>www.globo.com</u> – ok www.yahoo.com - ok www.hotmail.com - ok www.google.com - ok www.educacao.mg.gov.br - ok www.prodemge.gov.br - ok Responsável pelo teste de navegação: Nome: Janete Licia de Lima Teixeira Função: Diretora MASP: 511096 Telefone: 33-32615127 Funcionamento: 13:00h às 17:30h