
prodemge TERMO DE ACEITE TÉCNICO Solicitante: PRODEMGE / SEE NOC/Operadora: Ermínio Junior Operadora/Cliente **Gilvan Junior** Responsável/cliente Jucélia Tolentino GRE/Prodemge: João Antinossi Porta kbps Plataforma Consórcio **VSAT-ID EMC/Vodanet** SEE-JABA-22530 2Mbps **VSAT**

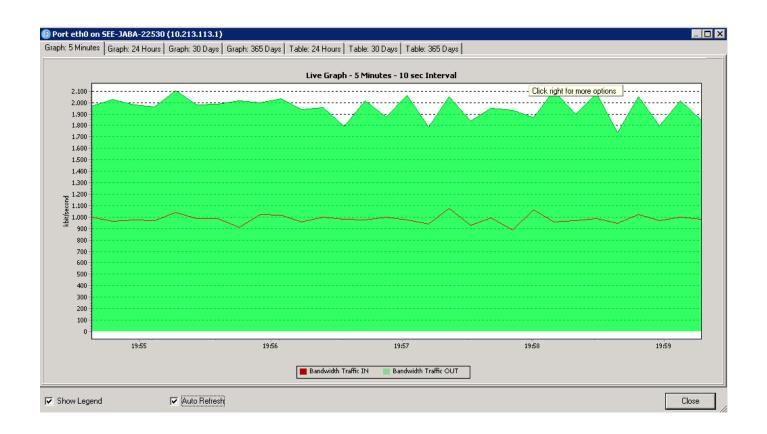

SatLink 2000

- Main board ID 120026, Revision R6.2
- SW ID 120208, Revision 16.0.1 Build 57

dvb rx show

Satellite (DVB) RX Configuration

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name Enable

* 0 0 4.883300 12.176420 DVB-S2 104 0.0EYes 1 1 16.667000 11.962753 DVB-S2 2 0.0EYes

Satellite (DVB) Receiver Status

Rx State : On

DVB State : Forward link up

: 65281, Prodemge@Vodanet Network

Frequency : 12.176260 GHz Symbol Rate : 4.883006 Msps

S2 ModCod

- receiving : 13 8PSK-2/3 - current max : 21 16APSK-5/6

Pilot : On

Frame length : Short DVB S2 Mode : ACM

DVB S2 Stream type: MPEG-TS

Roll off : 0.20 SNR : 16.2 dB Input Power : -32 dBm

dvb tx show

Satellite (DVB) TX Configuration

Auto start : Enabled IDU Output Power : -21 dBm IDU Max Output Power: 0.0 dBm ODU Output Power : max

EIRP : max

Default CW Frequency: 0.000000 GHz

ATM mode : VC-Mux Header Compression : UDP/IP

Satellite (DVB) Transmitter Status

State : On (DVB-RCS2) IDU Output Power : -16.0 dBm ODU Output Power : 34.7 dBm

EIRP : 48.0 dBW Es/No : 15.0 dB

Header Compression: Disabled - HC for RCS2 not supported by HUB

Timing correction : -226 us (281030 us)

Frequency correction: 170 Hz

arp show

NetAddr State MacAddr If 10.213.113.2 Dynamic e8:9a:8f:b7:bd:4a 1

device show

System Information:

Name : SEE-JABA-22530 Location : Jana ba - MG

Contact :

System Up time : 0 days, 00:13:10

CPU Load : 14%

System time(UTC) : 06 November 2017 19:55:06

Broadcast Message : not set

HW:

Model : SatLink 2000 HW ID : 120033

Main board ID : 120026 R6.2

```
MAC addresses:
```

Ethernet (LAN) : 00:20:0e:10:54:72 Satellite (DVB) : 00:20:0e:10:54:72

#

Pinging 10.213.113.1 with 32 bytes of data:

```
Reply from 10.213.113.1: bytes=32 time=539ms TTL=56 Reply from 10.213.113.1: bytes=32 time=577ms TTL=56 Reply from 10.213.113.1: bytes=32 time=571ms TTL=56 Reply from 10.213.113.1: bytes=32 time=536ms TTL=56 Reply from 10.213.113.1: bytes=32 time=504ms TTL=56 Reply from 10.213.113.1: bytes=32 time=526ms TTL=56 Reply from 10.213.113.1: bytes=32 time=525ms TTL=56 Reply from 10.213.113.1: bytes=32 time=543ms TTL=56 Reply from 10.213.113.1: bytes=32 time=544ms TTL=56 Reply from 10.213.113.1: bytes=32 time=544ms TTL=56 Reply from 10.213.113.1: bytes=32 time=596ms TTL=56
```

Ping statistics for 10.213.113.1:

Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),

Approximate round trip times in milli-seconds:

Minimum = 504ms, Maximum = 596ms, Average = 516ms

www.globo.com

www.yahoo.com.br

www.hotmail.com www.google.com

www.prodemge.gov.br

Responsável	Jucélia Toltentino
Cargo	Diretora
Identidade	1323247-5
Telefone	038-9-9902-5838
Funcionamento	07:00 às 17:00