


## TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Ederson Martins

Responsável/cliente: Elda Vieira Almeida GRE/Prodemge: João Antinossi

> Consórcio **VSAT-ID** Porta kbps Plataforma EMC/Vodanet SEE-SACO-22210 VSAT 2Mbps

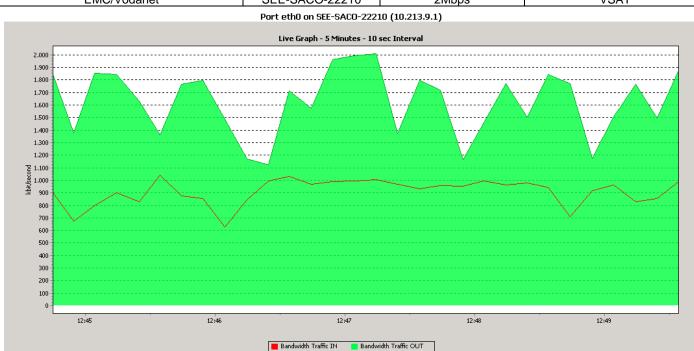

PRTG Traffic Grapher V6.2.0.907 - 23/10/2017 12:49:42

Satellite (DVB) RX Configuration

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10
RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

\* 0 0 12.176420 DVB-S2 104 4.883300 0 0.0 E

Yes

0 0.0 E 1 1 16.667000 11.962753 DVB-S2 2

Yes

Satellite (DVB) Receiver Status \_\_\_\_\_

Rx State : On

DVB State : Forward link up

Network : 65281, Prodemge@Vodanet

: 12.176046 GHz Frequency Symbol Rate : 4.882911 Msps

S2 ModCod

- receiving : 20 16APSK-4/5 - current max : 21 16APSK-5/6

: On Pilot Frame length : Short : ACM DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 16.6 dB Input Power : -33 dBm

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
IDU Output Power : -21 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -16.9 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Es/No
                    : 13.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -419 us (281684 us)
Frequency correction: 10 Hz
System Information:
                    : SEE-SACO-22210
    Name
    Location
                        : SÃO FRANCISCO - MG
    Contact
    System Up time : 0 days, 00:27:52 CPU Load : 46%
    System time(UTC) : 23 October 2017 12:03:16
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                       : 120026 R6.2
MAC addresses:
    Ethernet (LAN) : 00:20:0e:10:54:a1 Satellite (DVB) : 00:20:0e:10:54:a1
NetAddr
            State MacAddr
     10.213.9.2 Dynamic 1c:39:47:5b:e2:48 1
Pinging 10.213.9.1 with 32 bytes of data:
Reply from 10.213.9.1: bytes=32 time=558ms TTL=56
Reply from 10.213.9.1: bytes=32 time=559ms TTL=56
Reply from 10.213.9.1: bytes=32 time=552ms TTL=56
Reply from 10.213.9.1: bytes=32 time=549ms TTL=56
Reply from 10.213.9.1: bytes=32 time=562ms TTL=56
Reply from 10.213.9.1: bytes=32 time=552ms TTL=56
Reply from 10.213.9.1: bytes=32 time=577ms TTL=56
Reply from 10.213.9.1: bytes=32 time=548ms TTL=56
Reply from 10.213.9.1: bytes=32 time=949ms TTL=56
Reply from 10.213.9.1: bytes=32 time=561ms TTL=56
Ping statistics for 10.213.9.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 548ms, Maximum = 949ms, Average = 596ms
```

Lista de sites acessados:
www.globo.com – ok
<u>www.hotmail.com</u> – ok
www.google.com – ok
www.educacao.mg.gov.br – ok
www.prodemge.gov.br – ok
Responsável pelo teste de navegação: Nome: Elda Vieira Almeida Função: Professora Identidade: MG 10.815.911
Telefone: não tem
Horário de funcionamento – 07hrs às 17:30hrs