

# TERMO DE ACEITE TÉCNICO

Name

Solicitante: PRODEMGE / SEE

NOC/Operadora: Ermínio Junior

GRE/Prodemge: João Antinossi


Consórcio
EMC/Vodanet

SEE-BOAS-22106

Porta kbps
2Mbps

Plataforma
VSAT



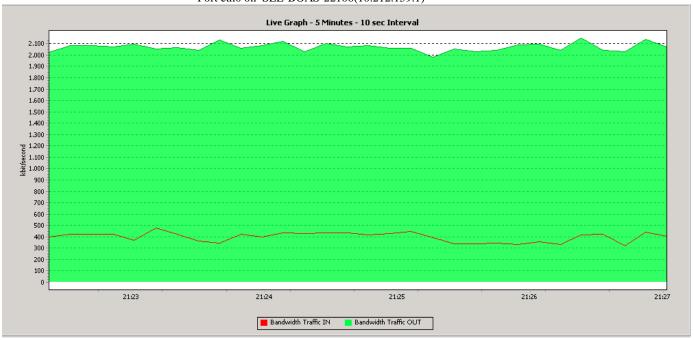

#### SatLink 2000

- Main board ID 120026, Revision R6.2
- SW ID 120208, Revision 16.0.1 Build 57

# dvb rx show

### Satellite (DVB) RX Configuration

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName

Enable

\* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E 1 1 16.667000 11.962753 DVB-S2 2 0 0.0 E Yes

#### Satellite (DVB) Receiver Status

Rx State : On

DVB State : Forward link up

Network : 65281, Prodemge@Vodanet

Frequency : 12.176674 GHz Symbol Rate : 4.883026 Msps

S2 ModCod

- receiving : 20 16APSK-4/5 - current max : 21 16APSK-5/6

Pilot : On Frame length : Short DVB S2 Mode : ACM

```
DVB S2 Stream type: MPEG-TS
Roll off
            : 0.20
SNR
             : 15.6 dB
Input Power
               : -36 dBm
# dvb tx show
Satellite (DVB) TX Configuration
          : Enabled
Auto start
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
             : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode
                : VC-Mux
Header Compression: UDP/IP
Satellite (DVB) Transmitter Status
            : On (DVB-RCS2)
IDU Output Power : -20.6 dBm
ODU Output Power : 33.3 dBm
             : 46.6 dBW
Es/No
             : 13.5 dB
Header Compression: Disabled - HC for RCS2 not supported by HUB
Timing correction : -452 us (281581 us)
Frequency correction: 40 Hz
# arp show
             State MacAddr
 NetAddr
  10.212.159.2 Dynamic 64:1c:67:62:2e:12 1
# device show
System Information:
  Name
                : SEE-BOAS-22106
  Location
                : BONITO DE MINAS
  Contact
  System Up time
                    : 0 days, 00:22:13
                  : 16%
  CPU Load
  System time(UTC) : 13 November 2017 12:31:46
  Broadcast Message : not set
HW:
  Model
                : SatLink 2000
  HW ID
                : 120033
  Main board ID
                  : 120026 R6.2
MAC addresses:
  Ethernet (LAN)
                   : 00:20:0e:10:55:09
  Satellite (DVB)
                  : 00:20:0e:10:55:09
Pinging 10.212.159.1 with 32 bytes of data:
Reply from 10.212.159.1: bytes=32 time=555ms TTL=56
Reply from 10.212.159.1: bytes=32 time=540ms TTL=56
Reply from 10.212.159.1: bytes=32 time=564ms TTL=56
Reply from 10.212.159.1: bytes=32 time=539ms TTL=56
Reply from 10.212.159.1: bytes=32 time=502ms TTL=56
Reply from 10.212.159.1: bytes=32 time=576ms TTL=56
Reply from 10.212.159.1: bytes=32 time=544ms TTL=56
Reply from 10.212.159.1: bytes=32 time=554ms TTL=56
Reply from 10.212.159.1: bytes=32 time=599ms TTL=56
Reply from 10.212.159.1: bytes=32 time=536ms TTL=56
Ping statistics for 10.212.159.1:
  Packets: Sent = 10, Received = 10, Lost = 0 (0\% loss),
Approximate round trip times in milli-seconds:
```

Minimum = 502ms, Maximum = 599ms, Average = 580ms

www.yahoo.com.br

## www.hotmail.com

### www.google.com

## www.prodemge.gov.br

Responsável	Ana Pimenta
Cargo	Diretora
Identidade	666.394-2
Telefone	038-9-9937-3003
Funcionamento	07:00- 16:50