TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

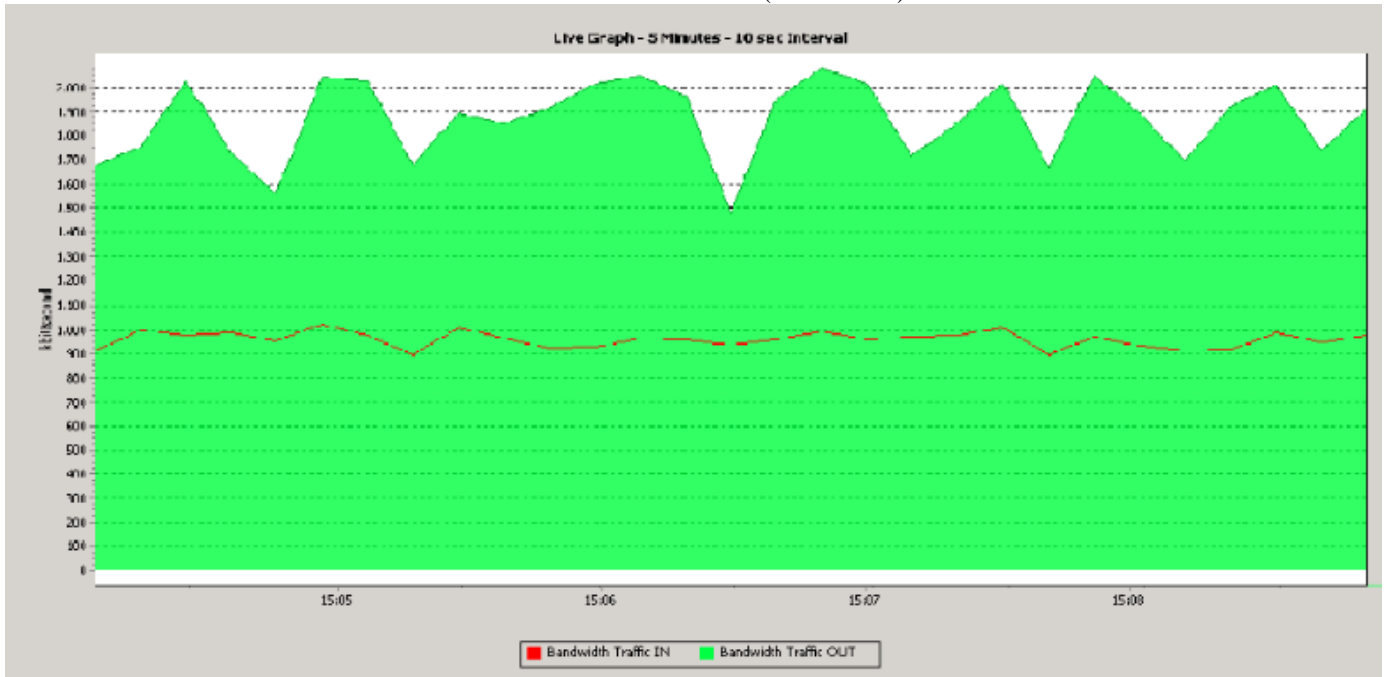|	
NOC/Operadora: Ermínio Junior	**Operadora/Cliente** Rodrigo Alves
GRE/Prodemge: João Antinossi	**Responsável/cliente** Sueli Fernandes Silva

Consórcio EMC/Vodanet	**VSAT-ID** SEE-MILA-23333	**Porta kbps** 2Mbps	**Plataforma** VSAT

Port eth 1 SEE-MILA-23333(10.213.225.1)

SatLink 2000
- Main board ID 120026, Revision R6.1
- SW ID 120208, Revision 16.0.1 Build 57
dvb tx show

Satellite (DVB) TX Configuration

Auto start   : Enabled
IDU Output Power   : -30 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power   : 33.2 dBm
EIRP   : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode   : VC-Mux
Header Compression : UDP/IP

Satellite (DVB) Transmitter Status

State   : On (DVB-RCS2)
IDU Output Power   : -18.6 dBm
ODU Output Power   : 31.5 dBm
EIRP   : 44.8 dBW
Es/No   : 13.0 dB
Header Compression : Disabled - HC for RCS2 not supported by HUB
Timing correction   : -282 us (281434 us)
Frequency correction: 200 Hz
dvb rx show

Satellite (DVB) RX Configuration

Auto start   : Enabled

Max Traffic MODCOD   : 23   16APSK-9/10
RX watchdog   : 15 minute

Idx	Pri	SymbRate[Msps]	Freq[GHz]	Mode	PopId	SatId	Pos	SatName	Name	Enable
* 0	0	4.883300	12.176420	DVB-S2	104	0	0.0 E			Yes
1	1	16.667000	11.962753	DVB-S2	2	0	0.0 E			Yes

Satellite (DVB) Receiver Status

Rx State   : On
DVB State   : Forward link up
Network   : 65281, Prodemge@Vodanet
Frequency   : 12.176295 GHz
Symbol Rate   : 4.883016 Msps
S2 ModCod
   - receiving : 21   16APSK-5/6
   - current max : 21   16APSK-5/6
Pilot   : On
Frame length   : Short
DVB S2 Mode   : ACM
DVB S2 Stream type : MPEG-TS
Roll off   : 0.20
SNR   : 17.1 dB
Input Power   : -28 dBm
arp show

  NetAddr   State   MacAddr   If
  10.213.225.2 Dynamic 2c:27:d7:a0:cd:ed   1
device show
System Information:
   Name   : SEE-MILA-23333
   Location   : Mirabela
   Contact   :
   System Up time   : 0 days, 00:11:51
   CPU Load   : 13%
   System time(UTC)   : 05 December 2017 18:35:48
   Broadcast Message : not set

HW:
   Model   : SatLink 2000
   HW ID   : 120033
   Main board ID   : 120026 R6.1

MAC addresses:
   Ethernet (LAN)   : 00:20:0e:10:48:79
   Satellite (DVB)   : 00:20:0e:10:48:79

Pinging 10.213.225.1 with 32 bytes of data:

Reply from 10.213.225.1: bytes=32 time=537ms TTL=56
Reply from 10.213.225.1: bytes=32 time=576ms TTL=56
Reply from 10.213.225.1: bytes=32 time=562ms TTL=56
Reply from 10.213.225.1: bytes=32 time=558ms TTL=56
Reply from 10.213.225.1: bytes=32 time=553ms TTL=56
Reply from 10.213.225.1: bytes=32 time=529ms TTL=56
Reply from 10.213.225.1: bytes=32 time=517ms TTL=56
Reply from 10.213.225.1: bytes=32 time=558ms TTL=56
Reply from 10.213.225.1: bytes=32 time=588ms TTL=56
Reply from 10.213.225.1: bytes=32 time=573ms TTL=56

Ping statistics for 10.213.225.1:
   Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
   Minimum = 517ms, Maximum = 588ms, Average = 555ms

Resp: Sueli Fernandes Silva
Cargo: Diretora
Masp:895156
Telefone:****
Funcionamento:07:00-21:20
Onde ficou: Secretaria

www.hotmail.com

www.google.com

www.prodemge.gov.br

www.globo.com

www.youtube.com