

TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE


NOC/Operadora: Pedro Bernardes Operadora/Cliente: Jean Polini

GRE/Prodemge: João Antinossi Responsável/cliente: Flavio Lehmann

> Porta kbps Consórcio **VSAT-ID** Plataforma EMC/Vodanet SEE-REOR-23201 2Mbps **VSAT**

> > Port eth0 on SEE-REOR-23201 (10.214.236.1)

Live Graph - 5 Minutes - 10 sec Interval

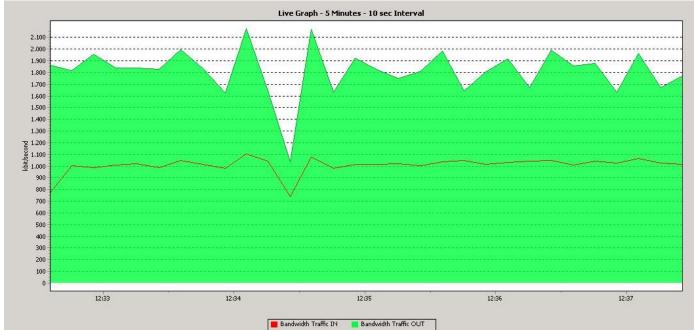

Satellite (DVB) RX Configuration _____

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

8.883000 12.176420 DVB-S2 104 0 0.0 E * 0 0

Yes

12.176420 DVB-S2 2 0 0.0 E 1 1 4.883300

Yes

Satellite (DVB) Receiver Status

Rx State : On

: Forward link up DVB State

Network : 65281, Prodemge@Vodanet

: 65281, Proder : 12.176400 GHz Frequency Symbol Rate : 8.883012 Msps

S2 ModCod

- receiving : 21 16APSK-5/6 - current max : 21 16APSK-5/6

Pilot : On Frame length : Short DVB S2 Mode : ACM DVB S2 Stream type : MPEG-TS Roll off : 0.20 : 14.0 dB SNR : -31 dBm Input Power

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
______
State : On (DVB-RCS2)
IDU Output Power : -18.0 dBm
ODU Output Power : 33.1 dBm
EIRP
                    : 46.4 dBW
Es/No
                    : 13.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -172 us (265698 us)
Frequency correction: 130 Hz
System Information:
                   : SEE-REOR-23201
    Name
    Location
                        : RESPLENDOR - MG
    Contact
    System Up time : 0 days, 00:03:22 CPU Load : 18%
    System time(UTC) : 11 December 2017 20:18:16
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                       : 120026 R6.2
    conernet (LAN) : 00:20:0e:10:5b:71
Satellite (DVB) : 00:20:00:10:5
MAC addresses:
    Ethernet (LAN)
NetAddr
             State MacAddr
   10.214.236.2 Dynamic 64:1c:67:62:2e:12 1
Pinging 10.214.236.1 with 32 bytes of data:
Reply from 10.214.236.1: bytes=32 time=588ms TTL=56
Reply from 10.214.236.1: bytes=32 time=581ms TTL=56
Reply from 10.214.236.1: bytes=32 time=582ms TTL=56
Reply from 10.214.236.1: bytes=32 time=523ms TTL=56
Reply from 10.214.236.1: bytes=32 time=572ms TTL=56
Reply from 10.214.236.1: bytes=32 time=527ms TTL=56
Reply from 10.214.236.1: bytes=32 time=550ms TTL=56
Reply from 10.214.236.1: bytes=32 time=549ms TTL=56
Reply from 10.214.236.1: bytes=32 time=536ms TTL=56
Reply from 10.214.236.1: bytes=32 time=596ms TTL=56
Ping statistics for 10.214.236.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 523ms, Maximum = 596ms, Average = 560ms
```

Lista de sites acessados:

<u>www.globo.com</u> – ok

www.yahoo.com – ok

<u>www.hotmail.com</u> – ok

www.google.com - ok

<u>www.educacao.mg.gov.br</u> – ok

www.prodemge.gov.br - ok

Responsável pelo teste de navegação:

Nome: Flavio Lehmann

Função: Diretor MASP: 853899-3

Telefone: 33-999402121

Funcionamento: 07:00h às 17:00h