


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Gustavo de Oliveira

GRE/Prodemge: João Antinossi Responsável/cliente: Helena Machado de Souza

> Consórcio **VSAT-ID** Porta kbps **Plataforma** EMC/Vodanet SEE-VIPA-22797 2Mbps **VSAT**

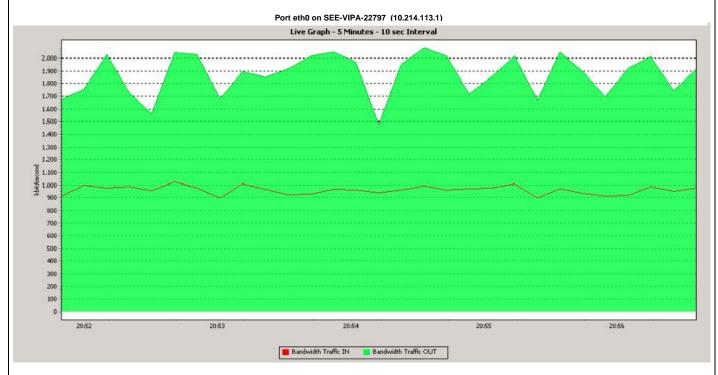

Satellite (DVB) RX Configuration ______ Auto start : Enabled

Auto start

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

4.883300 12.176420 DVB-S2 104 * 0 0 0 0.0 E

Yes

11.962753 DVB-S2 2 0 0.0 E 1 16.667000

Yes

Satellite (DVB) Receiver Status

: On Rx State

: Forward link up DVB State

: 65281, Prodemge@Vodanet Network

: 12.176437 GHz Frequency Symbol Rate : 4.882978 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On Frame length : Short DVB S2 Mode : ACM DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 15.1 dB

```
Input Power
                    : -34 dBm
Satellite (DVB) TX Configuration
_____
Auto start : Enabled IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
                    : VC-Mux
ATM mode
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -19.6 dBm
ODU Output Power : 32.8 dBm
EIRP
                    : 46.1 dBW
Es/No
                    : 13.5 dB
{\tt Header\ Compression} : Disabled - HC for RCS2 not supported by HUB
Timing correction : -773 us (281378 us)
Frequency correction: 80 Hz
System Information:
   Name
                        : SEE-VIPA-22797
                        : VIRGEM DA LAPA
    Location
    Contact
    System Up time : 0 days, 00:11:41
CPU Load : 13%
System time(UTC) : 17 November 2017 22:18:51
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                        : 120026 R6.2
MAC addresses:
    Ethernet (LAN) : 00:20:0e:10:58:cd Satellite (DVB) : 00:20:0e:10:58:cd
             State MacAddr
   10.214.113.2 Dynamic 64:1c:67:61:83:29 1
Pinging 10.214.113.1 with 32 bytes of data:
Reply from 10.214.113.1: bytes=32 time=624ms TTL=56
Reply from 10.214.113.1: bytes=32 time=557ms TTL=56
Reply from 10.214.113.1: bytes=32 time=583ms TTL=56
Reply from 10.214.113.1: bytes=32 time=551ms TTL=56
Reply from 10.214.113.1: bytes=32 time=579ms TTL=56
Reply from 10.214.113.1: bytes=32 time=557ms TTL=56
Reply from 10.214.113.1: bytes=32 time=564ms TTL=56
Reply from 10.214.113.1: bytes=32 time=562ms TTL=56
Reply from 10.214.113.1: bytes=32 time=599ms TTL=56
Reply from 10.214.113.1: bytes=32 time=562ms TTL=56
Ping statistics for 10.214.113.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 551ms, Maximum = 624ms, Average = 573ms
```

Lista de sites acessados: www.globo.com - ok www.yahoo.com - ok www.hotmail.com - ok www.google.com - ok www.educacao.mg.gov.br - ok www.prodemge.gov.br - ok

Responsável pelo teste de navegação: Nome: Helena Machado de Souza

Função: Diretora MASP: 560278-4

Telefone: (33) 9 88526522

Funcionamento: 06:00 as 18:00