


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Ermínio Junior Operadora/Cliente: Ederson Martins

GRE/Prodemge: João Antinossi Responsável/cliente : Sandra Marques Veloso

ConsórcioVSAT-IDPorta kbpsPlataformaEMC/VodanetSEE-SACO-222312MbpsVSAT

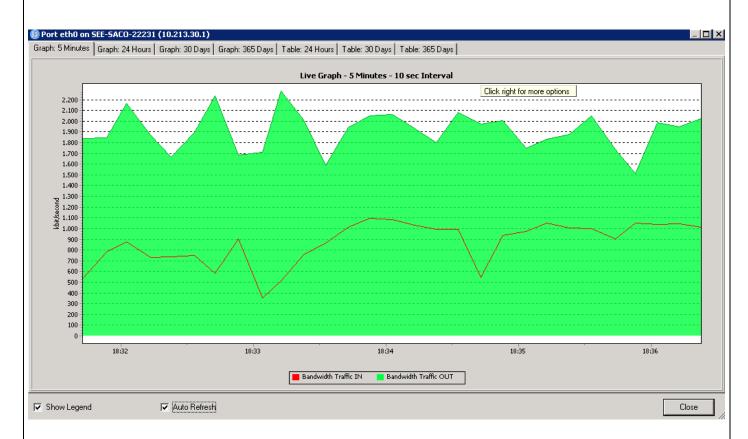

OBS: TESTE FEITO COM CHUVA CONSTANTE

dvb tx show

Satellite (DVB) TX Configuration

Auto start : Enabled

IDU Output Power : -21 dBm

IDU Max Output Power: 0.0 dBm

ODU Output Power : 33.2 dBm

EIRP : 46.5 dBW

Default CW Frequency: 0.000000 GHz ATM mode : VC-Mux **Header Compression: UDP/IP Satellite (DVB) Transmitter Status** State : On (DVB-RCS2) IDU Output Power : -15.6 dBm ODU Output Power : 31.6 dBm EIRP : 44.9 dBW Es/No : 14.5 dB Header Compression: Disabled - HC for RCS2 not supported by HUB Timing correction: -323 us (281687 us) Frequency correction: 80 Hz # dvb rx show Satellite (DVB) RX Configuration -----Auto start : Enabled Max Traffic MODCOD : 23 16APSK-9/10 RX watchdog : 15 minute Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name Enable * 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E Yes Satellite (DVB) Receiver Status -----Rx State : On **DVB State**: Forward link up

Network : 65281, Prodemge@Vodanet

Frequency : 12.176731 GHz

Symbol Rate : 4.882954 Msps

S2 ModCod

- receiving : 4 QPSK-1/2

- current max : 21 16APSK-5/6

Pilot : On

Frame length : Short

DVB S2 Mode : ACM

DVB S2 Stream type: MPEG-TS

Roll off : 0.20

SNR : 15.5 dB

Input Power : -37 dBm

arp show

NetAddr State MacAddr If

10.213.30.2 Dynamic 1c:39:47:5b:e2:48 1

device show

System Information:

Name : SEE-SACO-22231

Location : S O FARNCISCO

Contact :

System Up time : 0 days, 00:17:34

CPU Load : 20%

System time(UTC) : 17 October 2017 17:34:03

Broadcast Message: not set

HW:

Model : SatLink 2000

HW ID : 120033

Main board ID : 120026 R6.2

MAC addresses:

Ethernet (LAN) : 00:20:0e:10:5e:8f

Satellite (DVB) : 00:20:0e:10:5e:8f

Pinging 10.213.30.1 with 32 bytes of data:

Reply from 10.213.30.1: bytes=32 time=547ms TTL=56

Reply from 10.213.30.1: bytes=32 time=534ms TTL=56

Reply from 10.213.30.1: bytes=32 time=526ms TTL=56

Reply from 10.213.30.1: bytes=32 time=533ms TTL=56

Reply from 10.213.30.1: bytes=32 time=520ms TTL=56

Reply from 10.213.30.1: bytes=32 time=520ms TTL=56

Reply from 10.213.30.1: bytes=32 time=557ms TTL=56

Reply from 10.213.30.1: bytes=32 time=557ms TTL=56

Reply from 10.213.30.1: bytes=32 time=528ms TTL=56

Reply from 10.213.30.1: bytes=32 time=536ms TTL=56

Ping statistics for 10.213.30.1:

Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),

Approximate round trip times in milli-seconds:

Minimum = 520ms, Maximum = 557ms, Average = 535ms

Sites acessados

www.globo.com ok

www.yahoo.com.br- ok

www.hotmail.com- ok

www.google.com - ok

www.prodemge.gov.br - ok

Nome do responsável: Sandra Marques Veloso Cargo: Diretora MASP: MGS86.3252 Funcionamento: 07:00 até 16:15	
	Cargo: Diretora MASP: MG586.3252