


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Gilvan Junior

Responsável/cliente: Cleides Alves Cordeiro GRE/Prodemge: João Antinossi

> Porta kbps Plataforma Consórcio **VSAT-ID** EMC/Vodanet **VSAT** SEE-JABA-22531 2Mbps

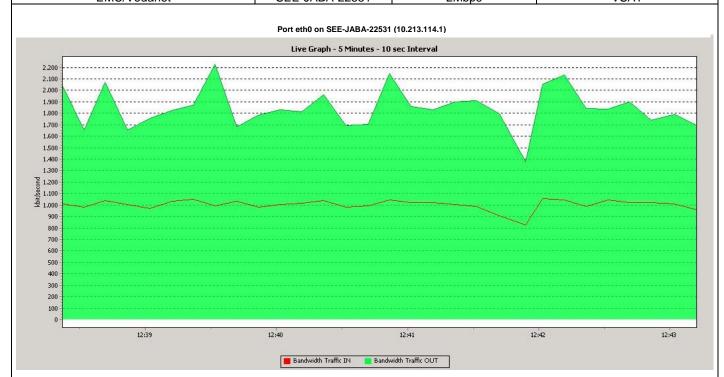

Satellite (DVB) RX Configuration _____

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

4.883300 12.176420 DVB-S2 104 0 0.0 E * 0 0

Yes

Satellite (DVB) Receiver Status ______

Rx State : On

DVB State : Forward link up

: 65281, Prodemge@Vodanet

: 65281, Proder : 12.176525 GHz Frequency Symbol Rate : 4.883016 Msps

S2 ModCod

- receiving : 21 16APSK-5/6 - current max : 21 16APSK-5/6

Pilot : On Frame length : Shor DVB S2 Mode : ACM : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 : 15.8 dB SNR Input Power : -34 dBm

```
Satellite (DVB) TX Configuration
_____
Auto start
                    : Enabled
IDU Output Power : -21 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : max
EIRP
                     : max
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -15.8 dBm
ODU Output Power : 34.0 dBm
EIRP
                     : 47.3 dBW
Es/No
                     : 13.0 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -409 us (281127 us)
Frequency correction: 0 Hz
System Information:
    Name
                        : SEE-JABA-22531
    Location
                         : JANAÚBA - MG
    Contact
    System Up time : 0 days, 00:23:22

CPU Load : 16%

System time(UTC) : 09 November 2017 12:50:24
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                        : 120026 R6.2
MAC addresses:
   Ethernet (LAN) : 00:20:0e:10:58:b3
Satellite (DVB) : 00:20:0e:10:58:b3
NetAddr
          State MacAddr
   10.213.114.2 Dynamic e8:9a:8f:b7:bd:4a 1
Pinging 10.213.114.1 with 32 bytes of data:
Reply from 10.213.114.1: bytes=32 time=520ms TTL=56
Reply from 10.213.114.1: bytes=32 time=534ms TTL=56
Reply from 10.213.114.1: bytes=32 time=536ms TTL=56
Reply from 10.213.114.1: bytes=32 time=619ms TTL=56
Reply from 10.213.114.1: bytes=32 time=558ms TTL=56
Reply from 10.213.114.1: bytes=32 time=533ms TTL=56
Reply from 10.213.114.1: bytes=32 time=528ms TTL=56
Reply from 10.213.114.1: bytes=32 time=576ms TTL=56
Reply from 10.213.114.1: bytes=32 time=531ms TTL=56
Reply from 10.213.114.1: bytes=32 time=558ms TTL=56
Ping statistics for 10.213.114.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 520ms, Maximum = 619ms, Average = 549ms
```

Lista de sites acessados:

<u>www.globo.com</u> – ok <u>www.yahoo.com</u> – ok

<u>www.hotmail.com</u> – ok

<u>www.google.com</u> – ok

www.educacao.mg.gov.br - ok

<u>www.prodemge.gov.br</u> – ok

Responsável pelo teste de navegação:

Nome: Cleides Alves Cordeiro

Função: Diretora MASP: 946814-1

Telefone: 38-3822-3006

Funcionamento: 07:00 às 23:30h