


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Gustavo de Oliveira da Silva

GRE/Prodemge: João Antinossi Responsável/cliente: Flavia de Souza

> Porta kbps Plataforma Consórcio **VSAT-ID** EMC/Vodanet SEE-CAGA-23376 2Mbps VSAT

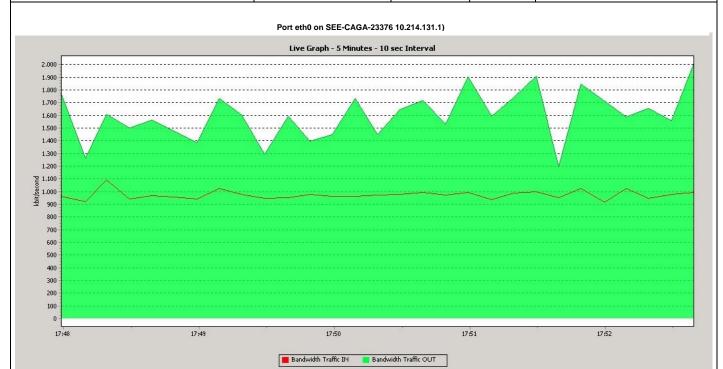

Satellite (DVB) RX Configuration _____ Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

8.883000 12.176420 DVB-S2 104 0 0.0 E * 0 0

Yes

12.176420 DVB-S2 104 0 0.0 E 4.883300 1 1

Yes

Satellite (DVB) Receiver Status

: On Rx State

: Forward link up DVB State

Network : 65281, Prodemge@Vodanet

: 65281, Proder : 12.176065 GHz Frequency Symbol Rate : 8.882901 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 22 16APSK-8/9

: On Pilot Pilot
Frame length : Short
ACM : ACM : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 : 16.8 dB SNR : -31 dBm Input Power

```
Satellite (DVB) TX Configuration
______
Auto start
                   : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                   : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -17.0 dBm
ODU Output Power : 33.0 dBm
EIRP
                    : 46.3 dBW
Es/No
                    : 14.0 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -238 us (266135 us)
Frequency correction: 130 Hz
System Information:
   Name
                       : SEE-CAGA-23376
    Location
                       : Caratinga - MG
    Contact
   Broadcast Message : not set
HW:
    Model
                       : SatLink 2000
    HW ID
                       : 120033
    Main board ID
                       : 120026 R6.2
    Satellite (DVB) : 00:20:0e:10:94:c4 : 00:20:0e:10:94:c4
MAC addresses:
Pinging 10.214.131.1 with 32 bytes of data:
Reply from 10.214.131.1: bytes=32 time=574ms TTL=56
Reply from 10.214.131.1: bytes=32 time=538ms TTL=56
Reply from 10.214.131.1: bytes=32 time=552ms TTL=56
Reply from 10.214.131.1: bytes=32 time=588ms TTL=56
Reply from 10.214.131.1: bytes=32 time=565ms TTL=56
Reply from 10.214.131.1: bytes=32 time=553ms TTL=56
Reply from 10.214.131.1: bytes=32 time=545ms TTL=56
Reply from 10.214.131.1: bytes=32 time=543ms TTL=56
Reply from 10.214.131.1: bytes=32 time=554ms TTL=56
Reply from 10.214.131.1: bytes=32 time=570ms TTL=56
Ping statistics for 10.214.131.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 538ms, Maximum = 588ms, Average = 558ms
```

Lista de sites acessados: <u>www.globo.com</u> – ok www.yahoo.com – ok <u>www.hotmail.com</u> – ok www.google.com - ok <u>www.educacao.mg.gov.br</u> – ok www.prodemge.gov.br - ok Responsável pelo teste de navegação: Nome: Flavia de Souza Função: Diretora MASP: 879583-3 Telefone: (33) 9 9981-6917 Horário: 07:00 as 21:45