


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Fabio Fernandes

GRE/Prodemge: João Antinossi Responsável/cliente: Niliana Renata Miranda Campos

ConsórcioVSAT-IDPorta kbpsPlataformaEMC/VodanetSEE-SAIS-223872MbpsVSAT

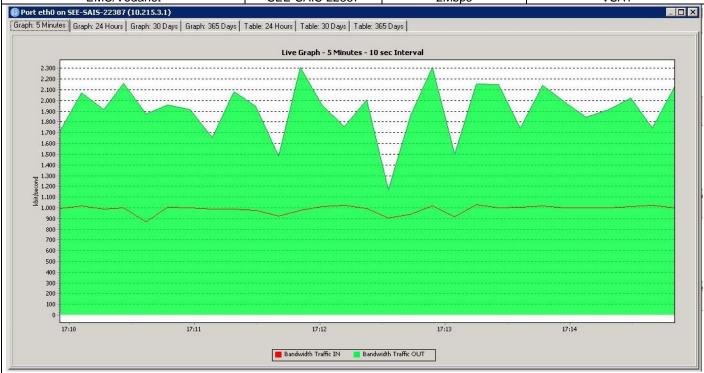

Satellite (DVB) RX Configuration

Auto start : Enabled

Muco scare . Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

IdxPriSymbRate[Msps]Freq[GHz]ModePopIdSatIdPosSatNameName

Enable

* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E

Yes

1 1 16.667000 11.962753 DVB-S2 2 0 0.0 E

Yes

Satellite (DVB) Receiver Status

Rx State : On

DVB State : Forward link up

Network : 65281, Prodemge@Vodanet

Frequency : 12.176446 GHz Symbol Rate : 4.883087 Msps

S2 ModCod

- receiving : 20 16APSK-4/5 - current max : 21 16APSK-5/6

Pilot : On
Frame length : Short
DVB S2 Mode : ACM
DVB S2 Stream type : MPEG-TS
Roll off : 0.20
SNR : 16.0 dB
Input Power : -30 dBm

```
Satellite (DVB) TX Configuration
______
Auto start
                   : Enabled
IDU Output Power : -25 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -17.1 dBm
ODU Output Power : 33.0 dBm
EIRP
                    : 46.3 dBW
Es/No
                    : 15.0 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -354 us (281546 us)
Frequency correction: 110 Hz
System Information:
              : SEE-SAIS-22387
   Name
    Location
                        : SABINÓPOLIS - MG
    Contact
   System Up time : 0 days, 07:50:25
CPU Load : 14%
    System time (UTC) : 31 October 2017 13:43:01
    Broadcast Message : not set
HW:
    Model
                       : SatLink 2000
    HW ID
                       : 120033
    Main board ID
                       : 120026 R6.2
MAC addresses:
   Ethernet (LAN) : 00:20:0e:10:4c:20
Satellite (DVB) : 00:20:0e:10:4c:20
NetAddr
            State MacAddr
     10.215.3.3 Dynamic b8:ae:ed:8b:9d:34 1
Pinging 10.215.3.1 with 32 bytes of data:
Reply from 10.215.3.1: bytes=32 time=590ms TTL=56
Reply from 10.215.3.1: bytes=32 time=535ms TTL=56
Reply from 10.215.3.1: bytes=32 time=523ms TTL=56
Reply from 10.215.3.1: bytes=32 time=557ms TTL=56
Reply from 10.215.3.1: bytes=32 time=559ms TTL=56
Reply from 10.215.3.1: bytes=32 time=537ms TTL=56
Reply from 10.215.3.1: bytes=32 time=929ms TTL=56
Reply from 10.215.3.1: bytes=32 time=607ms TTL=56
Reply from 10.215.3.1: bytes=32 time=535ms TTL=56
Reply from 10.215.3.1: bytes=32 time=538ms TTL=56
Ping statistics for 10.215.3.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 523ms, Maximum = 929ms, Average = 591ms
```

Lista de sites acessados:
www.globo.com - ok www.hotmail.com - ok www.google.com - ok www.educacao.mg.gov.br - ok www.prodemge.gov.br - ok
Responsável pelo teste de navegação: Nome: Niliana Renata Miranda Campos Função: Identidade: MASP 1107912-6
Telefone: não tem
Horário de funcionamento – 07hrs às 18hrs