


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Gustavo de Oliveira da Silva

GRE/Prodemge: João Antinossi Responsável/cliente: Rafael Juliano Araujo Ferreira

> Porta kbps Plataforma Consórcio **VSAT-ID VSAT** EMC/Vodanet SEE-JAIA-21956 2Mbps

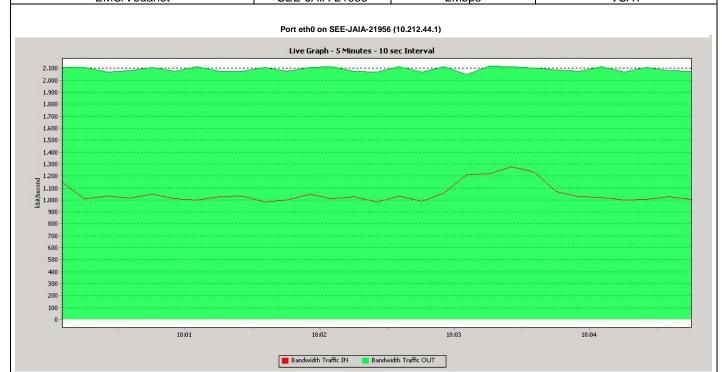

Satellite (DVB) RX Configuration _____ Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E

Yes

0 0.0 E 16.667000 11.962753 DVB-S2 2 1 1

Yes

Satellite (DVB) Receiver Status

: On Rx State

DVB State

Network

: Forward link up : 65281, Prodemge@Vodanet : 12.176130 GHz Frequency Symbol Rate : 4.882930 Msps

S2 ModCod

- receiving : 21 16APSK-5/6 - current max : 21 16APSK-5/6

: On Pilot Frame length : Shor : Short DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 16.1 dB : -26 dBm Input Power

```
Satellite (DVB) TX Configuration
______
Auto start
                    : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -19.2 dBm
ODU Output Power : 33.2 dBm
EIRP
                    : 46.5 dBW
Es/No
                    : 15.0 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -442 us (281656 us)
Frequency correction: 40 Hz
System Information:
                       : SEE-JAIA-21956
    Name
    Location
                        : JANUARIA - MG
    Contact
    System Up time : 7 days, 02:35:16 CPU Load : 13%
    System time (UTC) : 14 November 2017 12:32:28
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                        : 120026 R6.2
    Eunernet (LAN) : 00:20:0e:10:5d:34
Satellite (DVB) : 00:20:0e:10:5d:34
MAC addresses:
NetAddr
           State MacAddr
    10.212.44.2 Dynamic 6c:fd:b9:32:65:61 1
Pinging 10.212.44.1 with 32 bytes of data:
Reply from 10.212.44.1: bytes=32 time=537ms TTL=56
Reply from 10.212.44.1: bytes=32 time=518ms TTL=56
Reply from 10.212.44.1: bytes=32 time=565ms TTL=56
Reply from 10.212.44.1: bytes=32 time=556ms TTL=56
Reply from 10.212.44.1: bytes=32 time=550ms TTL=56
Reply from 10.212.44.1: bytes=32 time=526ms TTL=56
Reply from 10.212.44.1: bytes=32 time=535ms TTL=56
Reply from 10.212.44.1: bytes=32 time=530ms TTL=56
Reply from 10.212.44.1: bytes=32 time=546ms TTL=56
Reply from 10.212.44.1: bytes=32 time=542ms TTL=56
Ping statistics for 10.212.44.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 518ms, Maximum = 565ms, Average = 540ms
```

Lista de sites acessados:
www.globo.com – ok
www.yahoo.com – ok
www.hotmail.com – ok
www.google.com – ok
www.educacao.mg.gov.br – ok
www.prodemge.gov.br – ok
Responsável pelo teste de navegação:
Nome: Rafael Juliano Araujo Ferreira
Função: Diretor
MASP: 1114118-1
Telefone: (38) 99952-6377
Funcionamento: 07:00 às 18:00h