


TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Joao Gustavo

GRE/Prodemge: João Antinossi Responsável/cliente: Maria Aparecida de Carvalho Silva

ConsórcioVSAT-IDPorta kbpsPlataformaEMC/VodanetSEE-MOIA-221902MbpsVSAT

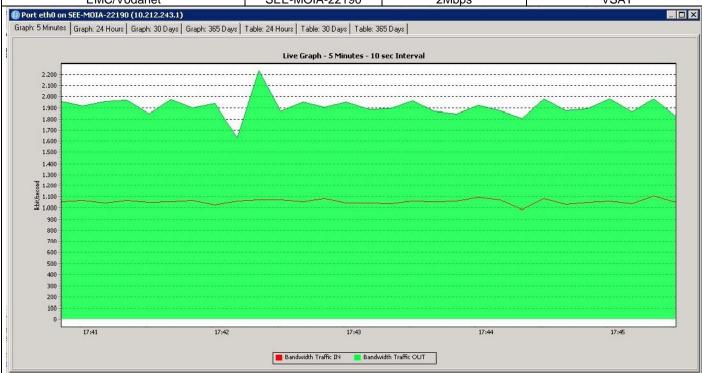

Satellite (DVB) RX Configuration

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

* 0 0 4.883300 12.176420 DVB-S2 104 0 0.0 E

Yes

1 1 16.667000 11.962753 DVB-S2 2 0 0.0 E

Yes

Satellite (DVB) Receiver Status

Rx State : On

DVB State : Forward link up

Network : 65281, Prodemge@Vodanet

Frequency : 12.176120 GHz Symbol Rate : 4.882946 Msps

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On
Frame length : Short

DVB S2 Mode : ACM

DVB S2 Stream type : MPEG-TS

Roll off : 0.20

SNR : 15.6 dB

Input Power : -37 dBm

```
Satellite (DVB) TX Configuration
_____
Auto start
                    : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : max
EIRP
                     : max
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
_____
State : On (DVB-RCS2)
IDU Output Power : -14.3 dBm
ODU Output Power : 34.8 dBm
EIRP
                     : 48.1 dBW
Es/No
                     : 14.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -283 us (281147 us)
Frequency correction: 130 Hz
System Information:
              : SEE-MOIA-22190
    Name
    Location
                         : MONTALVÂNIA - MG
    Contact
    System Up time : 0 days, 00:47:03

CPU Load : 15%

System time(UTC) : 30 October 2017 16:48:21
    Broadcast Message : not set
HW:
    Model
                        : SatLink 2000
    HW ID
                        : 120033
    Main board ID
                        : 120026 R6.2
MAC addresses:
   Ethernet (LAN) : 00:20:0e:10:5c:82
Satellite (DVB) : 00:20:0e:10:5c:82
NetAddr
             State MacAddr
   10.212.243.2 Dynamic b4:99:ba:00:92:6b
Pinging 10.212.243.1 with 32 bytes of data:
Reply from 10.212.243.1: bytes=32 time=534ms TTL=56
Reply from 10.212.243.1: bytes=32 time=522ms TTL=56
Reply from 10.212.243.1: bytes=32 time=546ms TTL=56
Reply from 10.212.243.1: bytes=32 time=533ms TTL=56
Reply from 10.212.243.1: bytes=32 time=531ms TTL=56
Reply from 10.212.243.1: bytes=32 time=553ms TTL=56
Reply from 10.212.243.1: bytes=32 time=529ms TTL=56
Reply from 10.212.243.1: bytes=32 time=541ms TTL=56
Reply from 10.212.243.1: bytes=32 time=546ms TTL=56
Reply from 10.212.243.1: bytes=32 time=528ms TTL=56
Ping statistics for 10.212.243.1:
    Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
    Minimum = 522ms, Maximum = 553ms, Average = 536ms
```

| Lista de sites acessados: |
|---|
| www.globo.com – ok |
| www.hotmail.com – ok |
| www.google.com – ok |
| www.educacao.mg.gov.br – ok |
| www.prodemge.gov.br – ok |
| Responsável pelo teste de navegação: Nome: Maria Aparecida de Carvalho Silva Função: Diretora Identidade: MASP 948151-6 |
| Telefone: 38-99993-7858 |
| Horário de funcionamento – 07hrs às 18hrs |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |
| |