


CHARGE-PERMIT-01 v0.2 – latch + CD signal actuator: complete charger NOT qualified

FAULT\_BUS\_N LOW clears Q even with ARM HIGH. Releasing fault alone does not re-arm.  
D and PRE tied HIGH. Only a new ARM rising edge after reset recovery may set Q. Q-bar intentionally unused.  
External fault sources / MCU revoke must sink or release; never drive shared bus HIGH.

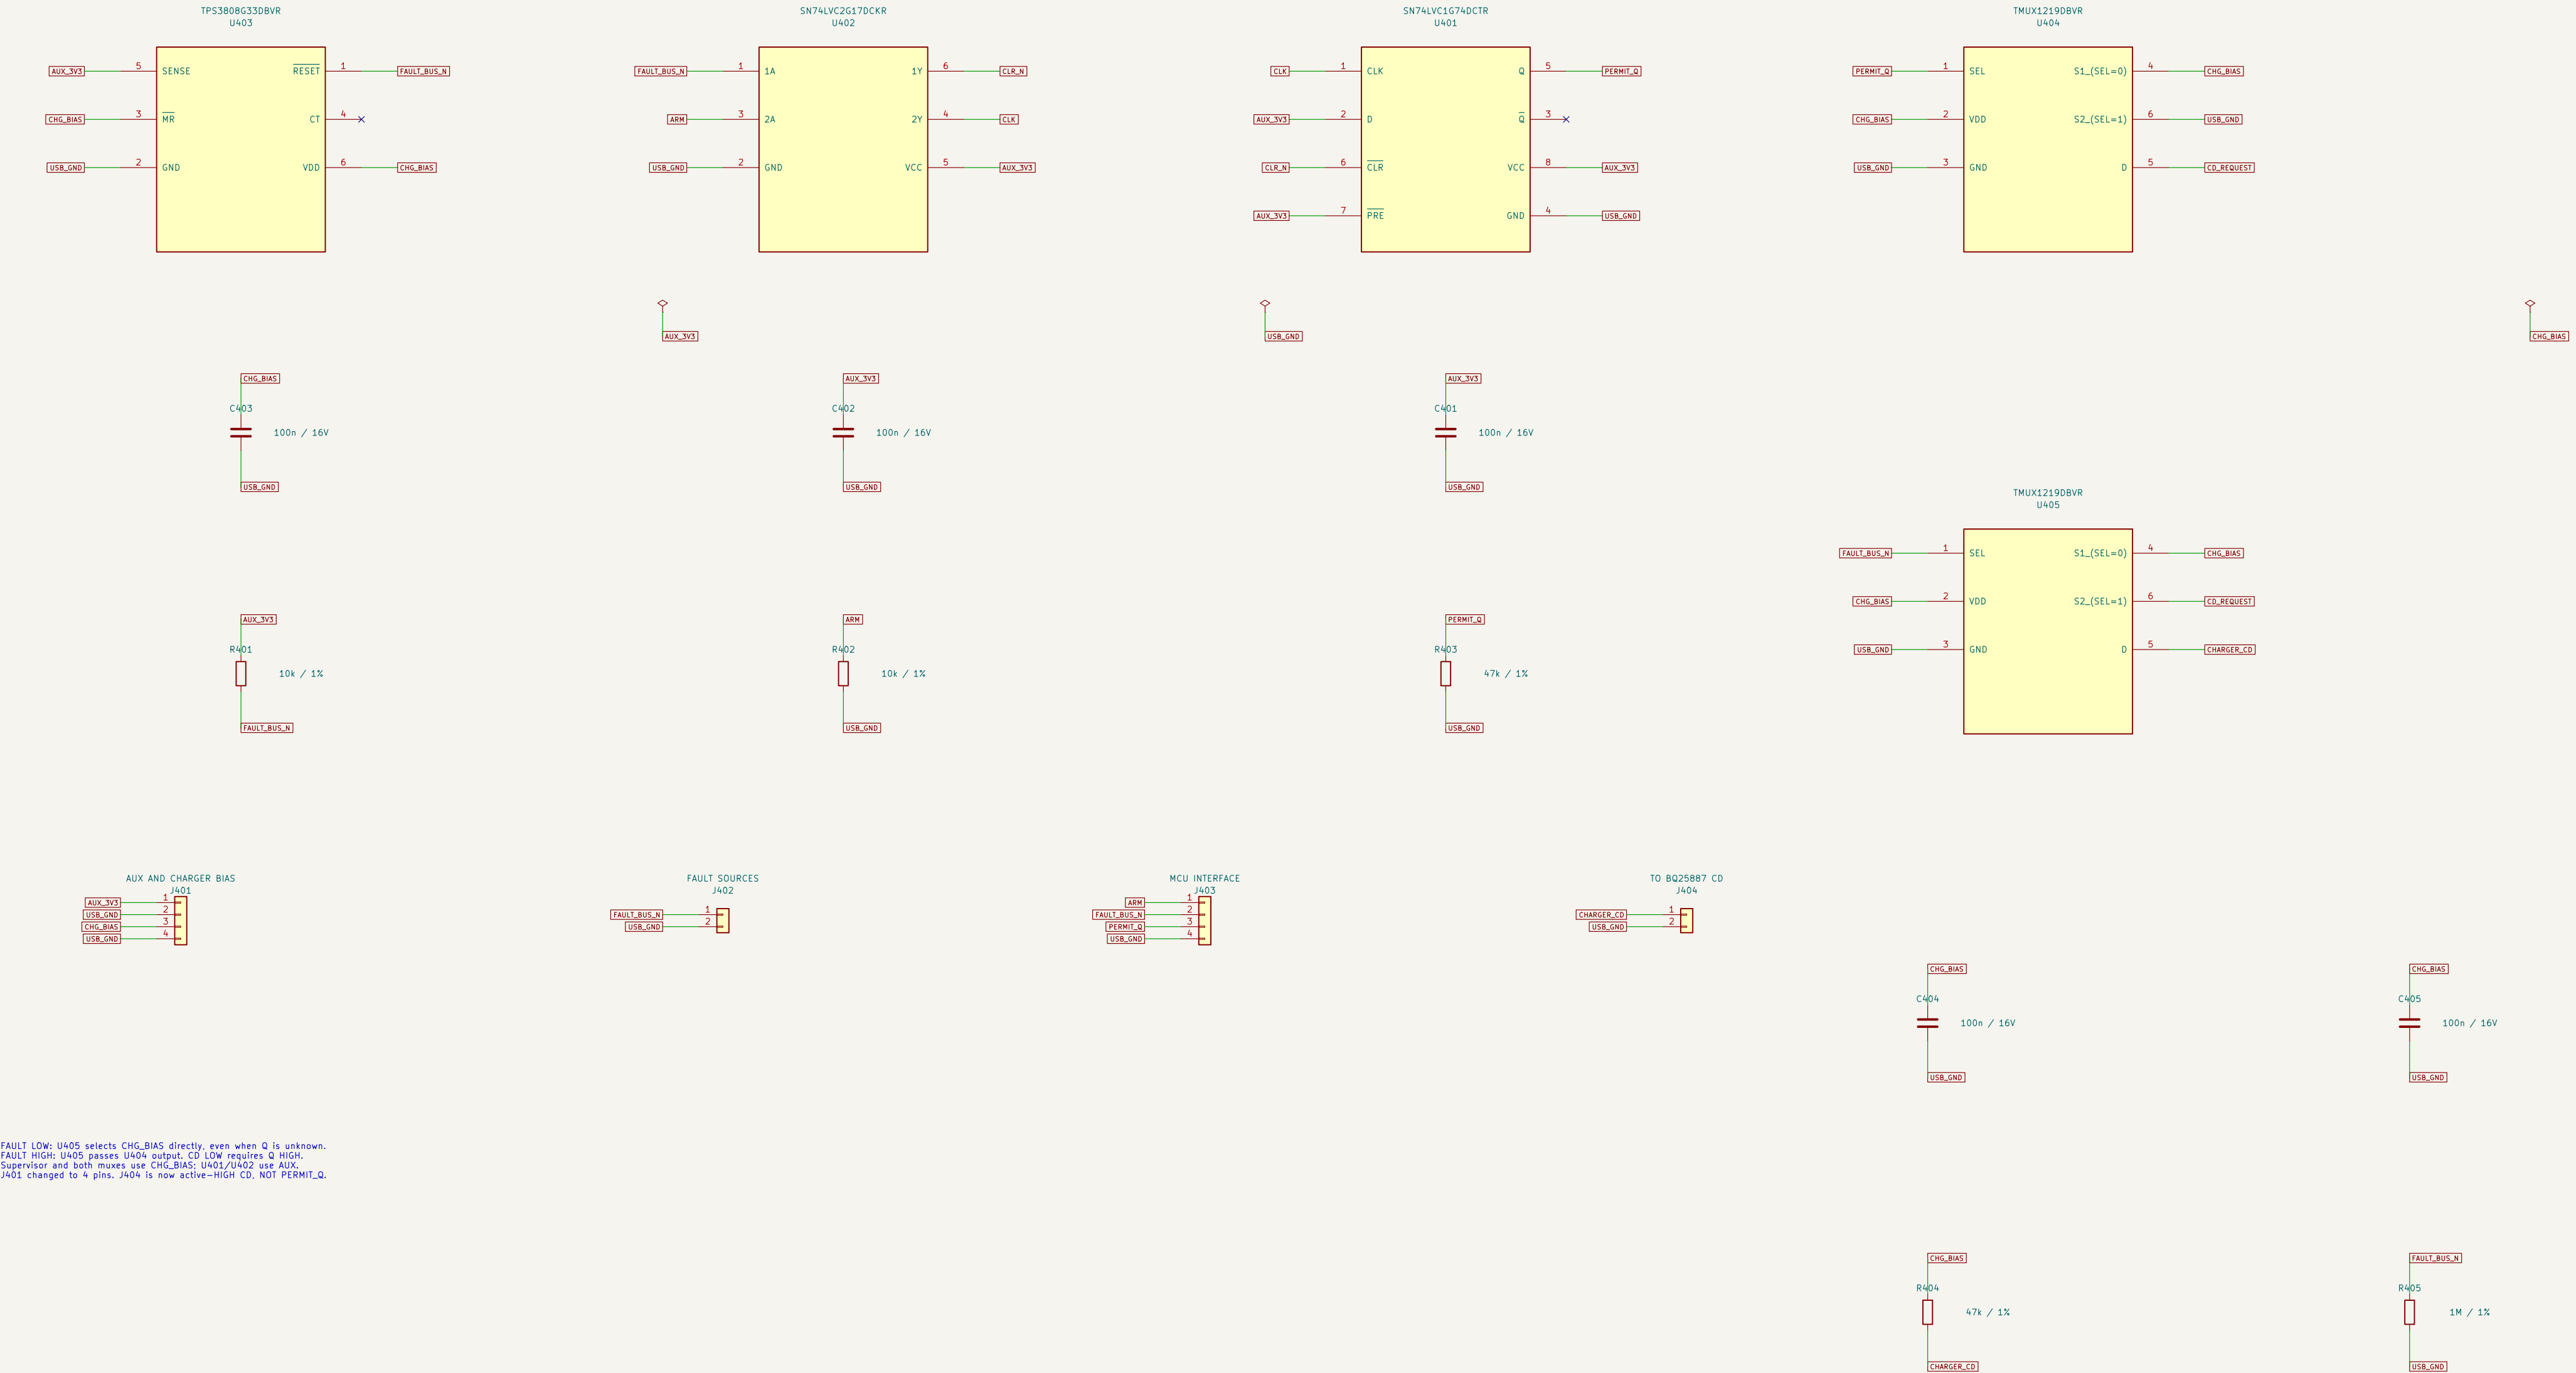

FAULT LOW: U405 selects CHG\_BIAS directly, even when Q is unknown.  
FAULT HIGH: U405 passes U404 output. CD LOW requires Q HIGH.  
Supervisor and both muxes use CHG\_BIAS; U402/U402 use AUX.  
J401 changed to 4 pins. J404 is now active-HIGH CD, NOT PERMIT\_Q.

CHG\_BIAS proposal: qualified charger-Input rail 4.5-5.5V. Existing TP525200 may clamp at 5.55V; NOT yet compatible.  
AUX 3.0-3.6V; SENSE falling nominal 3.07V. Delays/fast ramps/bias loss and restart still require measurement.  
No MCU, watchdog, INA300 or charger power stage here. This sheet does not authorize battery connection.