



A07 / SMOOTH CROWN ANCHOR

QTY 4 | ALUMINUM 6061-T6 | 18 x 55 x max10 | STEP: A07_long_travel_anchor.step

TOP (+Z)

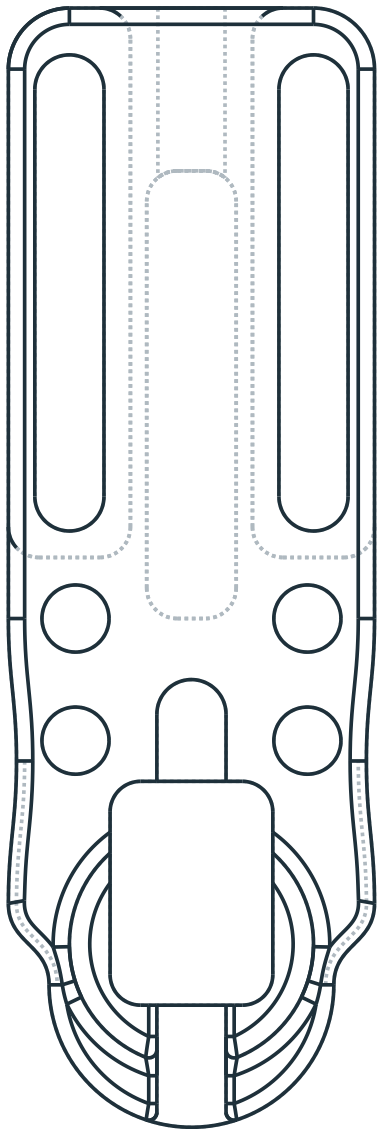

BOTTOM (-Z; mirrored Y on screen)

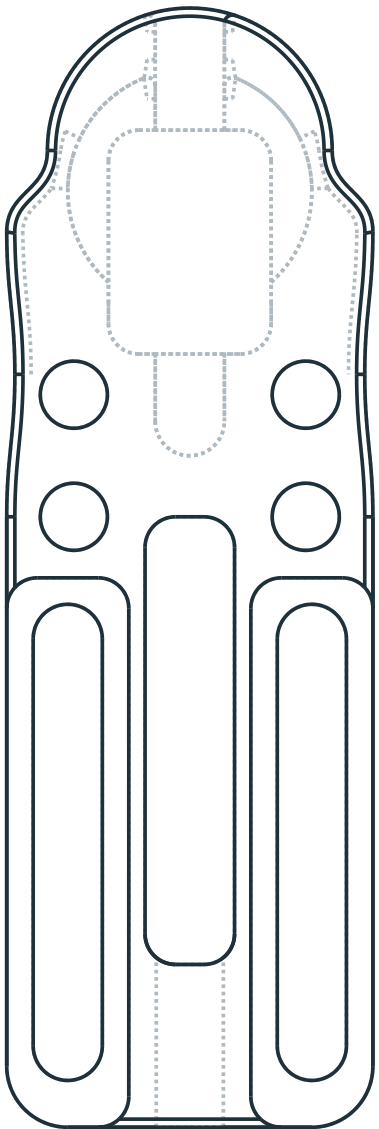

LEFT (-X)



DATUM	X=width centre; Y=front; Z=bottom
Envelope	W18; L55; body8; crown max10
Outside shape	NoseR7; rear plan cornersR3; see STEP
Body edge fillets	UpperR0.8; lowerR0.4
Integral crown	X0/Y9; D12; topR1.0; rootR0.8
Ball cradle	W8 x L11; centreX0/Y11.5
Cradle floor	Z2; plan cornersR1.5
String slot	W3.4; floorZ3.3; round rear end
Crown slot lips	R0.4
Height threads	4x M4 x 0.7 - 6H THRU8
Height coordinates	X +/-5.7; Y19 and Y25
Height tap drill	D3.3 THRU8
Clamp slots	X +/-6 / Y41; W3.4 x totalL23.4
Side underside relief	X +/-6 / Y41.5; 6 x 27; depth3; R1.5
Central underside window	X0/Y36; 4.4 x 22; depth6.3; R1.5

Rear M4 thread: see sheet2 (short tap to open window).

Height thread axes / slot width: +/-0.05 mm.

Other dimensions: ISO 2768-m; geometry from STEP.


Thread mouths / ball shoulders / string contact: C0.1 MAX.

Other remaining edges: C0.2 MAX. Ra3.2 target.


A07 / REAR TAP AND OPEN SCREW WINDOW

M4 x 0.7 - 6H; enter at Y55 in -Y direction. Axis X0/Z4. Tap through into the open underside window.

REAR (+Y): axial M4 tap / pilotD3.3

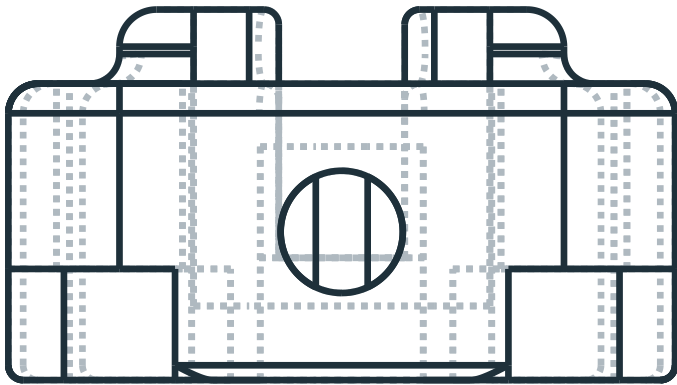


CENTRE SECTION X=0 - REAR HALF ONLY (pilot-diameter profile)

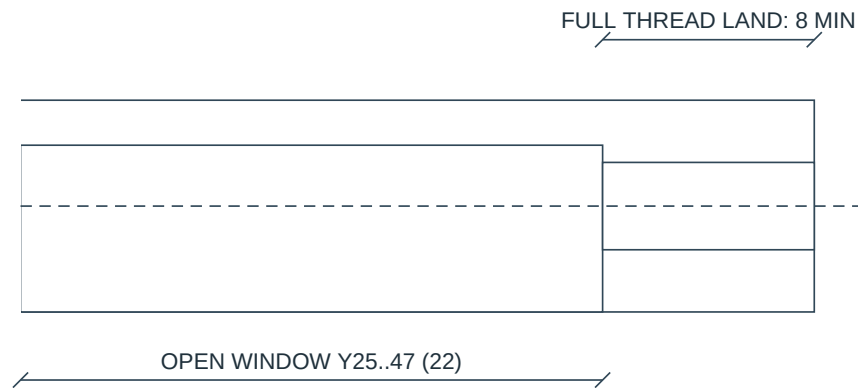

1. Drill D3.3 from Y55 to Y43 (12), fully breaking into open window.
2. Tap M4 x 0.7 - 6H through to the window, including partial outlet walls.
3. Require full circumferential thread over Y47..55: 8 mm MIN.
4. Deburr outlet from underside; do not leave an undersized untapped outlet.
5. No blind-hole tip allowance is needed; the outlet is open.

UNDERSIDE ISOMETRIC

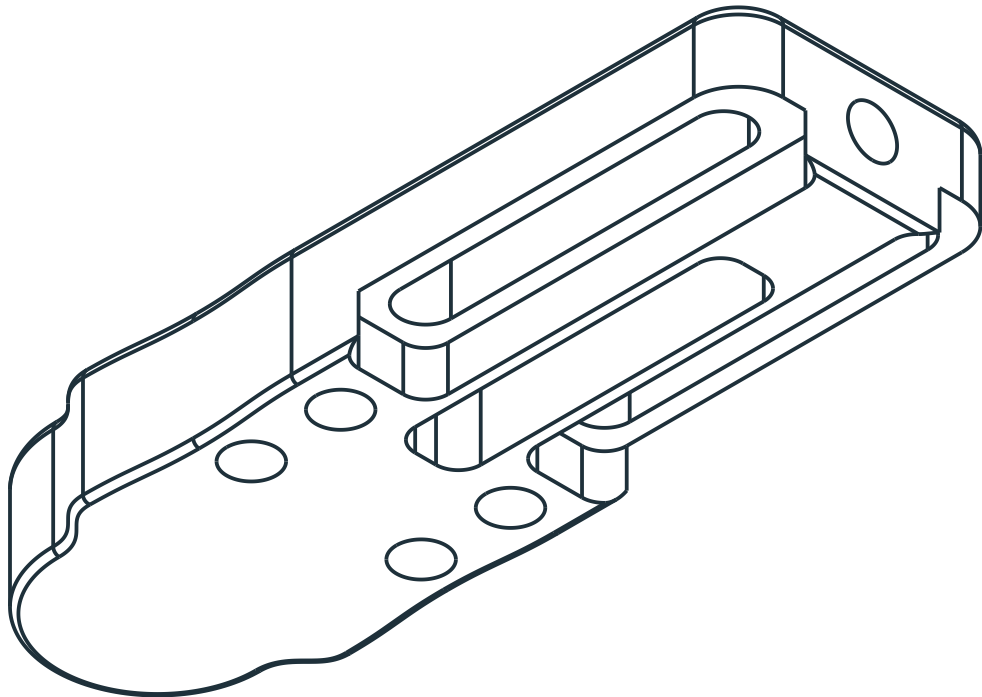

Central window: roofZ6.3, remaining top1.7.
M4 screw major radius2: topZ6, roof clearance0.3.
WindowW4.4: nominal side clearance0.2 each.
Full thread land is outside the window.
Nominal window-to-height-tap bulk:1.5.

Front screws no longer break into the ball cradle.
Rear height taps remain forward of side reliefY28.
An extra cross pin / retaining ring is not required.

Tap depth12 = 3 x M4 nominal diameter.
Confirm outlet tapping and tool access at quotation.