



REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-09-30	AC

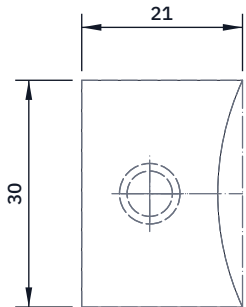


TOP VIEW

Scale 1:1; looking down (along -Z)

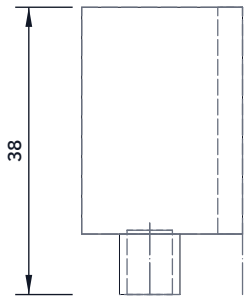

FRONT VIEW

Scale 1:1; looking at the front (along +Y)

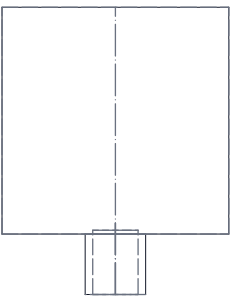

RIGHT VIEW

Scale 1:1; looking at the right side (along -X)



WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Shell: print 30 wide x 30 tall x 18 deep at the middle, open at the back, 2 mm walls. The face toward the anvil is curved to a 36 mm radius (anvil radius plus the 4 mm isolator).

For another anvil size use its radius plus 4 mm.

Fit the sensor board (Hall switch and accelerometer) with the Hall switch 1 mm under the top face; feed the cable through the 6 mm hole in the boss under the pad.

Fill with potting epoxy; let it cure fully before use.

Isolator: cut 30 x 30 mm of 4 mm elastomer; it bends to the anvil. Bond it to the pad's curved face.

Fit: the pad sits on the anvil side, its top 8 mm below the anvil top, under the hammer's overhang. The band clamp goes round the anvil and over the pad's outer face.

Check: the pad is fully potted; no wire shows at the top.

CONEPRO

github.com/BoujeeEnjinia1701/conepro

ConePro blow and tilt sensor pad: making sketch

DRAWING NO. CNP-DWG-109		REV P1	SHEET 1 of 1	SIZE ANSI B
SCALE 1:1	UNITS mm	PROJECTION 	DATE 2026-09-30	DRAWN Amish Chadha
MATERIAL / NOTES Printed PETG or ASA shell, potting epoxy; 4 mm elastomer sheet				
Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com			Generated from cad/src; do not edit by hand	