



REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-01	AC

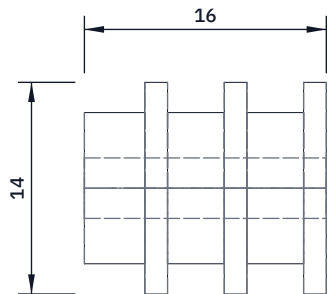


TOP VIEW

Scale 2:1; looking down (along -Z)

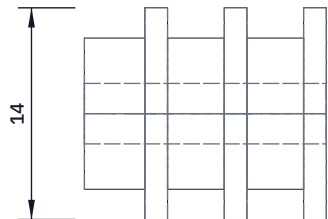


FRONT VIEW

Scale 2:1; looking at the front (along +Y)

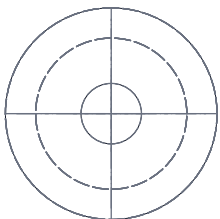

RIGHT VIEW

Scale 2:1; looking at the right side (along -X)

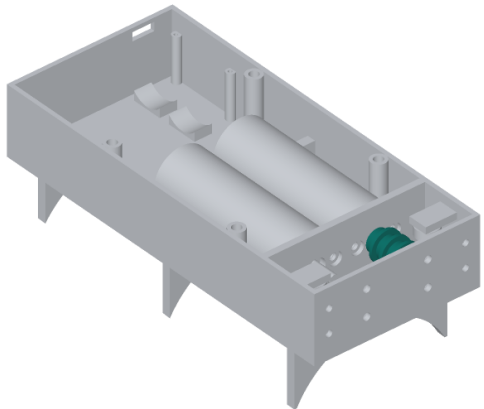

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Make two. 16 mm long: a 4 mm hub, then three 1.5 mm flanges of 14 mm diameter with two 3.75 mm wide grooves on a 10 mm core between them.

Bore: 4 mm D-shape to suit the motor shaft, through.

Hub: drill 2.5 mm across and tap M3 for a set screw onto the shaft flat.

Each groove: a 1 mm hole through the core near one flange to tie the line: the rear groove for the extensor line, the front for the flexor.

Fits: hub 0.5 mm in front of the bulkhead; set screw on the shaft flat.

The extensor line leaves the top of its groove and the flexor line the bottom of its groove, both toward the side wall, to the idlers.

Check: flanges run true; the spool slides on the shaft without play.

FLEXHAND

github.com/BoujeeEnjinia1701/flexhand

FlexHand spool (make 2): making sketch

DRAWING NO. FXH-DWG-105			REV P1	SHEET 1 of 1	SIZE ANSI B
SCALE 2:1	UNITS mm	PROJECTION 	DATE 2026-10-01		DRAWN Amish Chadha
MATERIAL / NOTES PA12, printed by a service (or PETG)					
Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com					Generated from cad/src; do not edit by hand