


REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-01	AC

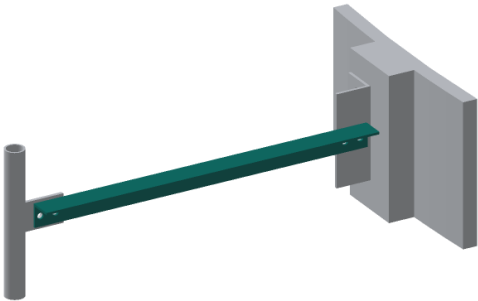

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Cut one 592 mm length of 40 x 40 x 4 angle; deburr the ends.

One leg stands upright against the lug and the wall bracket; the other lies flat along the top, pointing away from the lug.

Upright leg: four 11 mm holes, 18 mm up from its lower edge:

at the mast end 10 and 37 mm from the end;


at the wall end 13 and 40 mm from the end.

Drill the mast-end pair through the lug together if you can.

Paint cut ends and holes with zinc-rich paint.

Fit: two M10 bolts to the mast lug, two to the wall bracket, nuts on the stay side. Two bolts at each end stop the mast swinging along the wall; the stay is horizontal and square to the wall.

Check: hole pairs 27 mm apart and 552 mm between the pairs.

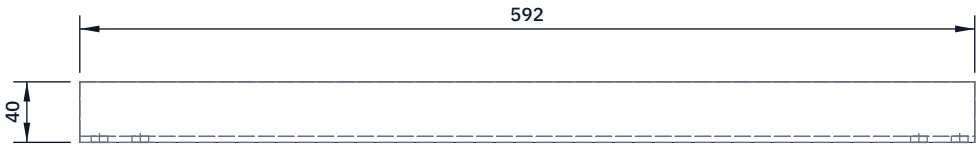

TOP VIEW

Scale 1:5; looking down (along -Z)



FRONT VIEW

Scale 1:5; looking at the front (along +Y)



RIGHT VIEW

Scale 1:5; looking at the right side (along -X)

GRAINGUARD

github.com/BoujeeEnjinia1701/grainguard

GrainGuard stay: making sketch

DRAWING NO. GGD-DWG-103			REV P1	SHEET 1 of 1	SIZE ANSI B
SCALE 1:5	UNITS mm	PROJECTION 	DATE 2026-10-01		DRAWN Amish Chadha
MATERIAL / NOTES Galvanized steel equal angle 40 x 40 x 4 mm					
Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com				Generated from cad/src; do not edit by hand	