


REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-02	AC

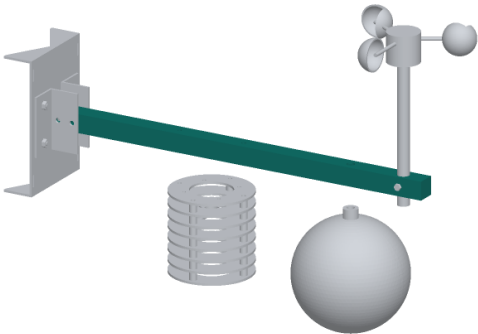

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Cut 530 mm of 25 x 25 x 2 tube; square and deburr both ends.

Measure every hole from the root end (the end that bears on the saddle).

Through both side walls, on the centre line: 6.6 mm at 12 and 32

(cheek bolts) and 5.5 mm at 500 (anemometer mast cross bolt).

Through the top and bottom walls, on the centre line:

5.5 mm at 178.3 and 270.3 (shield rods),

10.5 mm at 424.3 (globe hanger tube),

16.5 mm at 500.0 (anemometer mast; step drill).


Drill each top and bottom pair in one pass on a drill press so they

line up; the arm-holes picture in the plan repeats these figures.

Push the end plug into the tip and slide the two crush sleeves in

from the root end to line up with the cheek bolt holes.

Check: a drill of each hole size passes straight through each pair.

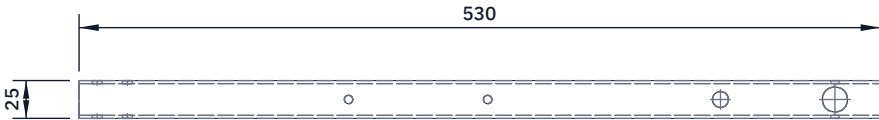

TOP VIEW

Scale 1:5; looking down (along -Z)



FRONT VIEW

Scale 1:5; looking at the front (along +Y)



RIGHT VIEW

Scale 1:5; looking at the right side (along -X)

HEATMAP NODE

github.com/BoujeeEnjinia1701/heatmap-node

HeatMap Node sensor arm: making sketch

DRAWING NO.

HMN-DWG-103

REV

P1

SHEET

1 of 1

SIZE

ANSI B

SCALE

1:5

UNITS

mm

PROJECTION



DATE

2026-10-02

DRAWN

Amish Chadha

MATERIAL / NOTES

Aluminium square tube 25 x 25 x 2 mm, 6063