



REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-01	AC

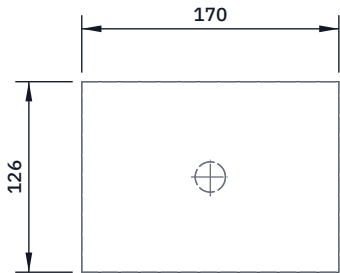


TOP VIEW

Scale 1:5; looking down (along -Z)

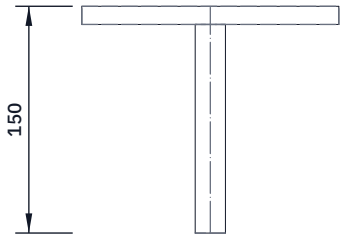


FRONT VIEW

Scale 1:5; looking at the front (along +Y)

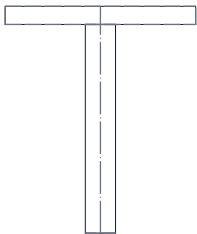

RIGHT VIEW

Scale 1:5; looking at the right side (along -X)

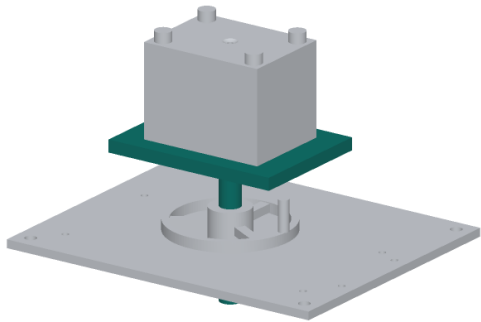

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Table: cut 170 x 126 mm from 12 mm steel plate; deburr.

Drill a 20.5 mm hole in the centre (85 and 63 mm from the edges).

Screw: cut 150 mm of Tr20 x 4 lead screw, ends square.

Push the screw into the hole flush with the table top. Clamp it square to the table with an engineer's square both ways.

Weld a 5 mm fillet all round underneath; plug weld the top and grind it flush and flat. Keep weld spatter off the thread.

Fit: the screw runs down through the handwheel nut, the thrust washer, the 25 mm hole in the base plate and the hole in the bench.

The table's back edge runs 2 mm in front of the column face; the column stops the table turning when the handwheel turns.

Check: the screw is square to the table within 0.2 mm over 100 mm.

MICROMOLD

github.com/BoujeeEnjinia1701/micromold

MicroMold lift table and screw: making sketch

DRAWING NO. MMD-DWG-109			REV P1	SHEET 1 of 1	SIZE ANSI B
SCALE 1:5	UNITS mm	PROJECTION 	DATE 2026-10-01		DRAWN Amish Chadha
MATERIAL / NOTES Steel plate 12 mm; Tr20 x 4 lead screw, 150 mm					
Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com				Generated from cad/src; do not edit by hand	