



REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-01	AC

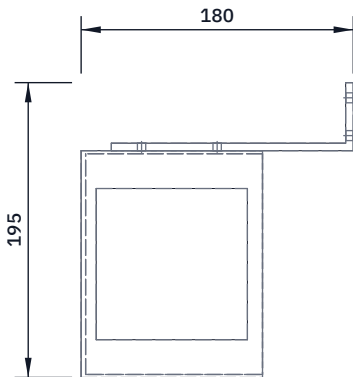


TOP VIEW

Scale 1:5; looking down (along -Z)

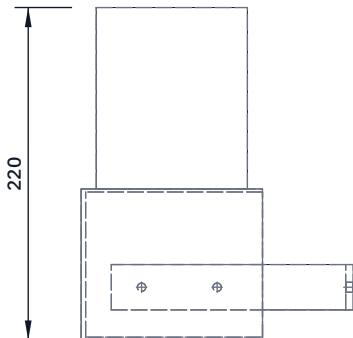


FRONT VIEW

Scale 1:5; looking at the front (along +Y)

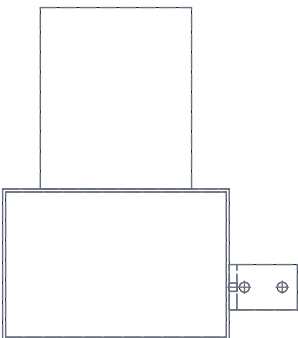

RIGHT VIEW

Scale 1:5; looking at the right side (along -X)

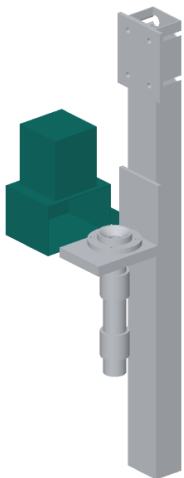

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Hood: fold 1 mm aluminium into a box 120 deep, 150 wide and 100 tall with one 150 x 100 face open (toward the funnel), seams pop riveted.

Cut a 100 mm hole in the top for the duct stub; rivet on a 100 mm round stub (a square stub is drawn) for the flexible duct.

Arm: 30 x 5 mm flat bar, 200 mm long; bend 90 degrees 45 mm from one end, flat way. Long leg: two 5.5 mm holes 20 and 70 mm from its free end. Short leg: two 6.5 mm holes 10 and 35 mm from the bend's outside.

Fit: the short leg bolts to the column's left face with two M6 screws into rivnuts; the long leg lies on the hood's back face, two M5 screws and nuts. The hood's open face is 100 mm from the funnel axis, its centre level with the flange.

Check: the hood stays put when pushed by hand.

MICROMOLD

github.com/BoujeeEnjinia1701/micromold

MicroMold fume hood and hood arm: making sketch

DRAWING NO. MMD-DWG-114		REV P1	SHEET 1 of 1	SIZE ANSI B
SCALE 1:5	UNITS mm	PROJECTION 	DATE 2026-10-01	DRAWN Amish Chadha

MATERIAL / NOTES Aluminium sheet 1 mm; steel flat bar 30 x 5 mm	
--	--