



REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-02	AC

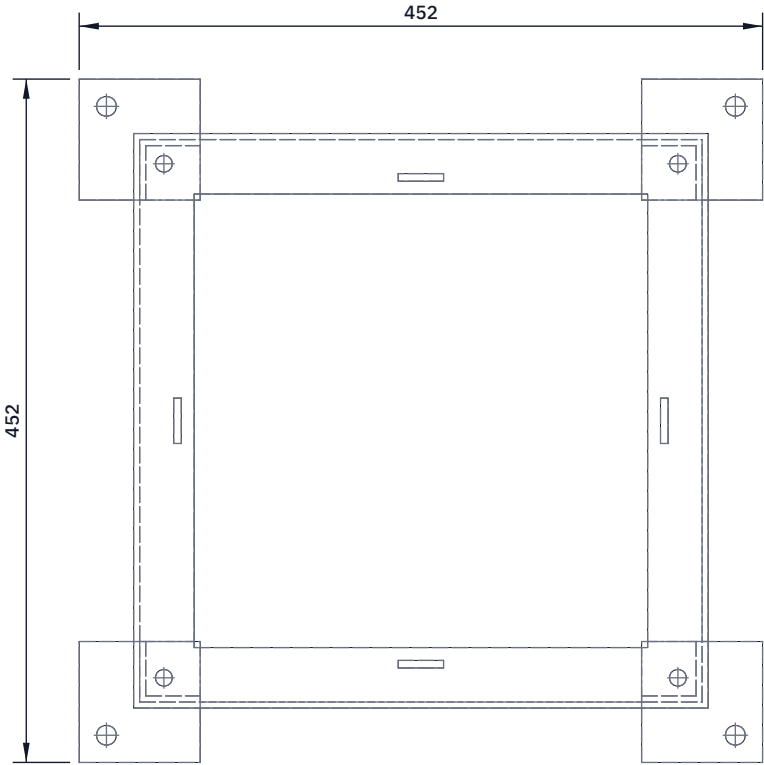


TOP VIEW

Scale 1:5; looking down (along -Z)

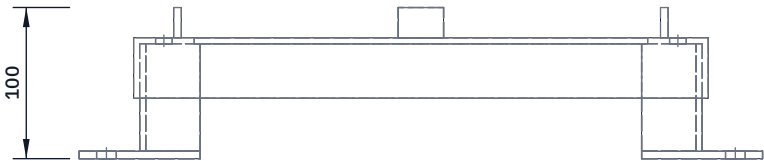


FRONT VIEW

Scale 1:5; looking at the front (along +Y)

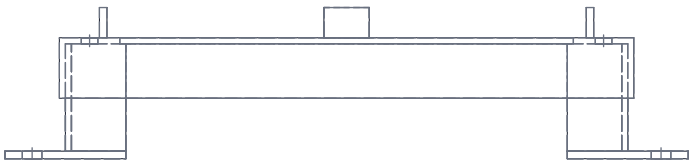

RIGHT VIEW

Scale 1:5; looking at the right side (along -X)

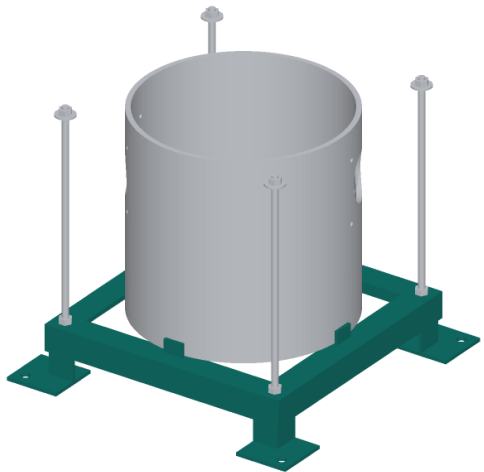

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Square: four 380 mm lengths of 40 x 40 x 4 angle, mitred 45 deg at each end, horizontal legs pointing inward, top faces flat and level.

Weld the corners; check the diagonals agree within 2 mm.

Legs: four 70 mm lengths of the same angle, fitted inside each corner, tight under the horizontal legs and against the vertical legs; weld.

Feet: four 80 x 80 x 5 mm plates welded under the legs, reaching outward; one 13 mm anchor hole in each, 208 mm from the centre lines.

Pipe stops: four 30 x 20 x 5 mm flat bars welded upright on the horizontal legs at the middle of each side, inner face 158.5 mm from the centre (1 mm outside the housing).

Tie rod holes: 11 mm in each corner, 170 mm from both centre lines.

Clean the welds, then galvanize or paint the whole frame. Never weld after galvanizing.

Check: top flat within 1 mm; the housing drops in between the stops.

PICOFLOW

github.com/BoujeeEnjinia1701/picoflow

PicoFlow turbine frame: making sketch

DRAWING NO. PCF-DWG-101			REV P1	SHEET 1 of 1	SIZE ANSI B
SCALE 1:5	UNITS mm	PROJECTION 	DATE 2026-10-02	DRAWN Amish Chadha	

MATERIAL / NOTES Bare steel angle 40 x 40 x 4 mm; flat 80 x 80 x 5 and 30 x 20 x 5 mm; galvanized or painted after welding					
---	--	--	--	--	--