BUILD PLAN SKETCH, PLAN NOT YET BUILT

PotPress · github.com/BoujeeEnjinia1701/potpress

REV	DESCRIPTION	DATE	BY
P1	First issue	2026-09-30	AC
P2	Clay shrink allowance; 480 flange; eye bolts	2026-10-23	AC

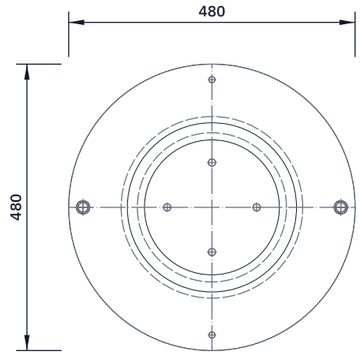

TOP VIEW

Scale 1:10; looking down (along -Z)

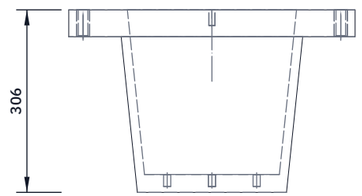

FRONT VIEW

Scale 1:10; looking at the front (along +Y)

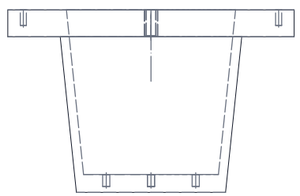

RIGHT VIEW

Scale 1:10; looking at the right side (along -X)

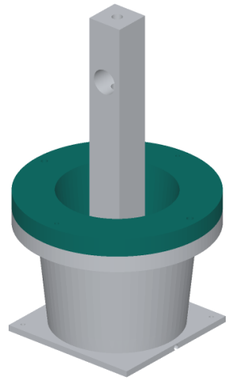

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Cast plug: 250 mm dia at the tip to 304 at the flange, 261 long (fired size / 0.92); 15 shell, 30 tip; flange 480 dia x 45. Open at the top: the inside is a cone 226 dia at the floor to 284 at the top.
Pattern: printed PLA, flat-back, flange top face down on the board, plug pointing up; the inside forms its own sand core, so no core box. Add 1.3 % shrink, 3 mm to lap off the flange underside, 2 degree draft on the flange rim. Print in 8 segments, glue, seal.
Finish: lap the flange underside flat; plug to printed templates.
Bushes: 22 mm holes through the flange at 216 mm each side, steel bushes 22 x 16 x 45 set in retaining compound; 16 mm bore reamed.
Floor: four M12 holes (drill 10.2, tap 20 deep) at 75 mm from the middle, square to the axes, for the stem's adapter disc.
Eye bolts: 2 x M12 holes, 26 deep, at 214 mm in the flange top.
Check: plug to templates; bushes slide on the dowels; melt checked.

POTPRESS

github.com/BoujeeEnjinia1701/potpress

PotPress male mold and its casting pattern: making sketch

DRAWING NO.	REV	SHEET	SIZE
PPR-DWG-108	P2	1 of 1	ANSI B

SCALE	UNITS	PROJECTION	DATE	DRAWN
1:10	mm		2026-10-23	Amish Chadha

MATERIAL / NOTES

Sand-cast aluminium (lead-free scrap); 22 mm steel bushes

Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com

Generated from cad/src; do not edit by hand