




REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-01	AC

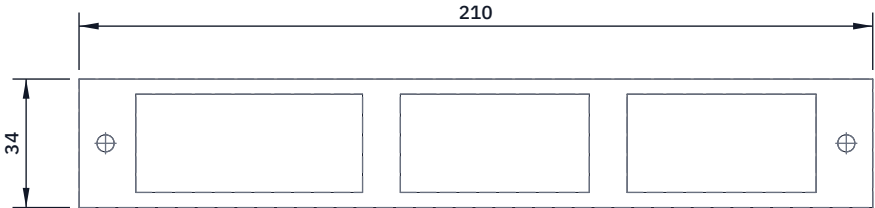


TOP VIEW
Scale 1:2; looking down (along -Z)

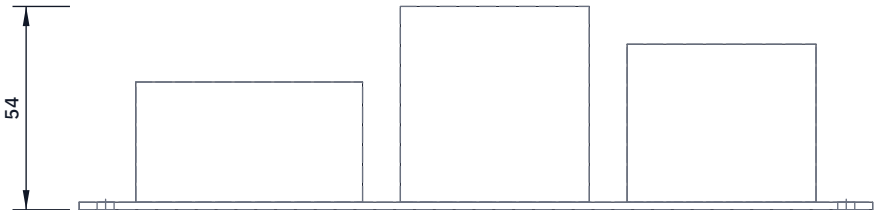

FRONT VIEW
Scale 1:2; looking at the front (along +Y)

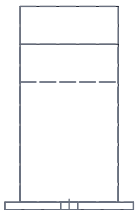

RIGHT VIEW
Scale 1:2; looking at the right side (along -X)

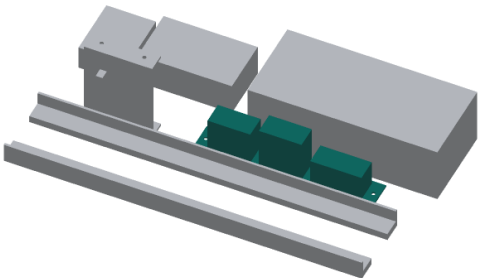

WHERE IT GOES
This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Cut 210 x 34 mm from 2 mm sheet.

Two 4.5 mm holes for the floor screws, 7 from each end, 17 from either long edge.

Lay out on it, left to right: the 30 A main fuse holder, the 20 A DC breaker, then the inverter relay with its 47 ohm pre-charge resistor.

Drill each to its own holes, M4 or M3 with nyloc nuts.

Fit: on the floor between the inverter and the pack bay, two M4 button heads from below with nyloc nuts on top.

All three parts must be rated 60 V DC or more; the fuse holder and fuse at least 1 kA breaking capacity.

Check: 6 mm clear of the inverter and 14 mm clear of the runners.

POWERBOX				github.com/BoujeeEnjinia1701/powerbox			
PowerBox protection plate: making sketch							
DRAWING NO. PBX-DWG-113			REV P1		SHEET 1 of 1		SIZE ANSI B
SCALE 1:2	UNITS mm	PROJECTION 		DATE 2026-10-01		DRAWN Amish Chadha	
MATERIAL / NOTES 5052 aluminium sheet 2 mm, with bought fuse holder, breaker and relay							
Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com						Generated from cad/src; do not edit by hand	