



REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-01	AC
P2	Pivot hole moved up 1.5 mm (raised grip)	2026-10-02	AC

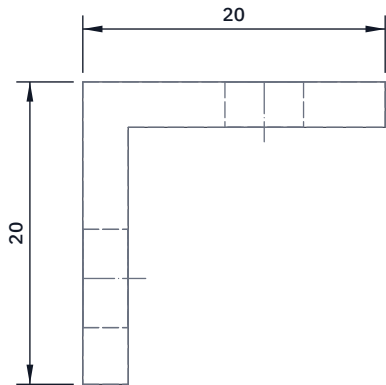


TOP VIEW

Scale 2:1; looking down (along -Z)

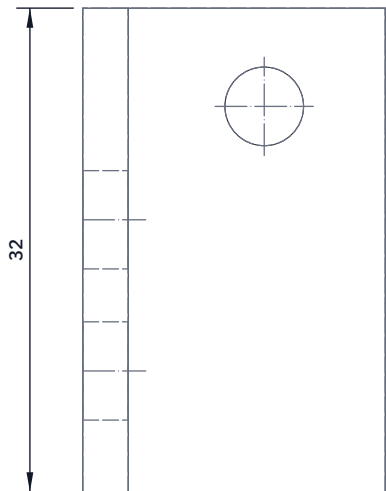


FRONT VIEW

Scale 2:1; looking at the front (along +Y)

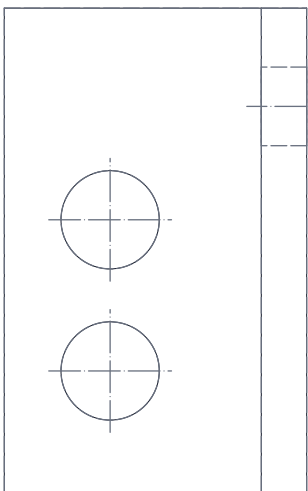

RIGHT VIEW

Scale 2:1; looking at the right side (along -X)

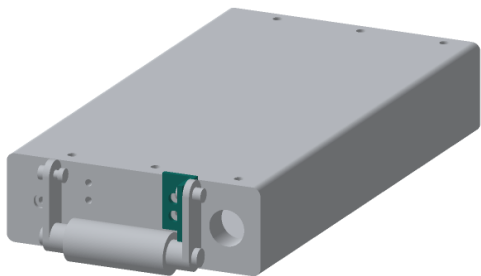

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Cut two 32 mm lengths of 20 x 20 x 3 angle; deburr.

Flat leg (goes on the cap): two 6.5 mm holes 13 mm from the outside of the upright leg, 8 and 18 mm up from the bottom end. The bolts pass with 1.25 mm air all round: the bolt must not touch.

Upright leg: one 5.2 mm pivot hole 12 mm out from the back of the flat leg, 25.5 mm up from the bottom end.

Left and right are mirror images: drill them as a pair.

Fit: flat leg on two phenolic washers (9 x 4.5 x 3 mm) per bolt, 3 mm off the flange; bottom end 22 mm above the flange's bottom edge; upright legs outward, their outsides 40 mm each side of the centre line. M4 x 20 bolts with a 3 mm phenolic washer under each head, into the plug.

Check: no metal path from bolt to angle (meter: open circuit).

THERMACART

github.com/BoujeeEnjinia1701/thermacart

ThermaCart lug angle (make 2, a left and a right): making sketch

DRAWING NO. TCT-DWG-106			REV P2	SHEET 1 of 1	SIZE ANSI B
SCALE 2:1	UNITS mm	PROJECTION 	DATE 2026-10-02		DRAWN Amish Chadha
MATERIAL / NOTES 6063 equal angle 20 x 20 x 3 mm					
Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com				Generated from cad/src; do not edit by hand	