REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-02	AC
P2	Cross bolt is an eye bolt for the padlock (WLS-DEC-001)	2026-10-02	AC

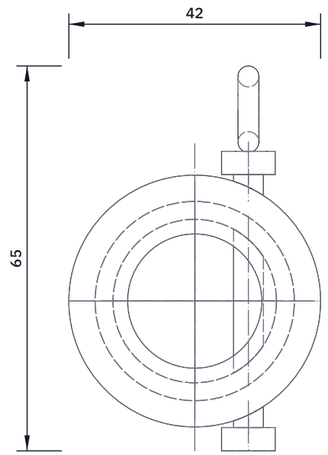

TOP VIEW

Scale 1:1; looking down (along -Z)

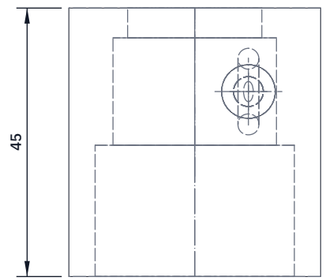

FRONT VIEW

Scale 1:1; looking at the front (along +Y)

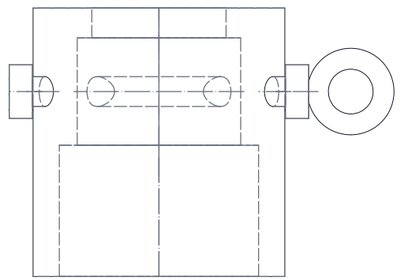

RIGHT VIEW

Scale 1:1; looking at the right side (along -X)

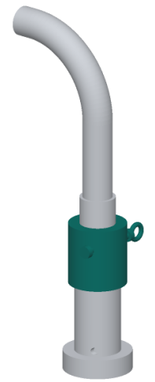

WHERE IT GOES

This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Do not glue the cap: it lifts off with the probe for calibration.
Top: drill 22.5 mm in the centre for the 1/2 in conduit connector.
Side: drill 5 mm straight across, 9 above the tube end (the cap's shoulder) and 9 off the centre line, for the M5 eye bolt (the cross bolt).
The bolt passes beside the cable, never through it.
Fit: the conduit connector goes through the top with its locknut inside. The cable support grip's eye goes over the cross bolt, which then carries the probe and cable; nyloc nut on the -Y side. The eye on the +Y side takes the padlock (WLS-DEC-001).
The cap sits on the tube end by its own weight and the load.
Check: with the bolt in, the cap still slides on and off the tube.

WELLSENSE github.com/BoujeeEnjinia1701/wellsense

WellSense tube cap: making sketch

DRAWING NO.	REV	SHEET	SIZE
WLS-DWG-109	P2	1 of 1	ANSI B

SCALE	UNITS	PROJECTION	DATE	DRAWN
1:1	mm		2026-10-02	Amish Chadha

MATERIAL / NOTES
1 in Sch 40 PVC slip cap; stainless M5 x 50 eye bolt

Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com Generated from cad/src; do not edit by hand