Cut Sheet

Board Design Summary

Style: scrap-chaotic

Dimensions: 12.000" (12") × 18.000" (18") × 1.500" (1 1/2")

Species: Walnut, Maple, Cherry

Juice Groove: Perimeter loop, 0.492" (~31/64") wide × 0.197" (~13/64") deep, 0.748" (~3/4") from the edge, corner radius 1.004" (~1"), top face.

Rubber Feet: 4 rubber feet, 1" (25.4 mm) diameter × 3/8" (9.5 mm) high, foot centres 1.260" (~1 17/64") in from the edges (underside).

Cut List


Part	Width	Thickness	Length	Species
Board strips	1.000" (1")	1.500" (1 1/2")	18.000" (18")	Walnut

Cut List

Part	Qty	Width	Thickness	Length	Species
Maple blank (mill & rip, then crosscut slices)	1	3.957" (~4 61/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Maple
Walnut blank (mill & rip, then crosscut slices)	1	3.197" (~3 13/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut
Walnut blank (mill & rip, then crosscut slices)	1	5.165" (~5 11/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut
Walnut blank (mill & rip, then crosscut slices)	1	1.122" (~1 7/8")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut
Maple blank (mill & rip, then crosscut slices)	1	4.772" (~4 49/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Maple
Cherry blank (mill & rip, then crosscut slices)	1	3.957" (~3 61/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Cherry
Walnut blank (mill & rip, then crosscut slices)	1	3.591" (~3 37/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut
Maple blank (mill & rip, then crosscut slices)	1	0.921" (~59/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Maple
Walnut blank (mill & rip, then crosscut slices)	1	4.933" (~4 15/16")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut

Cherry blank (mill & rip, then crosscut 4 slices) [width before jointer (use plane) Cherry or hand flatten]	1	6.028" (~6 1/32")	1.835" (~1 53/64")	12.008" (~12 1/64")	Cherry	
Cherry blank (mill & rip, then crosscut 2 slices)	1	2.122" (~2 1/8")	1.835" (~1 53/64")	12.008" (~12 1/64")	Cherry	
Walnut blank (mill & rip, then crosscut 4 slices)	1	4.106" (~4 7/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut	
Walnut blank (mill & rip, then crosscut 2 slices)	1	2.583" (~2 37/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut	
Walnut blank (mill & rip, then crosscut 3 slices)	1	3.783" (~3 25/32")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut	
Maple blank (mill & rip, then crosscut 4 slices)	1	2.169" (~2 11/32")	1.835" (~1 53/64")	12.008" (~12 1/64")	Maple	
Maple blank (mill & rip, then crosscut 2 slices)	1	1.181" (~1 11/16")	1.835" (~1 53/64")	12.008" (~12 1/64")	Maple	
Cherry blank (mill & rip, then crosscut 3 slices)	1	3.524" (~3 17/32")	1.835" (~1 53/64")	12.008" (~12 1/64")	Cherry	
Cherry blank (mill & rip, then crosscut 5 slices)	1	5.016" (~5 1/64")	1.835" (~1 53/64")	12.008" (~12 1/64")	Cherry	
Walnut blank (mill & rip, then crosscut 2 slices)	1	2.724" (~2 23/32")	1.835" (~1 53/64")	12.008" (~12 1/64")	Walnut	

Board Layout (Top View)

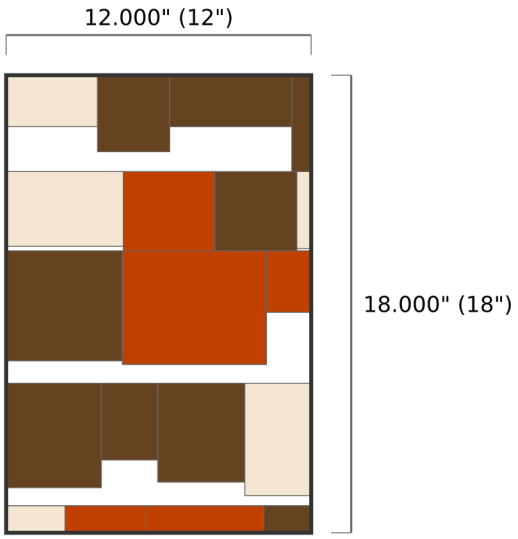

Step 1: Mill rough stock

Joint one face and one edge on the jointer, then plane to final thickness plus 1/8" (3 mm). Rest overnight, then plane to final thickness. Take ~1/64" (0.4 mm) passes for the last two passes.

Settings:


Final pass depth: ~1/64" (0.4 mm)

WARNING: Use push blocks on the jointer. Never joint stock shorter than 12" (305 mm) or thinner than 1/2" (12.7 mm).

WARNING: Keep hands clear of the infeed and outfeed. Feed only boards at least 12" (305 mm) long.

Scrap Chaotic (End Grain): step 1: Mill rough stock

Whole blank on the jointer (schematic, not to scale)

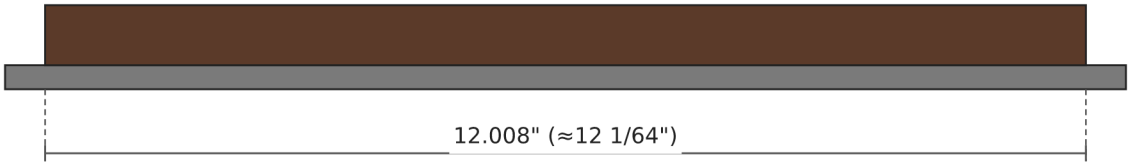

Mill and rip whole blanks before any crosscut. Blank length = max(305 mm, slices x (slice + kerf) + 2 x 25 mm trim). Never send a crosscut slice or piece shorter than 305 mm to the jointer or planer.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 4.117" (≈4 7/64") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 5.106" (≈5 7/64") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 4.117" (≈4 1/8") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 6.729" (≈6 47/64") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 5.036" (≈5 1/32") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 5.949" (≈5 61/64") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 5.432" (≈5 7/16") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 5.124" (≈5 1/8") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 6.416" (≈6 27/64") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 6.561" (≈6 9/16") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 4.509" (≈4 33/64") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 6.199" (≈6 13/64") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 5.110" (≈5 7/64") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 5.981" (≈5 63/64") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 6.514" (≈6 33/64") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 3.160" (≈3 5/32") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 3.160" (≈3 5/32") crosscut after milling.

Maple strip: blank 12.008" (≈12 1/64") long, 1 slices of 3.160" (≈3 5/32") crosscut after milling.

Walnut strip: blank 12.008" (≈12 1/64") long, 1 slices of 3.160" (≈3 5/32") crosscut after milling.

Blank lengths: catalog blankRule applied to the app cut list by boardviz; the app export does not apply the rule yet.

Joint one face and one edge on the jointer, then plane to final thickness plus 1/8" (3 mm). Rest overnight, then plane to final thickness. Take ~1/64" (0.4 mm) passes for the last two passes.

Final pass depth: ~1/64" (0.4 mm)

WARNING: Use push blocks on the jointer. Never joint stock shorter than 12" (305 mm) or thinner than 1/2" (12.5 mm).

WARNING: Keep hands clear of the infeed and outfeed. Feed only boards at least 12" (305 mm) long.

Step 2: Sort offcuts

Discard pieces with checks, knots or softwood. Only pieces at least 12" (305 mm) long go through the jointer and planer; glue shorter offcuts onto a 305 mm carrier panel first or sand them to thickness. Cut pieces of 6" (152 mm) or less only on a sled with a hold-down.

NOTE: Use closed-grain, non-toxic hardwoods only. Avoid spalted, softwood or oily/sensitising exotics on cutting surfaces.

WARNING: Use push blocks on the jointer. Never joint stock shorter than 12" (305 mm) or thinner than 1/2" (12.7 mm).

WARNING: Do not cut pieces shorter than 6" (152 mm) free-hand on the table saw. Use a sled with a hold-down.

Step 3: Glue up

Glue offcuts into rough panels. Alternate clamps above and below the panel and check for flat with a straightedge.

Settings:

Clamp spacing: about 8" (200 mm)

NOTE: Use a waterproof PVA glue rated for indirect food contact. Clamp until squeeze-out turns rubbery, then scrape.

Scrap Chaotic (End Grain): glue-up 1, step 3: Glue up



Glue offcuts into rough panels. Alternate clamps above and below the panel and check for flat with a straightedge.

Clamp spacing: about 8" (200 mm)

NOTE: Use a waterproof PVA glue rated for indirect food contact. Clamp until squeeze-out turns rubbery, then scrape.


Step 4: Crosscut slices

Crosscut slices on a crosscut sled with a stop block.
Slice size: 1-11/16" (43 mm) (final thickness 1-1/2" (38 mm) + 5 mm end-grain allowance).

DANGER: Never use the rip fence as a length stop for crosscuts. Use a crosscut sled with a stop block set before the blade, so the offcut is never trapped between blade and fence.

WARNING: Do not cut pieces shorter than 6" (152 mm) free-hand on the table saw. Use a sled with a hold-down.

Scrap Chaotic (End Grain): crosscut, step 4: Crosscut slices

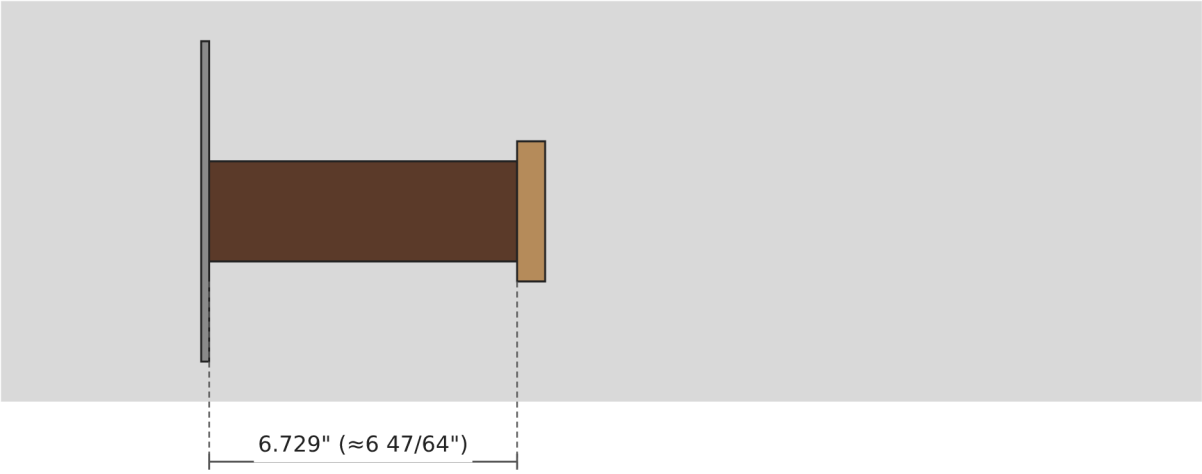

Crosscut slices on a crosscut sled with a stop block.

DANGER: Never use the rip fence as a length stop for crosscuts. Use a crosscut sled with a stop block set before the blade, so the offcut is never trapped between blade and fence.

WARNING: Do not cut pieces shorter than 6" (152 mm) free-hand on the table saw. Use a sled with a hold-down.

Step 5: Glue up

Glue slices end grain up in random order. Alternate clamps above and below the panel and check for flat with a straightedge.

Settings:

Clamp spacing: about 8" (200 mm)

NOTE: Use a waterproof PVA glue rated for indirect food contact. Clamp until squeeze-out turns rubbery, then scrape.

Scrap Chaotic (End Grain): glue-up 2, step 5: Glue up



Glue slices end grain up in random order. Alternate clamps above and below the panel and check for flat with a straightedge.

Clamp spacing: about 8" (200 mm)

NOTE: Use a waterproof PVA glue rated for indirect food contact. Clamp until squeeze-out turns rubbery, then scrape.

Step 6: Flatten and sand


Flatten with a router sled or drum sander, never the thickness planer. Sand 80, 120, 180 grit. Break edges (180 grit).

Settings:

Grits: 80 / 120 / 180

DANGER: Never run an end-grain glue-up through the thickness planer. It can blow apart. Flatten with a router sled or drum sander.

Scrap Chaotic (End Grain): top view

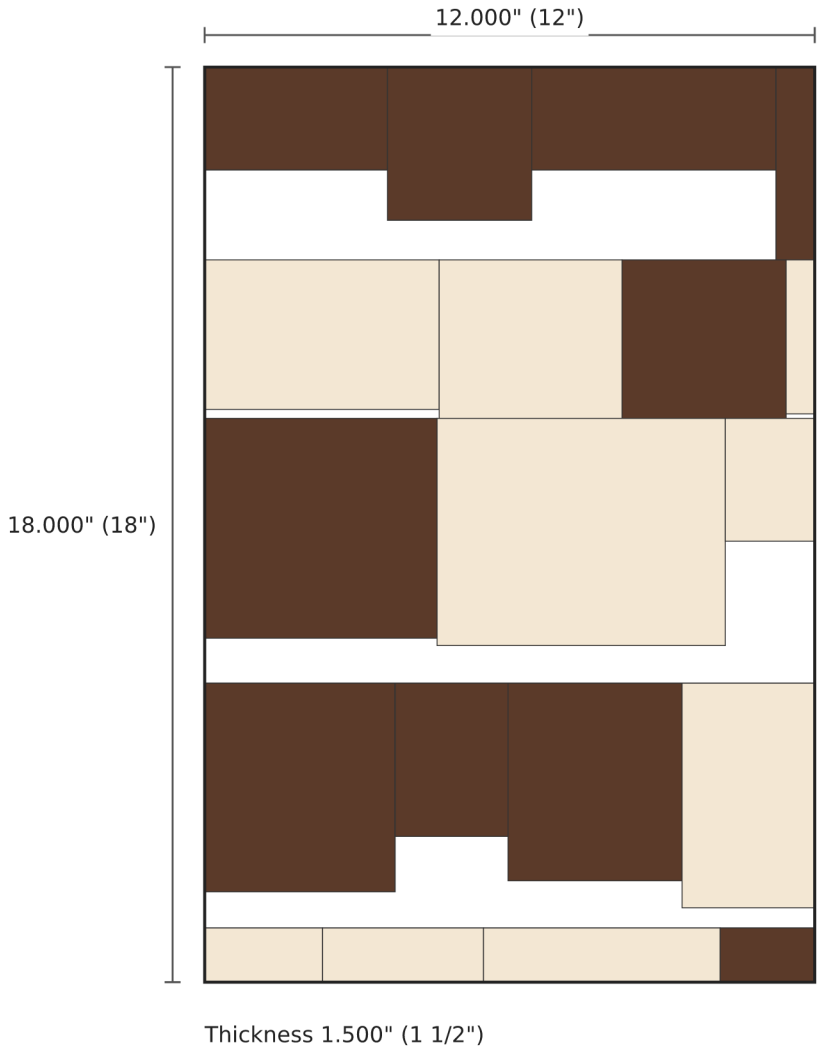

Flatten with a router sled or drum sander, never the thickness planer. Sand 80, 120, 180 grit. Break edges (180 grit).

Grits: 80 / 120 / 180

DANGER: Never run an end-grain glue-up through the thickness planer. It can blow apart. Flatten with a router sled or drum sander.

Step 7: Edge profile


Rout the edge profile, default: 1/8" (3 mm) roundover. Optional finger grips: core box / round-nose bit 3/8-1/2" (9.5-12.7 mm).

Settings:

Bit: 1/8" (3 mm) roundover

WARNING: Climb cuts can grab. Feed the router against the bit rotation and take shallow passes.

Scrap Chaotic (End Grain): outline, step 7: Edge profile

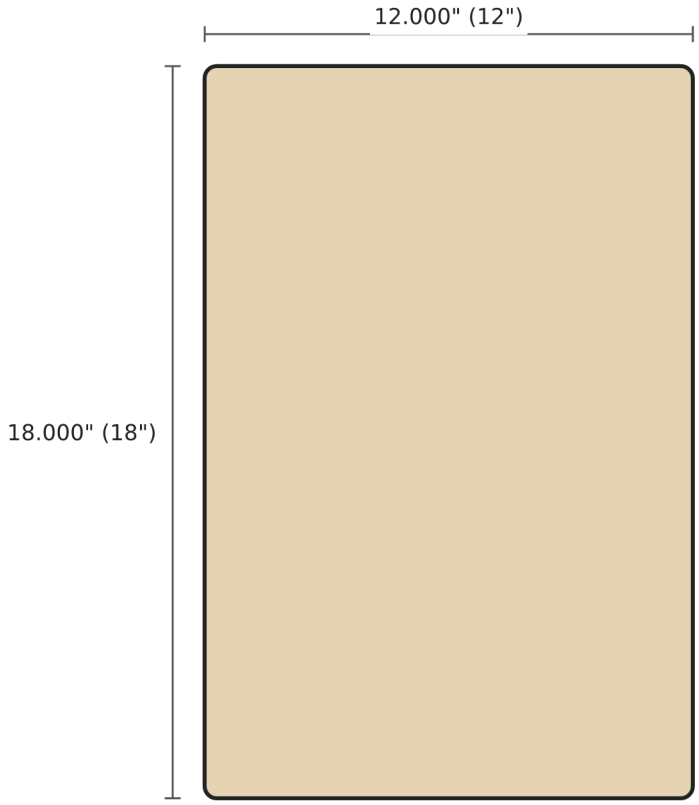

Rout the edge profile, default: 1/8" (3 mm) roundover. Optional finger grips: core box / round-nose bit 3/8–1/2" (9.5–12.7 mm).

Bit: 1/8" (3 mm) roundover

WARNING: Climb cuts can grab. Feed the router against the bit rotation and take shallow passes.

Step 8: Finish

Raise the grain with a damp cloth, sand 180 again, then flood with food-safe mineral oil and top with board butter.

NOTE: Use closed-grain, non-toxic hardwoods only. Avoid spalted, softwood or oily/sensitising exotics on cutting surfaces.