


EQ-01 SF-S06 / SF-S08 bearings over the FF windows FF-WF02 / FF-WF19 (S-102, S-121)

Status: Open | see GS-02

ICF model (GS-02)

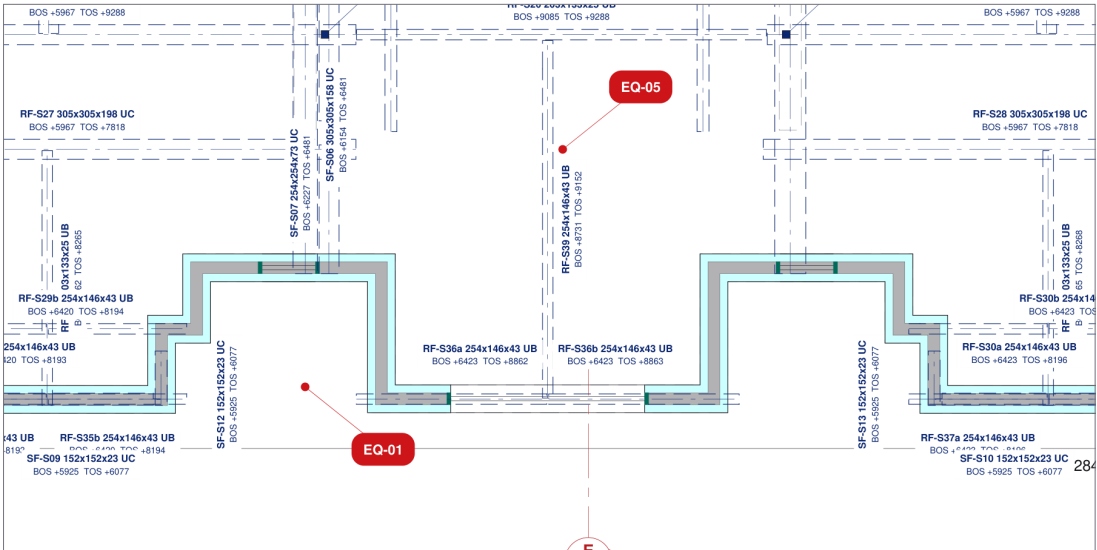

ISSUE The second-floor transfer beams SF-S06 (UC 305x305x158, x 6370) and SF-S08 (UC 356x406x287, x 12586) bear on the south wall (L2, top 174.975 AOD) directly over the 685-wide FF windows either side of the entrance bay. At TOS 175.229 the beam undersides are 6252 (S06) and 6185 (S08) above the slab datum; the architect's window head is 6023, leaving 229 mm (S06) and 162 mm (S08) of wall between head and beam. S-121 schedules an RCB152 x 300 - 2H16 lintel there, which would reach 6323, 71 mm into SF-S06 and 138 mm into SF-S08.

QUESTION Please confirm the bearing detail: a steel spreader under each beam end (model assumption UC 152x152x30, 1285 long, 300 bearing each side, TOS = beam underside), or a revised lintel / beam arrangement. The window positions are the architect's and are held.


ENGINEER'S RESPONSE

Name / date:

EQ-02 Stair void on S-101 vs the architect's main stair (Plan FF, Sections A-A / E-E)

Status: Open | see GS-02

ICF model (GS-02)

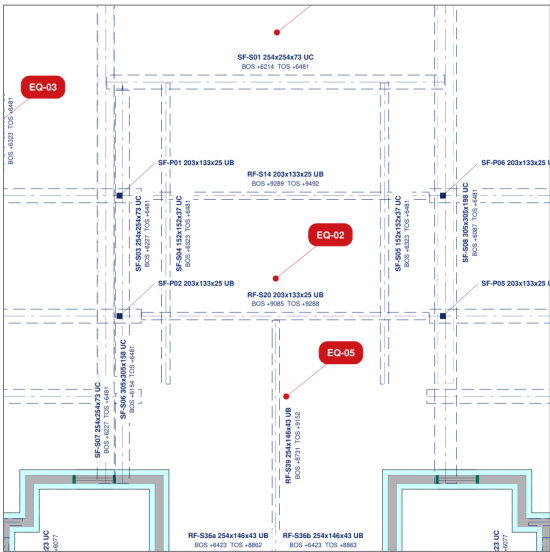

Status: Open | see GS-02

RF-S226 35x25x473 UC
BOS +5967 TOS +9492

RF-S12 305x305x198 UC
BOS +6967 TOS +9492

RF-S19 305x305x198 UC
BOS +6967 TOS +9288

RF-S10 15x15x77 UC
BOS +8323 TOS +6481

EQ-03

SF-S03 35x25x473 UC
BOS +6227 TOS +6481

SF-P01 20x20x77 UC
BOS +5323 TOS +6481

SF-S04 15x15x77 UC
BOS +5323 TOS +6481

SF-P02 20x20x77 UC
BOS +5323 TOS +6481

QUESTION Please confirm its purpose and bearings (lift overrun trimmer?).

Name / date:

Status: Open | see GS-02

QUESTION Please confirm the intended TOS of the cranked frames and knee beams, and the splice arrangement of the collinear plateau pairs.

Name / date:

Ref	Subject	Drawing	Status
EQ-01	SF-S06 / SF-S08 bearings over the FF windows FF-WF02 / FF-WF19 (S-102, S-121)	GS-02	Open
EQ-02	Stair void on S-101 vs the architect's main stair (Plan FF, Sections A-A / E-E)	GS-02	Open
EQ-03	RF-S13 (UC 152x152x30, x 4225, y 7030...9373, TOS 175.229) has no support at either end	GS-02	Open
EQ-04	Roof steel levels (S-103 / S-200 / S-201) - for confirmation	GS-02	Open
EQ-05	RF-S40 / RF-S41 bay ridge beams land 244 mm above RF-S27 / RF-S28	GS-02	Open
EQ-06	Lintel depths vs the floor bearings (S-120 / S-121)	GA-01	Open
EQ-07	S-120 internal ICF walls flanking the hall (x 6.2 m / 12.4 m) - door positions	GA-01	Open

1. Questions raised on the ICF approval drawings against the structural engineer's drawing Tier Consult 078-TCE-DEN-XX-DR-S-096..210 rev -.
2. Each panel shows the engineer's drawing beside the architect's drawing and/or the ICF model, cropped to the same area.
3. Please answer in the response box of each question (or by email quoting the EQ reference); the approval drawings will be revised to suit.
4. EQ tags on the GA drawings link to these panels.

REV	DATE	DESCRIPTION
P01	23.09.26	Approval issue



PROJECT	Dendrons
---------	----------

QUESTIONS FOR THE ENGINEER

Structural queries on the ICF approval drawings - sheet 2 of 4

	DRAWN
	TS

REV

FOR APPROVAL


UKPCS-003-EQ-01

P01

EQ-05 RF-S40 / RF-S41 bay ridge beams land 244 mm above RF-S27 / RF-S28

Status: Open | see GS-02

ICF model (GS-02)

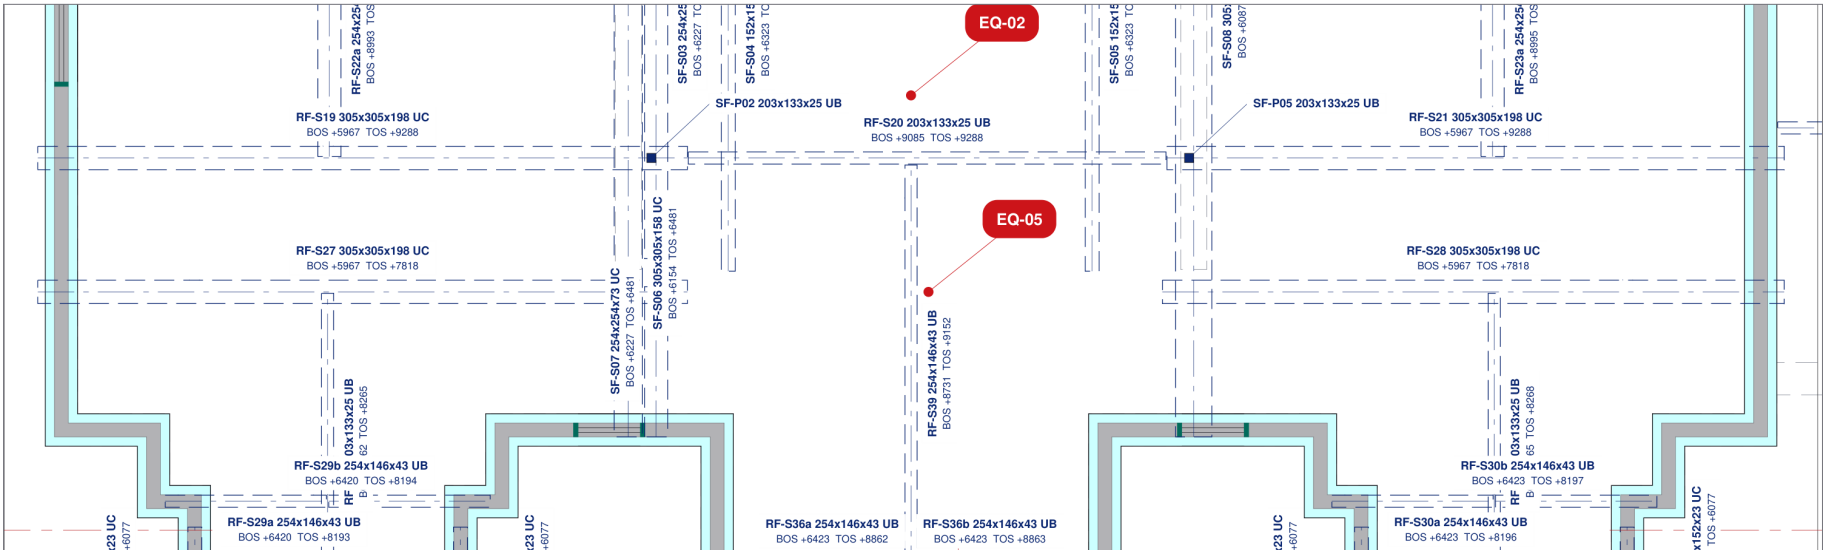

ISSUE RF-S40/RF-S41 (bay 1/3 ridge beams, TOS 177.013) land 244 mm above RF-S27/RF-S28 (TOS 176.566); modelled on 244-high stools.

QUESTION Please confirm the stool / seating detail.

ENGINEER'S RESPONSE

Name / date:

EQ-06 Lintel depths vs the floor bearings (S-120 / S-121)

Status: Open | see GA-01

ISSUE GF north openings GF-WG07/08/09 (heads at 2948 = 171.598 AOD): the scheduled RCB152 x 375 - 2H20 reaches 3323, 23 mm above the hollowcore soffit 3300 (S-101 TOC 172.100, 150 planks). FF north windows FF-WF05/11 (heads 6023): the RCB152 x 350 - 2H20 reaches 6373, 48 mm above the FF wall top (174.975 AOD, the second-floor joist bearing). Both modelled as drawn. The pool-hall screens GF-WG10..13 carry the S-101 high-level beams FF-S16/S06/S07/S01 with no RC lintel.

QUESTION Please confirm the lintel / bearing arrangement at these openings.

ENGINEER'S RESPONSE

Name / date:

QUESTIONS REGISTER

QUERIES

Ref	Subject	Drawing	Status
EQ-01	SF-S06 / SF-S08 bearings over the FF windows FF-WF02 / FF-WF19 (S-102, S-121)	GS-02	Open
EQ-02	Stair void on S-101 vs the architect's main stair (Plan FF, Sections A-A / E-E)	GS-02	Open
EQ-03	RF-S13 (UC 152x152x30, x 4225, y 7030..9373, TOS 175.229) has no support at either end	GS-02	Open
EQ-04	Roof steel levels (S-103 / S-200 / S-201) - for confirmation	GS-02	Open
EQ-05	RF-S40 / RF-S41 bay ridge beams land 244 mm above RF-S27 / RF-S28	GS-02	Open
EQ-06	Lintel depths vs the floor bearings (S-120 / S-121)	GA-01	Open
EQ-07	S-120 internal ICF walls flanking the hall (x 6.2 m / 12.4 m) - door positions	GA-01	Open

NOTES

- Questions raised on the ICF approval drawings against the structural engineer's drawing Tier Consult 078-TCE-DEN-XX-DR-S-096..210 rev -.
- Each panel shows the engineer's drawing beside the architect's drawing and/or the ICF model, cropped to the same area.
- Please answer in the response box of each question (or by email quoting the EQ reference); the approval drawings will be revised to suit.
- EQ tags on the GA drawings link to these panels.

REVISIONS

REV	DATE	DESCRIPTION
P01	23.09.26	Approval issue



CLIENT

ICF Homes

PROJECT

Dendrons

DRAWING TITLE

QUESTIONS FOR THE ENGINEER

Structural queries on the ICF approval drawings - sheet 3 of 4

SCALE	SIZE	DATE	DRAWN
NTS	A3	23.09.26	TS

STATUS	DRAWING No.	REV
FOR APPROVAL	UKPCS-003-EQ-01	P01

Do not scale. All dimensions in mm. Check all dimensions on site.

FOR APPROVAL - NOT FOR CONSTRUCTION

EQ-07 S-120 internal ICF walls flanking the hall (x 6.2 m / 12.4 m) - door positions

Status: Open | see GA-01

ISSUE S-120 shows ICF 286 mm walls either side of the hall with lintels at y 10.0-11.8 m and (S-121) 12.7-13.6 m; the model has these walls (Walls 43/44) with double doors GF-ID01/02 (1783 wide) and FF doors FF-ID01/02 (915) from the architect's swings. S-120 also shows lintels on the annex cross wall (Wall 46) at x 21.6-22.8, 23.5-24.5 and 26.9-27.8 m and on Wall 47 at y 5.05-6.87 m; the architect's plan shows the Wall 46 doors at 23.5-24.5 and 26.85-27.8 m and single doors at the north ends of Walls 45/47. Modelled to the architect (GF-ID03..07).

QUESTION Please confirm the door positions on the internal ICF walls.

ENGINEER'S RESPONSE

Name / date:

QUESTIONS REGISTER

QUERIES

Ref	Subject	Drawing	Status
EQ-01	SF-S06 / SF-S08 bearings over the FF windows FF-WF02 / FF-WF19 (S-102, S-121)	GS-02	Open
EQ-02	Stair void on S-101 vs the architect's main stair (Plan FF, Sections A-A / E-E)	GS-02	Open
EQ-03	RF-S13 (UC 152x152x30, x 4225, y 7030..9373, TOS 175.229) has no support at either end	GS-02	Open
EQ-04	Roof steel levels (S-103 / S-200 / S-201) - for confirmation	GS-02	Open
EQ-05	RF-S40 / RF-S41 bay ridge beams land 244 mm above RF-S27 / RF-S28	GS-02	Open
EQ-06	Lintel depths vs the floor bearings (S-120 / S-121)	GA-01	Open
EQ-07	S-120 internal ICF walls flanking the hall (x 6.2 m / 12.4 m) - door positions	GA-01	Open

NOTES

- Questions raised on the ICF approval drawings against the structural engineer's drawing Tier Consult 078-TCE-DEN-XX-DR-S-096..210 rev -.
- Each panel shows the engineer's drawing beside the architect's drawing and/or the ICF model, cropped to the same area.
- Please answer in the response box of each question (or by email quoting the EQ reference); the approval drawings will be revised to suit.
- EQ tags on the GA drawings link to these panels.

REVISIONS

REV	DATE	DESCRIPTION
P01	23.09.26	Approval issue



CLIENT	PROJECT
ICF Homes	Dendrons

DRAWING TITLE
QUESTIONS FOR THE ENGINEER

Structural queries on the ICF approval drawings - sheet 4 of 4

SCALE	SIZE	DATE	DRAWN
NTS	A3	23.09.26	TS
STATUS		DRAWING No.	REV
FOR APPROVAL		UKPCS-003-EQ-01	P01