



C:\Users\jcd\Documents\1050 - VAAC-Bldg-Building_1_R17_Central.mxd - 10-9-18_Yeanyoung.rvt 2/26/2018 9:23:08 AM

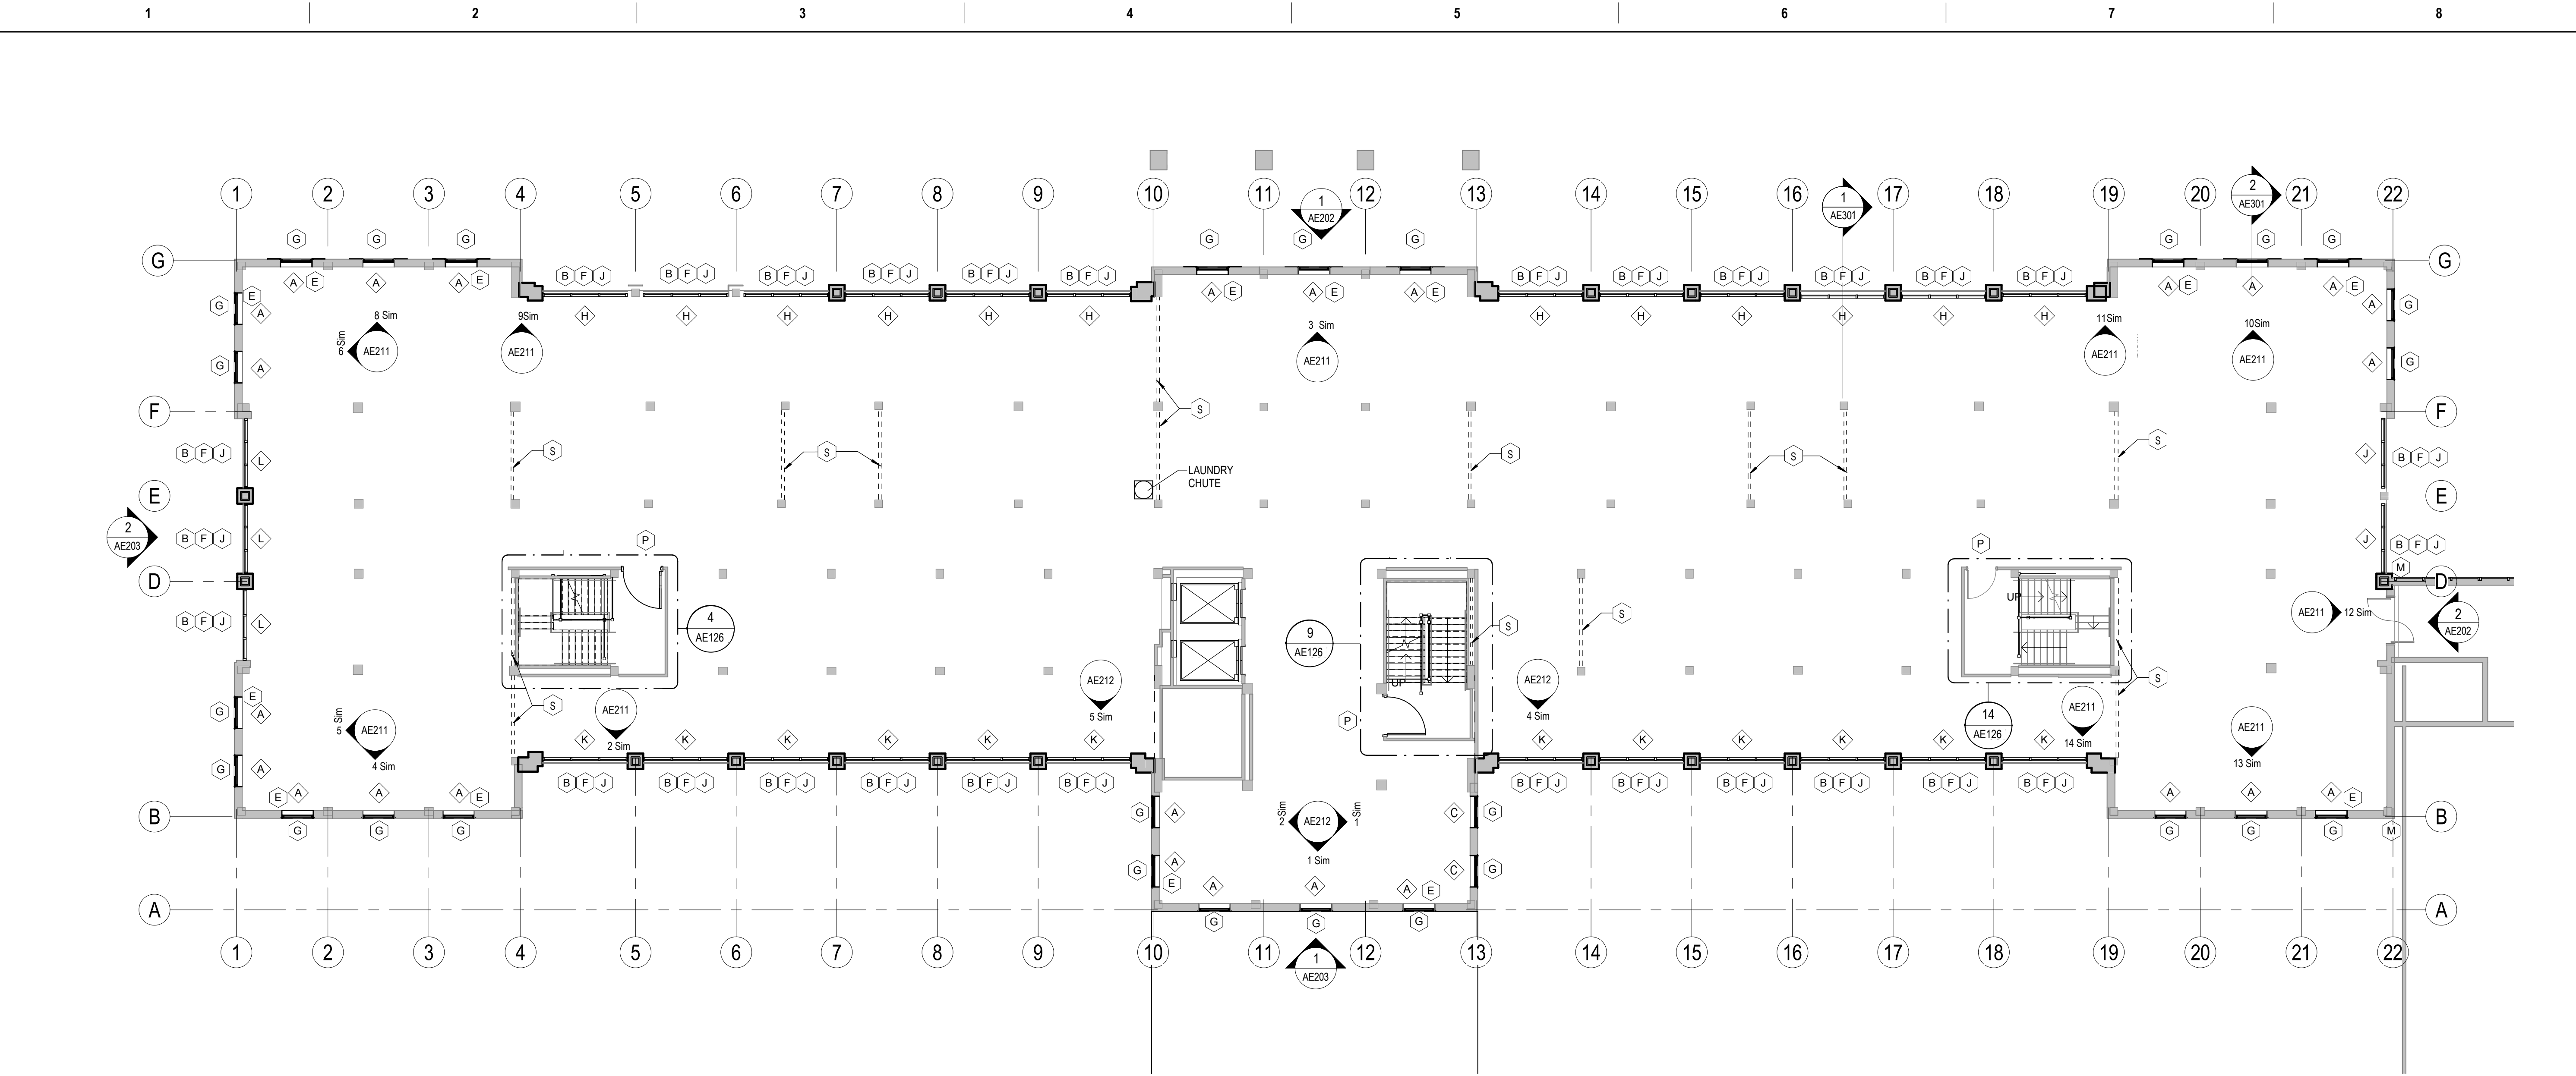

2 FOURTH FLOOR PLAN
3/32" = 1'-0"

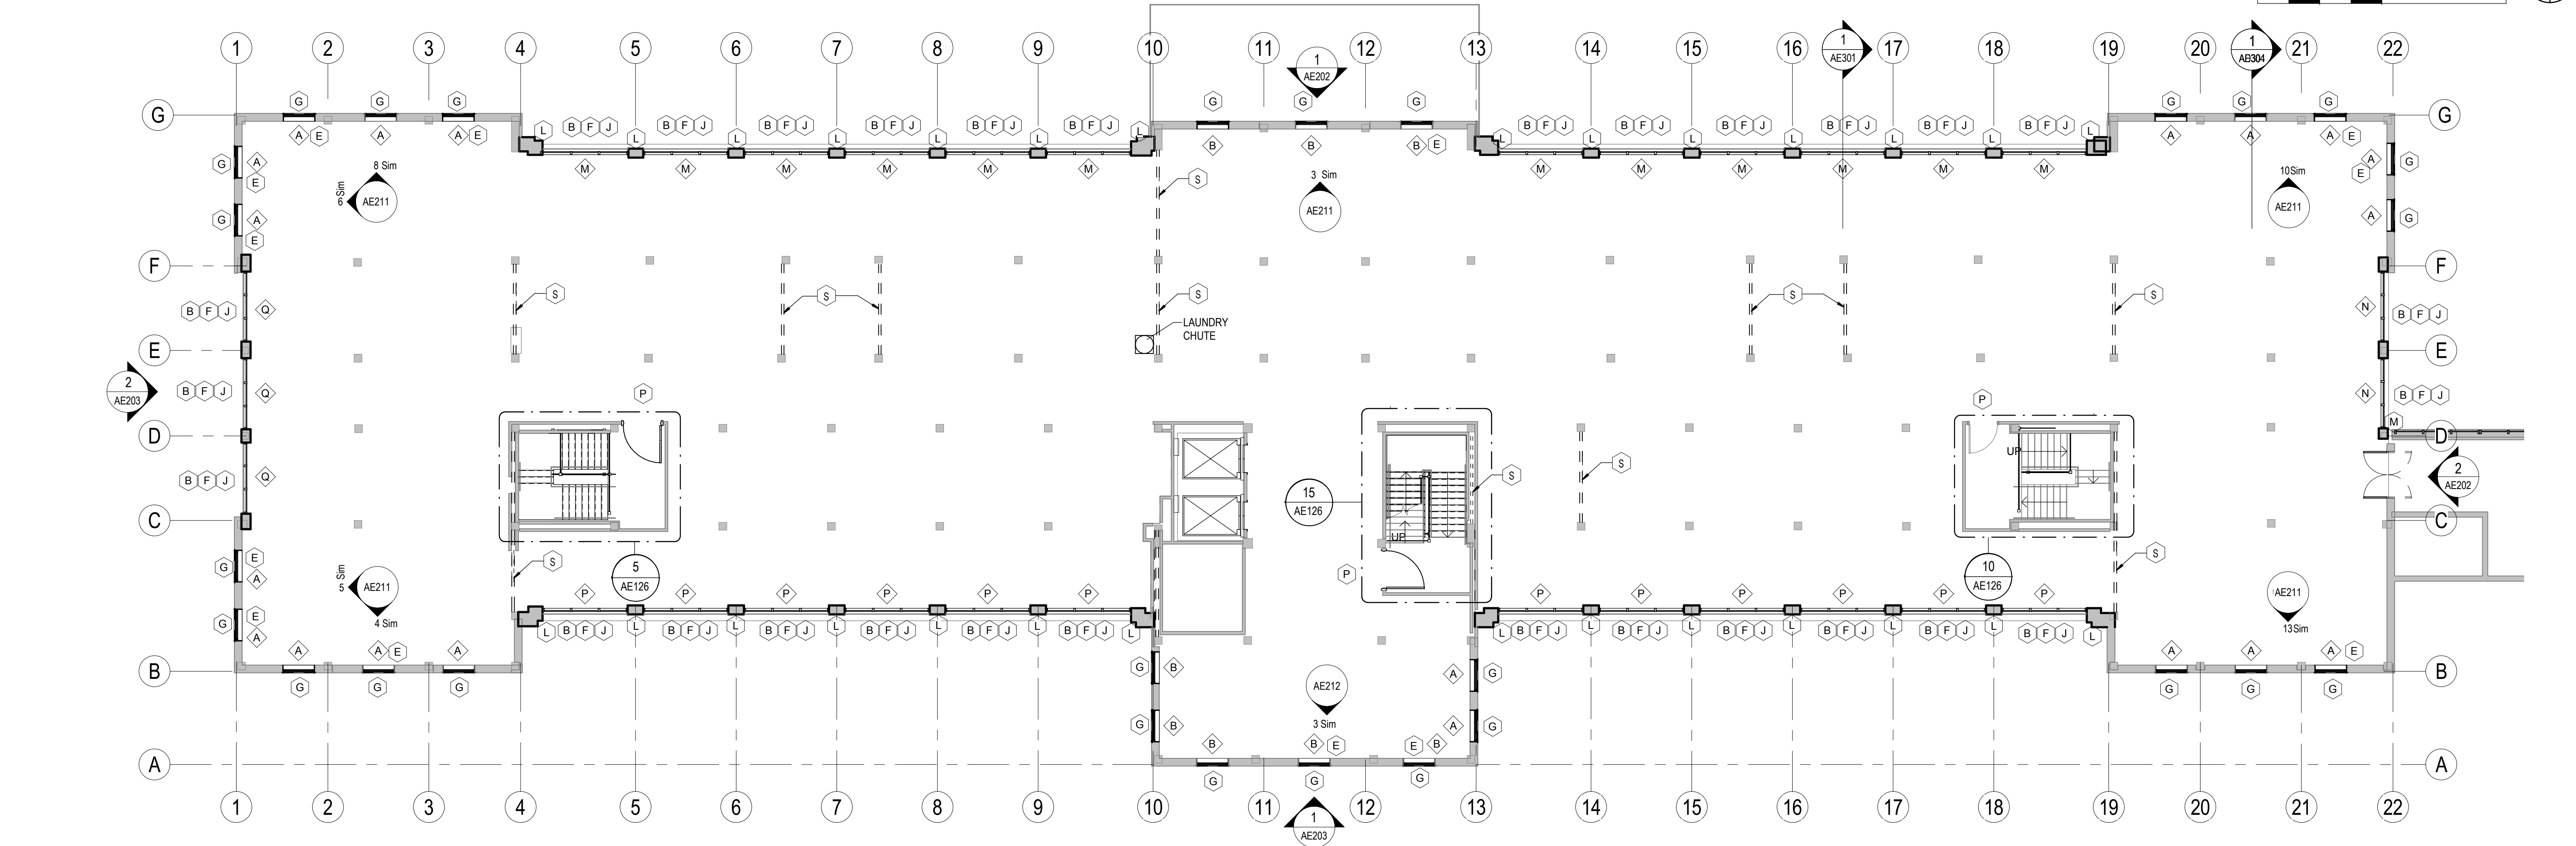

1 FIFTH FLOOR PLAN
3/32" = 1'-0"

FLOOR PLAN GENERAL NOTES

- CONTRACTOR IS TO FIELD VERIFY ALL DIMENSIONS AND CONDITIONS.
- UPON DISCOVERY OF ANY DISCREPANCIES BETWEEN DRAWINGS AND EXISTING CONDITIONS OR UPON DISCOVERY OF UNKNOWN CONDITIONS DEPENDANT TO THE COMPLETION OF THE WORK AS INDICATED IN THE DOCUMENTS, THE CONTRACTOR SHALL IMMEDIATELY NOTIFY THE ARCHITECT & RESIDENT ENGINEER, IN WRITING, OF THE CONDITION IN QUESTION BEFORE PROCEEDING WITH WORK IN THE AREA.
- CONTRACTOR SHALL MAINTAIN SAFE METHODS OF EGRESS FOR OCCUPIED PORTIONS OF BUILDING AND IN SITE AREA DURING CONSTRUCTION.
- DO NOT SCALE DRAWINGS. IF DIMENSIONS ARE IN QUESTION, THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING CLARIFICATION FROM THE ARCHITECT & RESIDENT ENGINEER BEFORE CONTINUING WITH THE CONSTRUCTION.
- COORDINATE WORK WITH OTHER PHASES
- COORDINATE SITE LAYOUT / ACCESS / WORK AREAS / LAYDOWN AREAS / PHASING WITH RESIDENT ENGINEER.
- ALL INTERIOR DIMENSIONS ARE TAKEN FROM FACE OF MASONRY, GYPSUM BOARD UNLESS NOTED OTHERWISE
- DIMENSIONS AT WINDOW LOCATIONS ARE TO BE COORDINATED WITH WINDOW SYSTEMS
- SEE SHEET AE603 FOR CURTAINWALL AND WINDOW TYPES
- SEE SHEET AE502 FOR TYPICAL CURTAINWALL AND COLUMN CONSTRUCTION DETAILS
- SEE ELEVATIONS AND WALL SECTIONS FOR ADDITIONAL INFORMATION
- PROVIDE SEALANT AT INTERSECTIONS OF DISSIMILAR MATERIALS AND AROUND ALL PENETRATIONS. WATERPROOF COATING TO RUN OVER THE TOP OF SEALANT, TYP

FLOOR PLAN LEGEND

- EXISTING STRUCTURAL CROSS BRACING TO REMAIN
- EXISTING TO REMAIN
- NEW CONSTRUCTION
- KEYNOTE
- WINDOW TYPE

FLOOR PLAN KEYNOTES


- APPLY BLAST FILM TO INTERIOR OF ALL EXISTING WINDOW. SEE SPEC SECTION 08 80 00. APPLY GUNABLE SEALANT OVER BUTYL TAPE AT ALL EXISTING WINDOWS.
- REINSTALL REFINISHED RAILINGS. FILL ANY SOCKETS IN STONE WITH EPOXY. REMOVE BOTTOM OF POST S IF APPLICABLE AND PROVIDE L-BRACKET TO FASTEN TO RAIL TO ADJACENT COLUMN.
- REINSTALL SHUTTERS.
- INFILL CAVITY WHERE TERRA COTTA BRICK WAS REMOVED. SEE DETAILS SHEET S404.
- INFILL CAVITY BELOW EXISTING PUNCHED WINDOW OPENING. SEE STRUCTURAL DETAILS ON S408.
- INSTALL ALUMINUM CURTAINWALL UNIT IN EXISTING OPENING ACCORDING TO MANUFACTURER'S RECOMMENDATIONS.
- INSTALL ALUMINUM WINDOW IN EXISTING OPENING. ACCORDING TO MANUFACTURER'S RECOMMENDATIONS.
- INSTALL SEALANT AND BACKER RODS AT ALL EXISTING DOOR AND LOUVER. PAINT EXISTING DOOR FRAMES.
- PROVIDE STRUCTURAL MODIFICATIONS/ADDITIONS AT WINDOW / STOREFRONT OPENING. SEE STRUCTURAL SHEET S402 AND S403.
- INSTALL CMU INFILL AT EXISTING OPENING. SEE DETAILS ON SHEET S404.
- REINSTALL METAL COLUMNS AT 5TH FLOOR.
- INSTALL ALUMINUM EXPANSION JOINT ASSEMBLY AT NORTH AND SOUTH SIDES OF BUILDING 1 AT CONNECTION TO BUILDING 53. SEE SPEC SECTION 07 85 13 - EXPANSION JOINT COVER ASSEMBLY AND DETAILS ON SHEET AE511 FOR MORE INFORMATION.
- REINSTALL EXTERIOR ACCESS CONTROLS, EXTERIOR LIGHT FIXTURE AND EXTERIOR SECURITY COMMUNICATIONS FIXTURE AFTER EXTERIOR WORK COMPLETE.
- AT STAIR LOCATIONS OF REMOVED FIRE HOSE CABINETS AND ASSOCIATED PIPING, PATCH PARTITION OPENINGS WITH RATED GYPSUM BOARD TO MAINTAIN FIRE RATING. INTEGRITY OF REQUIRED STAIRWELL RATING. SEE FX SERIES DRAWINGS FOR ADDITIONAL INFORMATION.
- AT AREA BOUNDED BY GRID 10, 13, B, AND G, REPAIR AND RESTORE PORTIONS OF EXISTING PAINTED PLASTER FINISH TO DOCUMENTED PRE-DEMOLITION CONDITION WITH IN KIND MATERIAL. AT LOCATIONS OF SELECTIVE DEMOLITION INDICATED ON 1/AD02 AFTER COMPLETION OF WORK INDICATED ON 1/ME100.
- FOLLOWING THE STRUCTURAL EVALUATION AND REPAIRS TO THE THIRD FLOOR STRUCTURAL FLOOR, REINSTALL CEILING SYSTEMS, DUCTWORK, PLUMBING, FIRE PROTECTION SYSTEMS, ELECTRICAL SYSTEMS, LOW VOLTAGE SYSTEMS, AND FIREPROOFING IN THE SECOND FLOOR CEILING PLENUM. SLAB UNDERSIDE TO MEET TWO-HOUR RATED FLOOR CONSTRUCTION. SEE SPECIFICATIONS - GENERAL REQUIREMENTS 01 00 00 PARAGRAPH 1.3, FOR ALTERNATES IN WORK FROM BASE BID.
- EXISTING STRUCTURAL STEEL BRACING TO REMAIN, PAINT

NOTE: NOT ALL THE KEYNOTES ARE USED ON THIS SHEET


BID DOCUMENTS

Revisions:		CONSULTANT	ARCHITECT/ENGINEER OF RECORD THOMAS OLESAK, ARCHITECT MS Lic # 5505 1050 HOYT AVE WEST ST PAUL, MN 55117 952-451-0460	STAMP  03.10.2023	Office of Construction and Facilities Management VA U.S. Department of Veterans Affairs	Drawing Title 4TH & 5TH FLOOR PLAN - SHELL	Phase CONSTRUCTION DOCUMENTS	Project Title RENOVATE BUILDING 1	Project Number 520-317X
							Building Number 1	Drawing Number AE104	
							Location BILOXI, MISSISSIPPI		
							Issue Date 03/10/2023	Checked LA	Drawn CD
									Dwg. 62 of 238


3/13/2023 10:30:25 AM
C:\Users\pjd\Documents\15950 - VAHC-Bldg Building 1_R21_Central.mxd_Yunyoung.nst

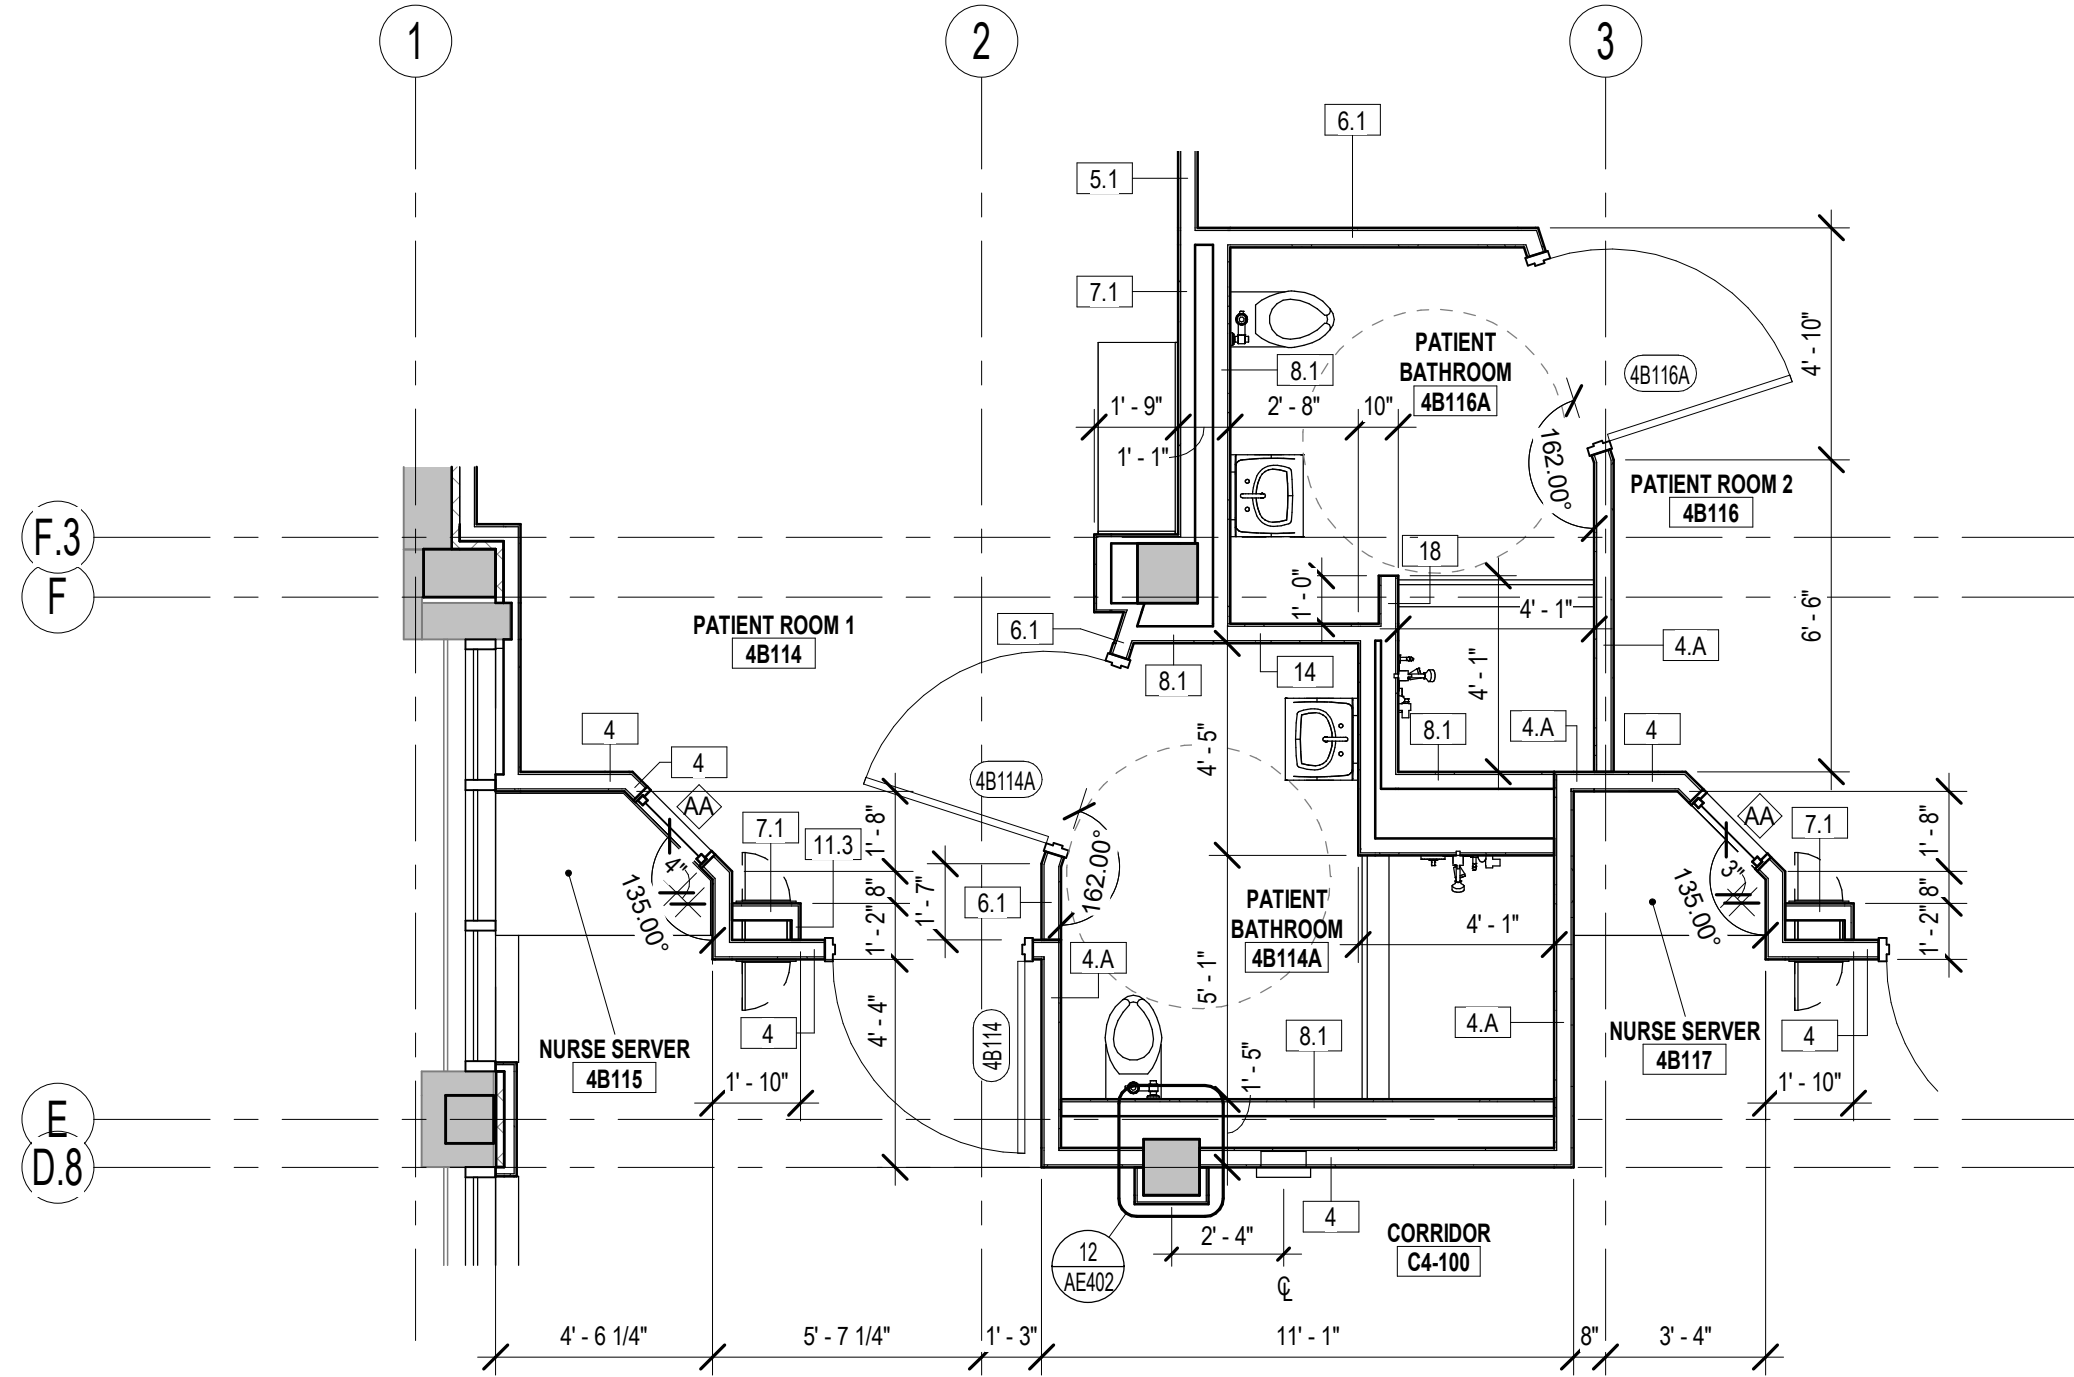


1 ENLARGED DIMENSION PLAN - 4B114A/4B116A
AE108.2 1/4" = 1'-0"

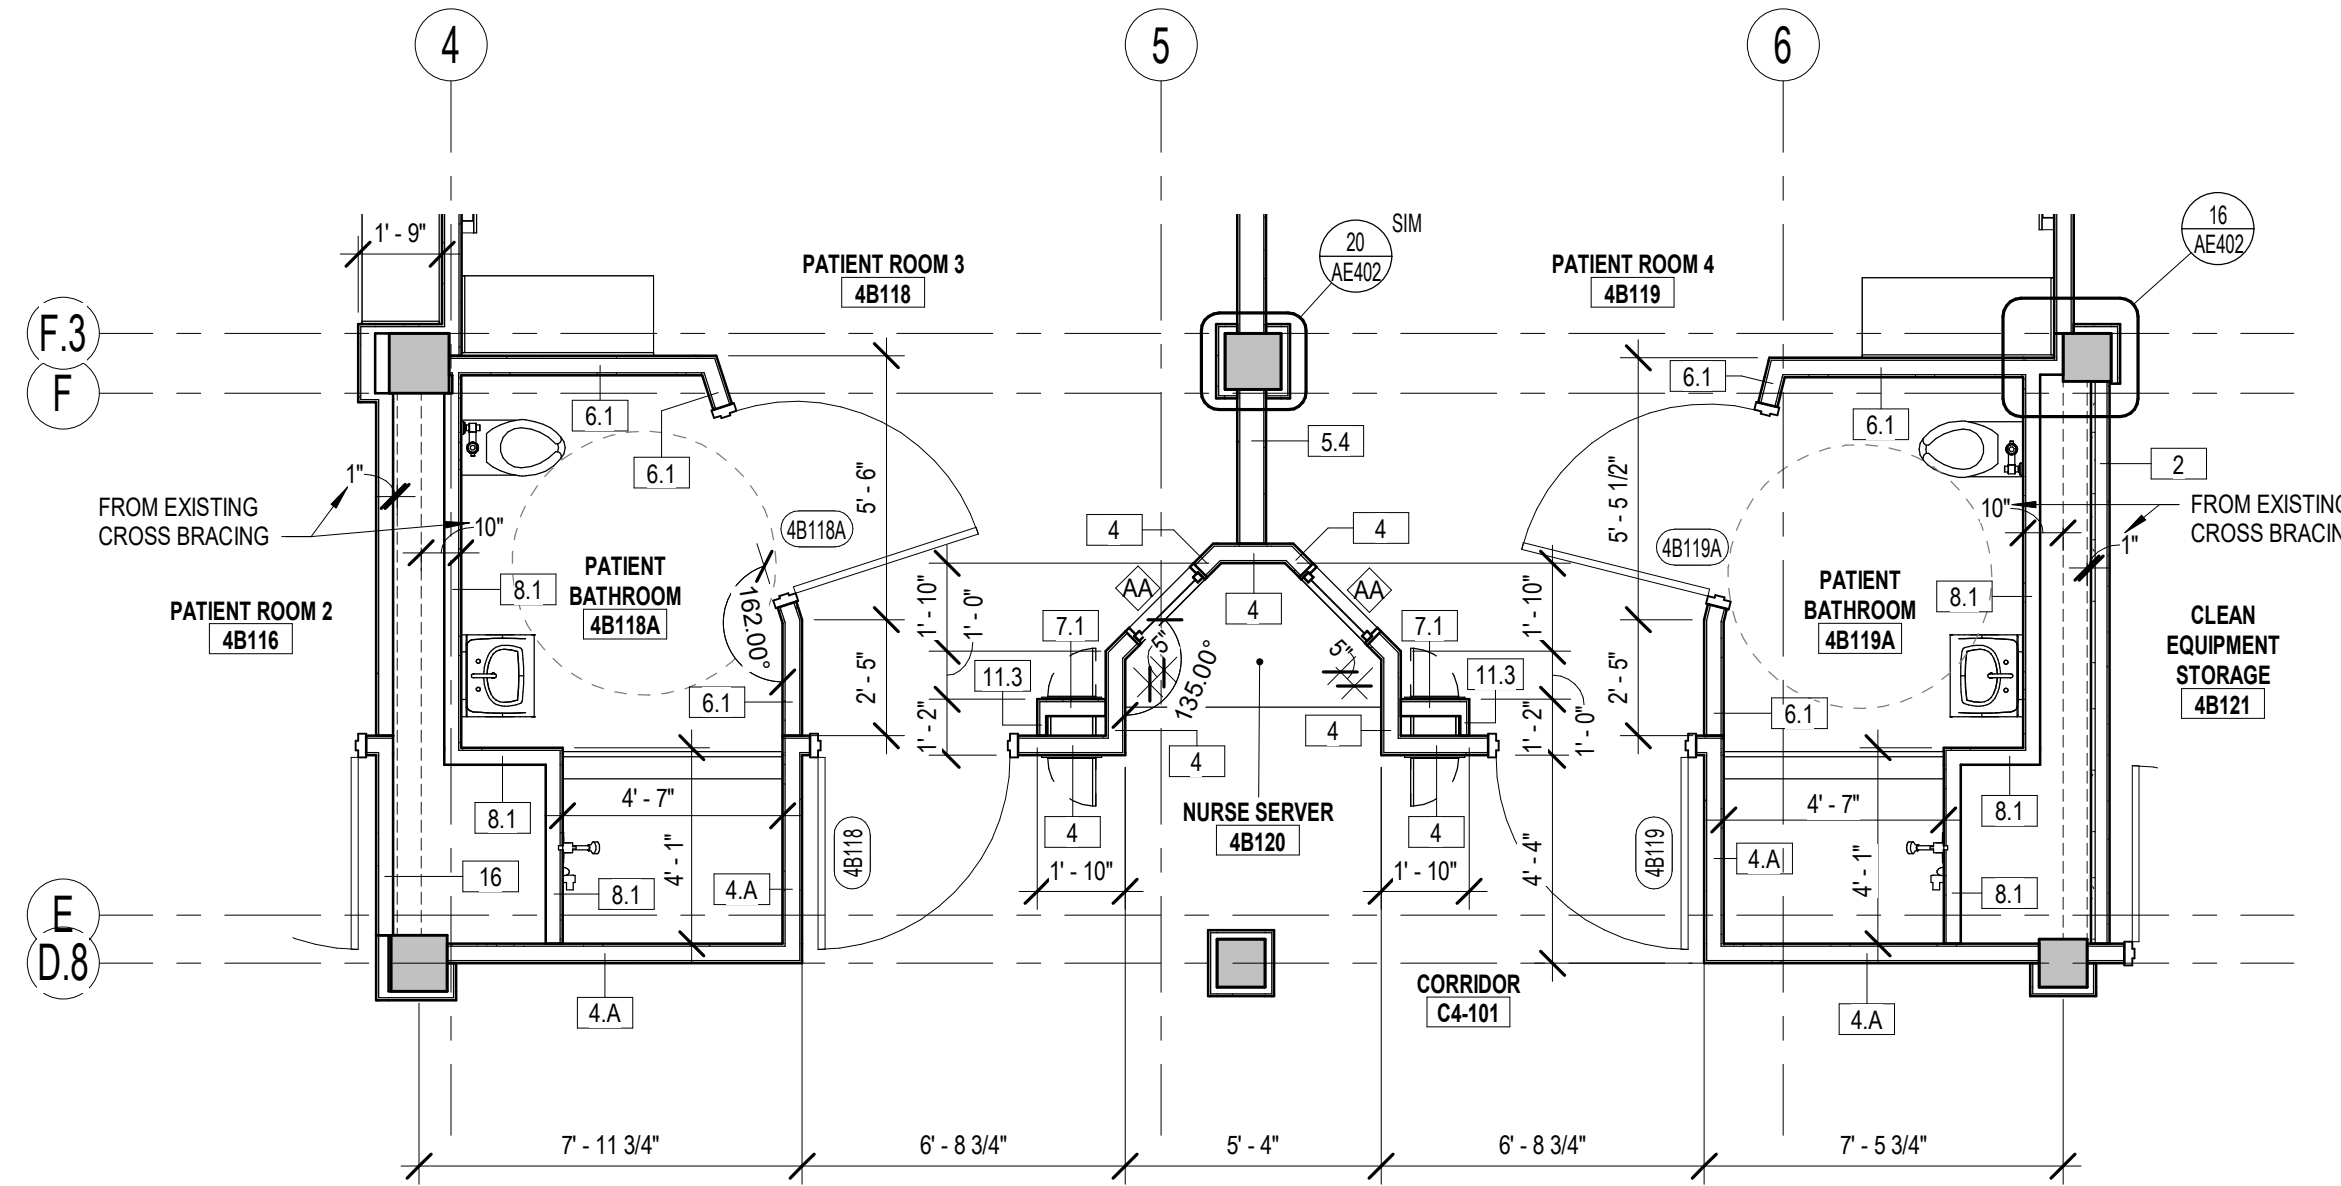


2 ENLARGED DIMENSION PLAN - 4B118A/4B119A
AE108.2 1/4" = 1'-0"

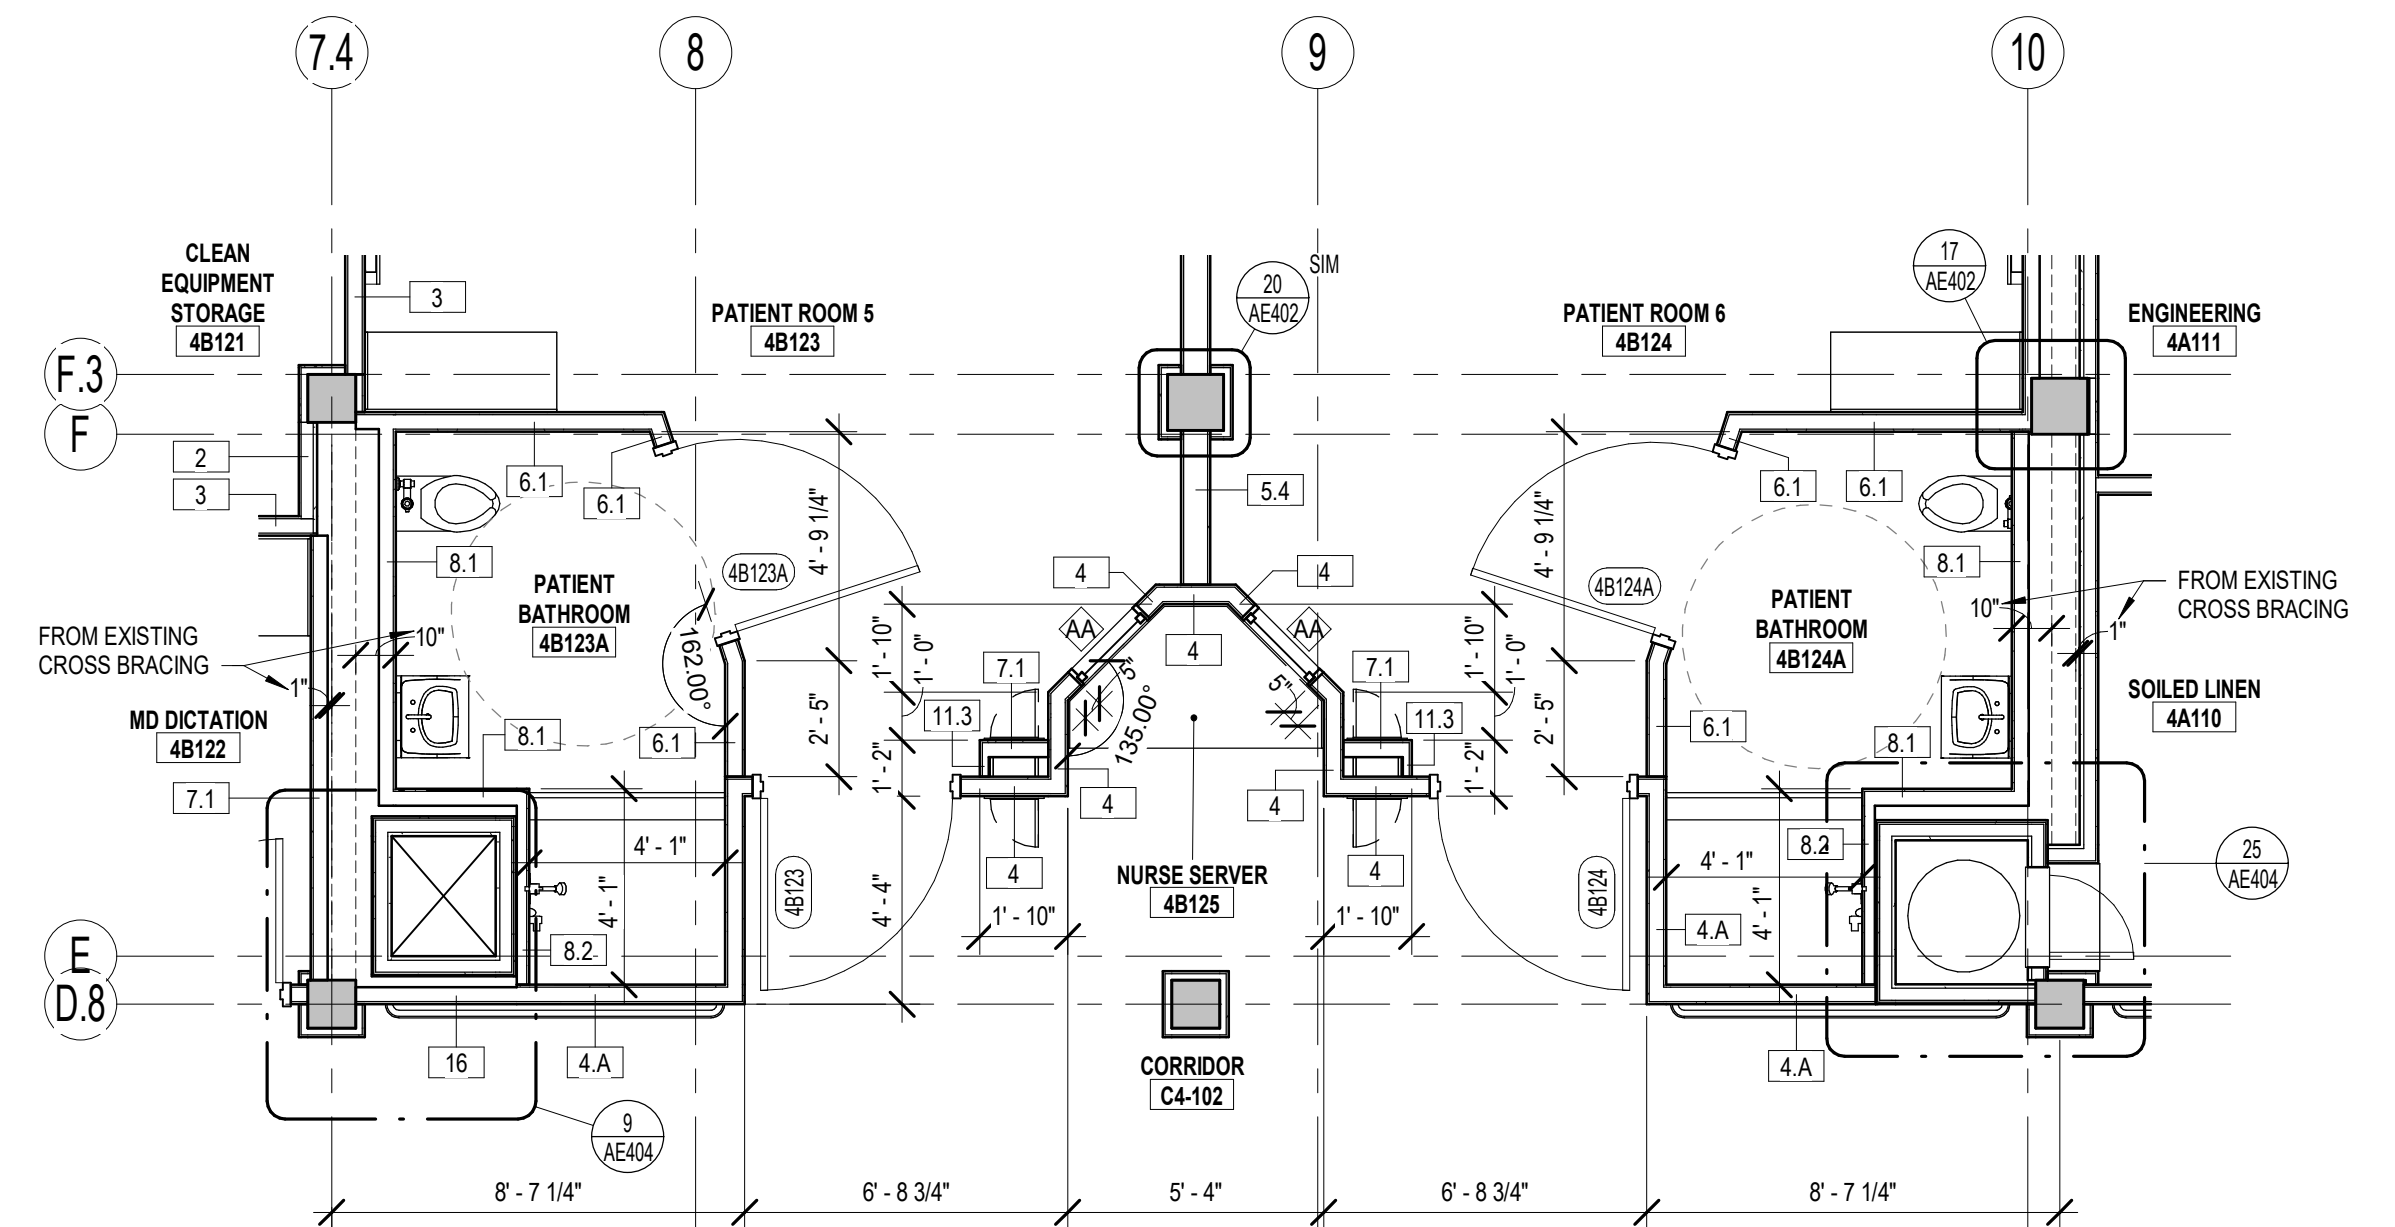


3 ENLARGED DIMENSION PLAN - 4B123A/4B124A
AE108.2 1/4" = 1'-0"

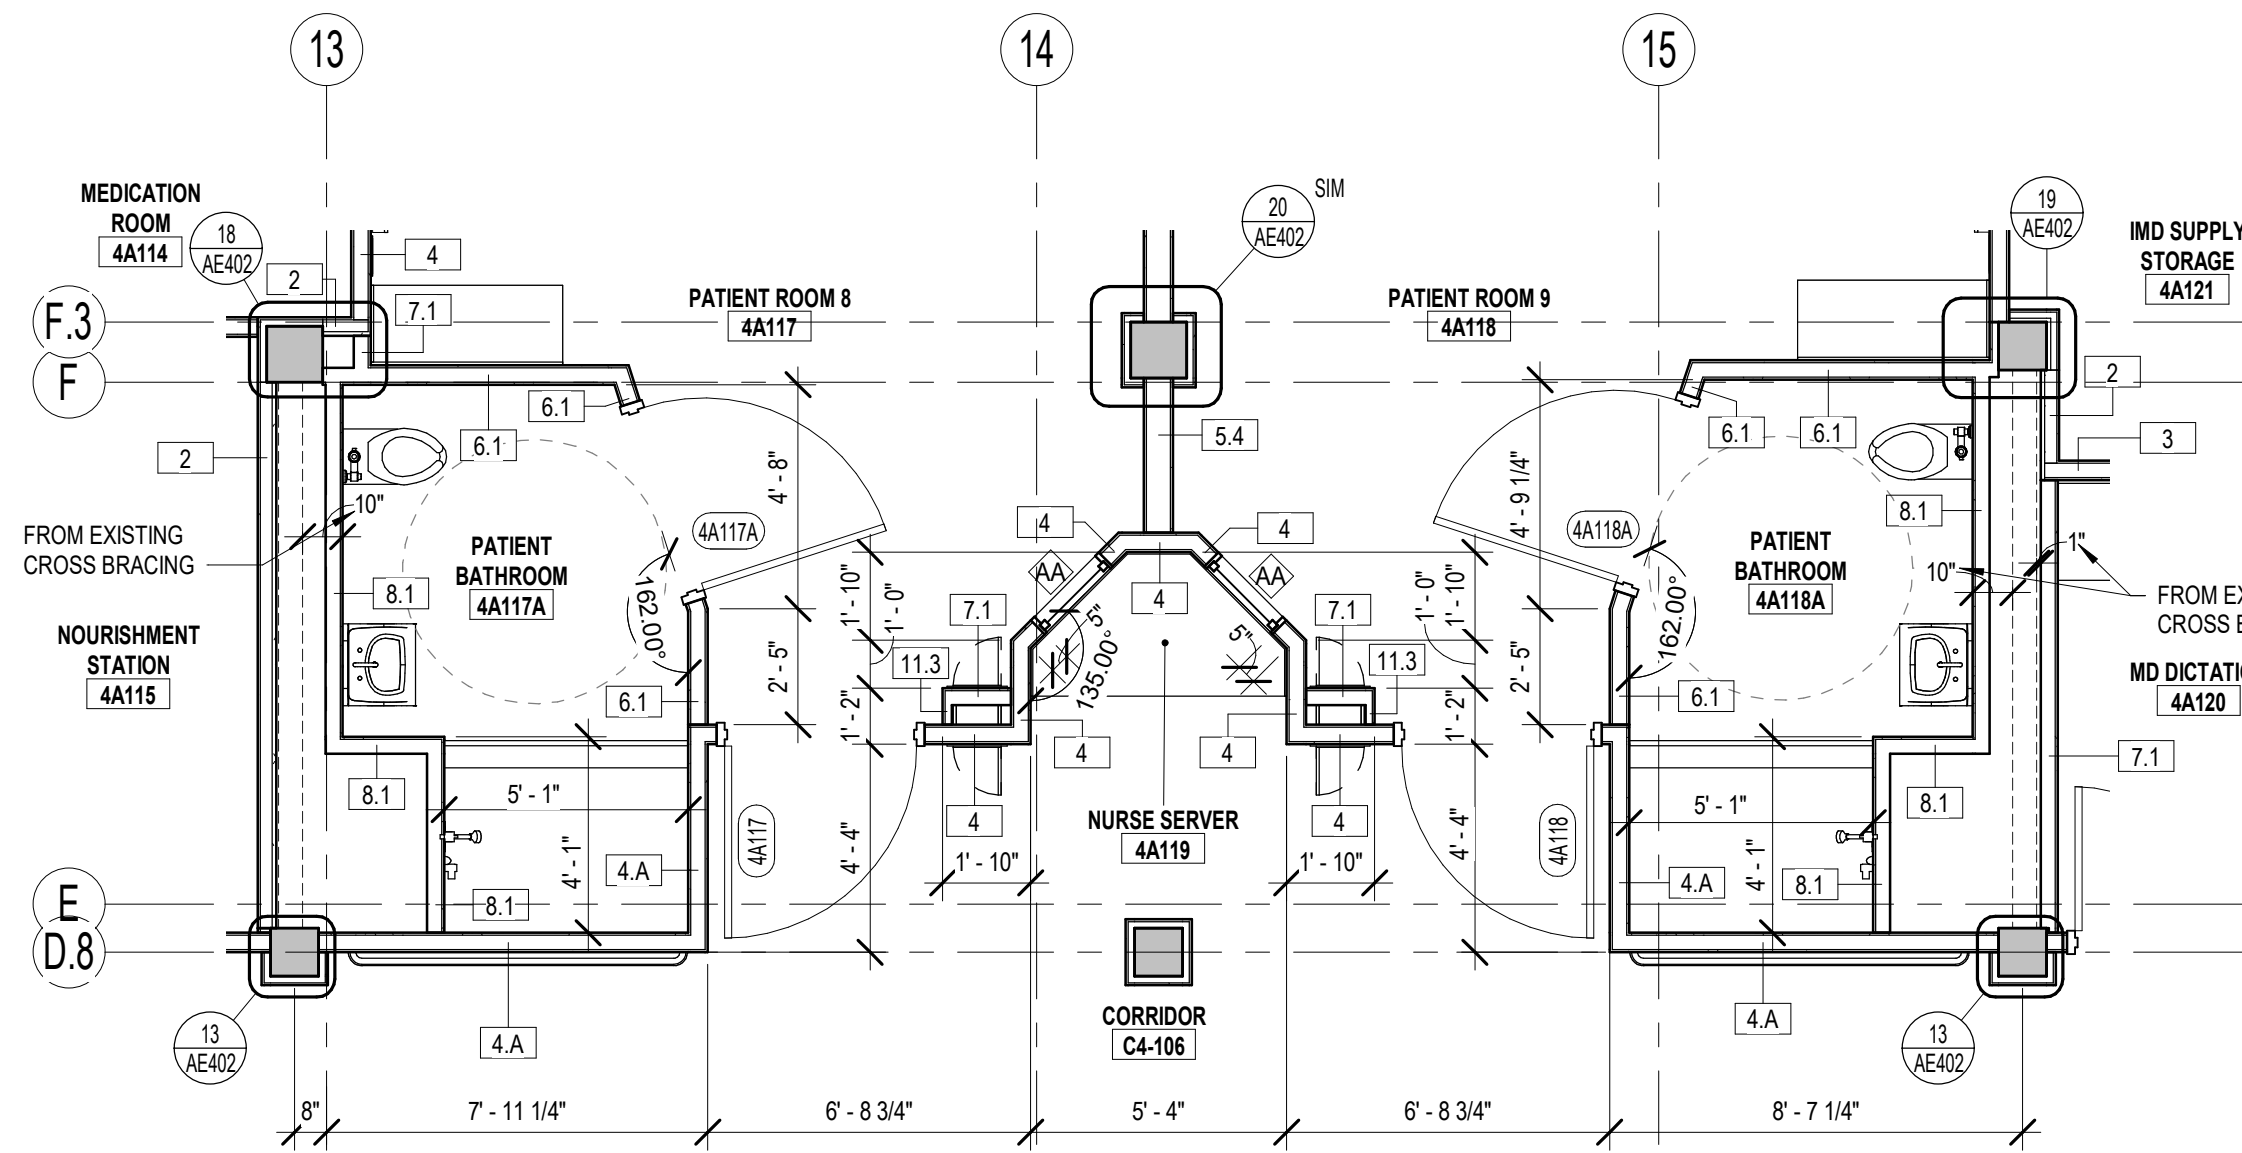


4 ENLARGED DIMENSION PLAN - 4A117A/4A118A
AE108.2 1/4" = 1'-0"

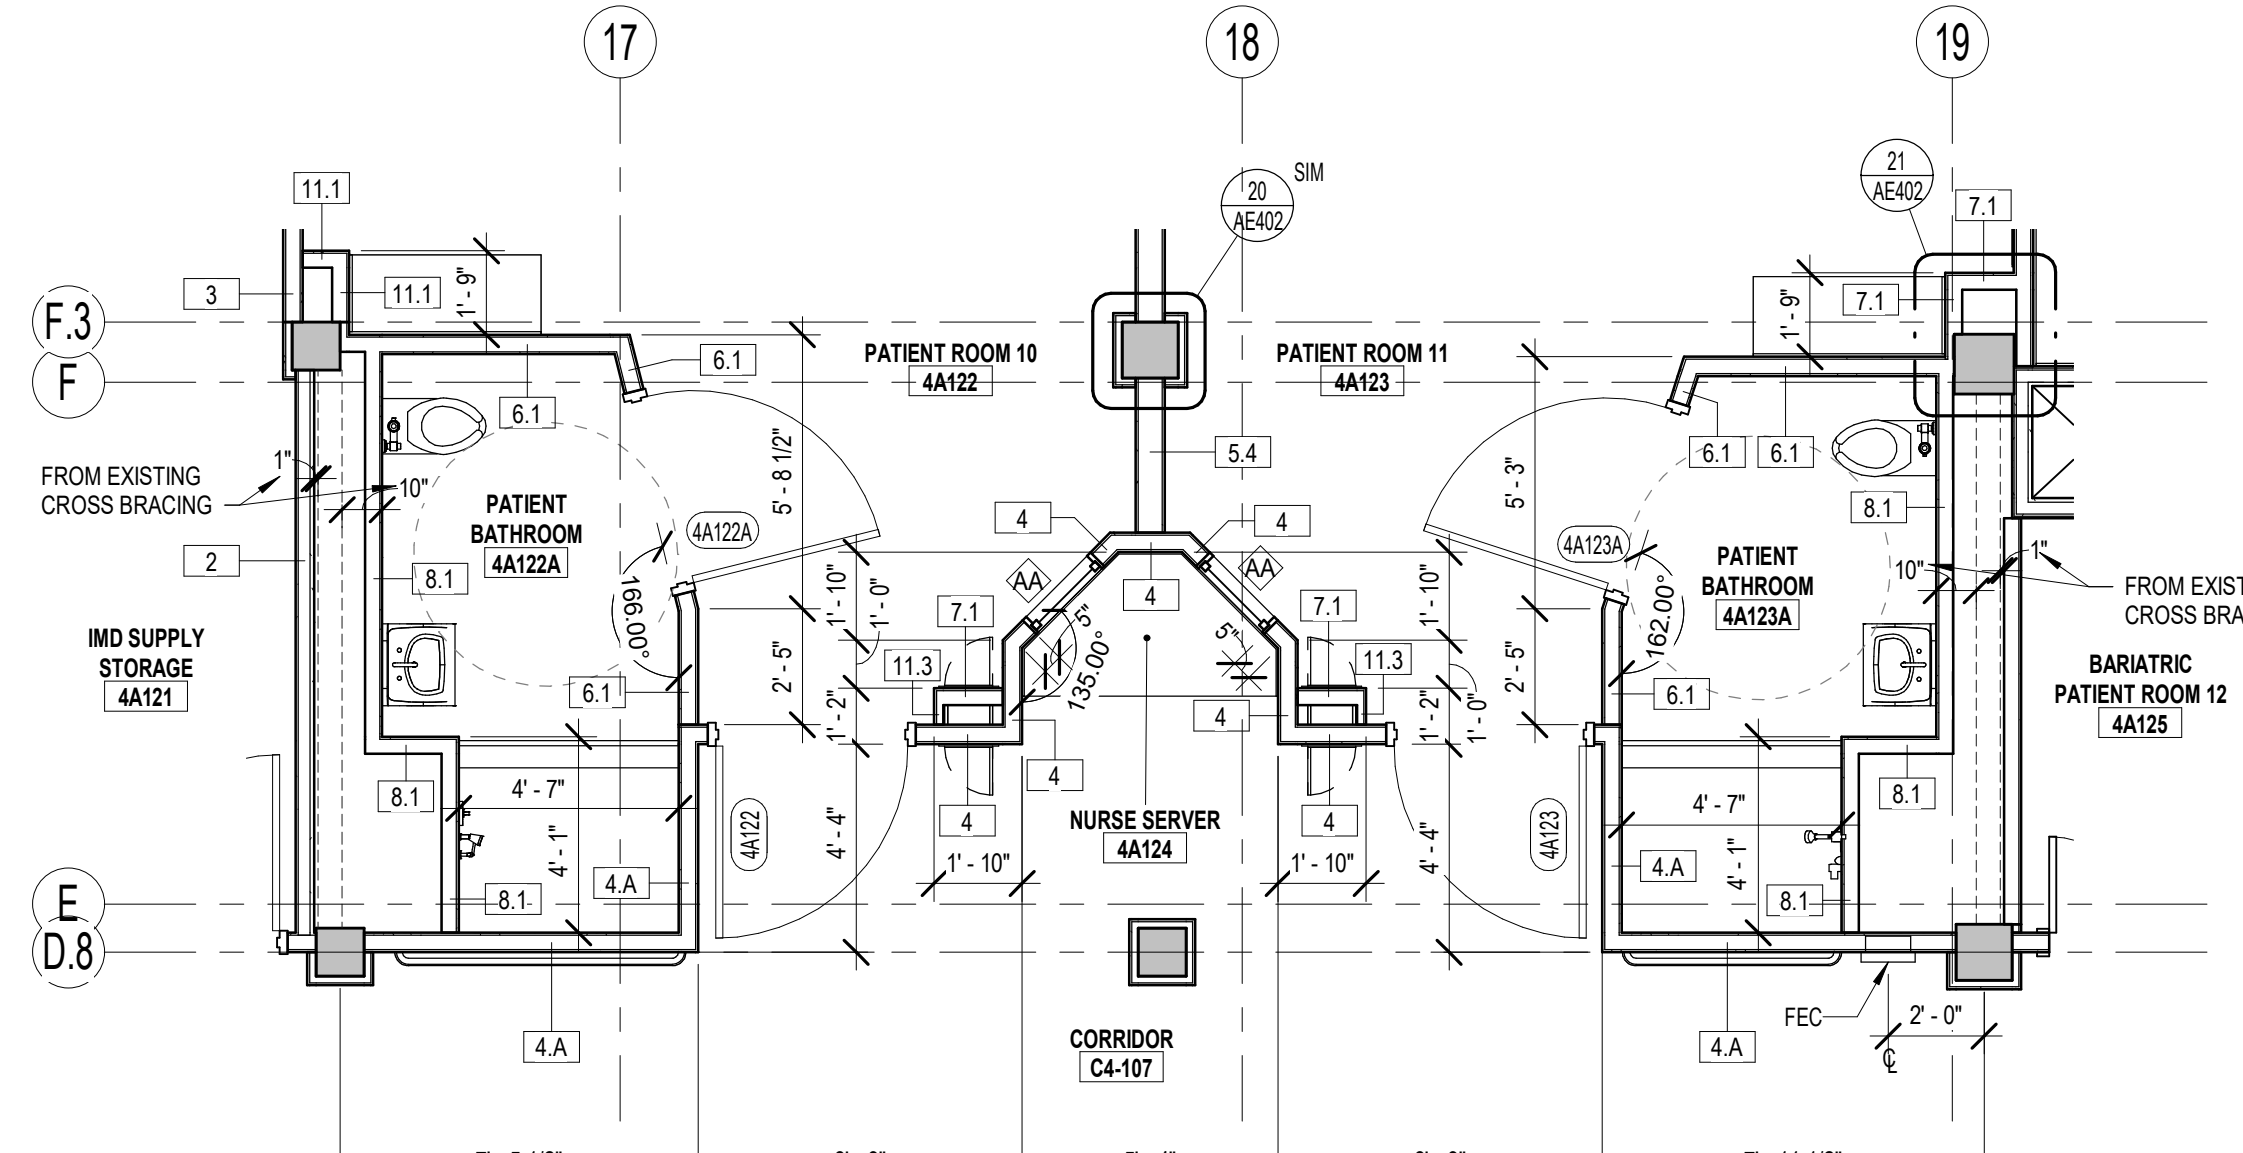


5 ENLARGED DIMENSION PLAN - 4A122A/4A123A
AE108.2 1/4" = 1'-0"

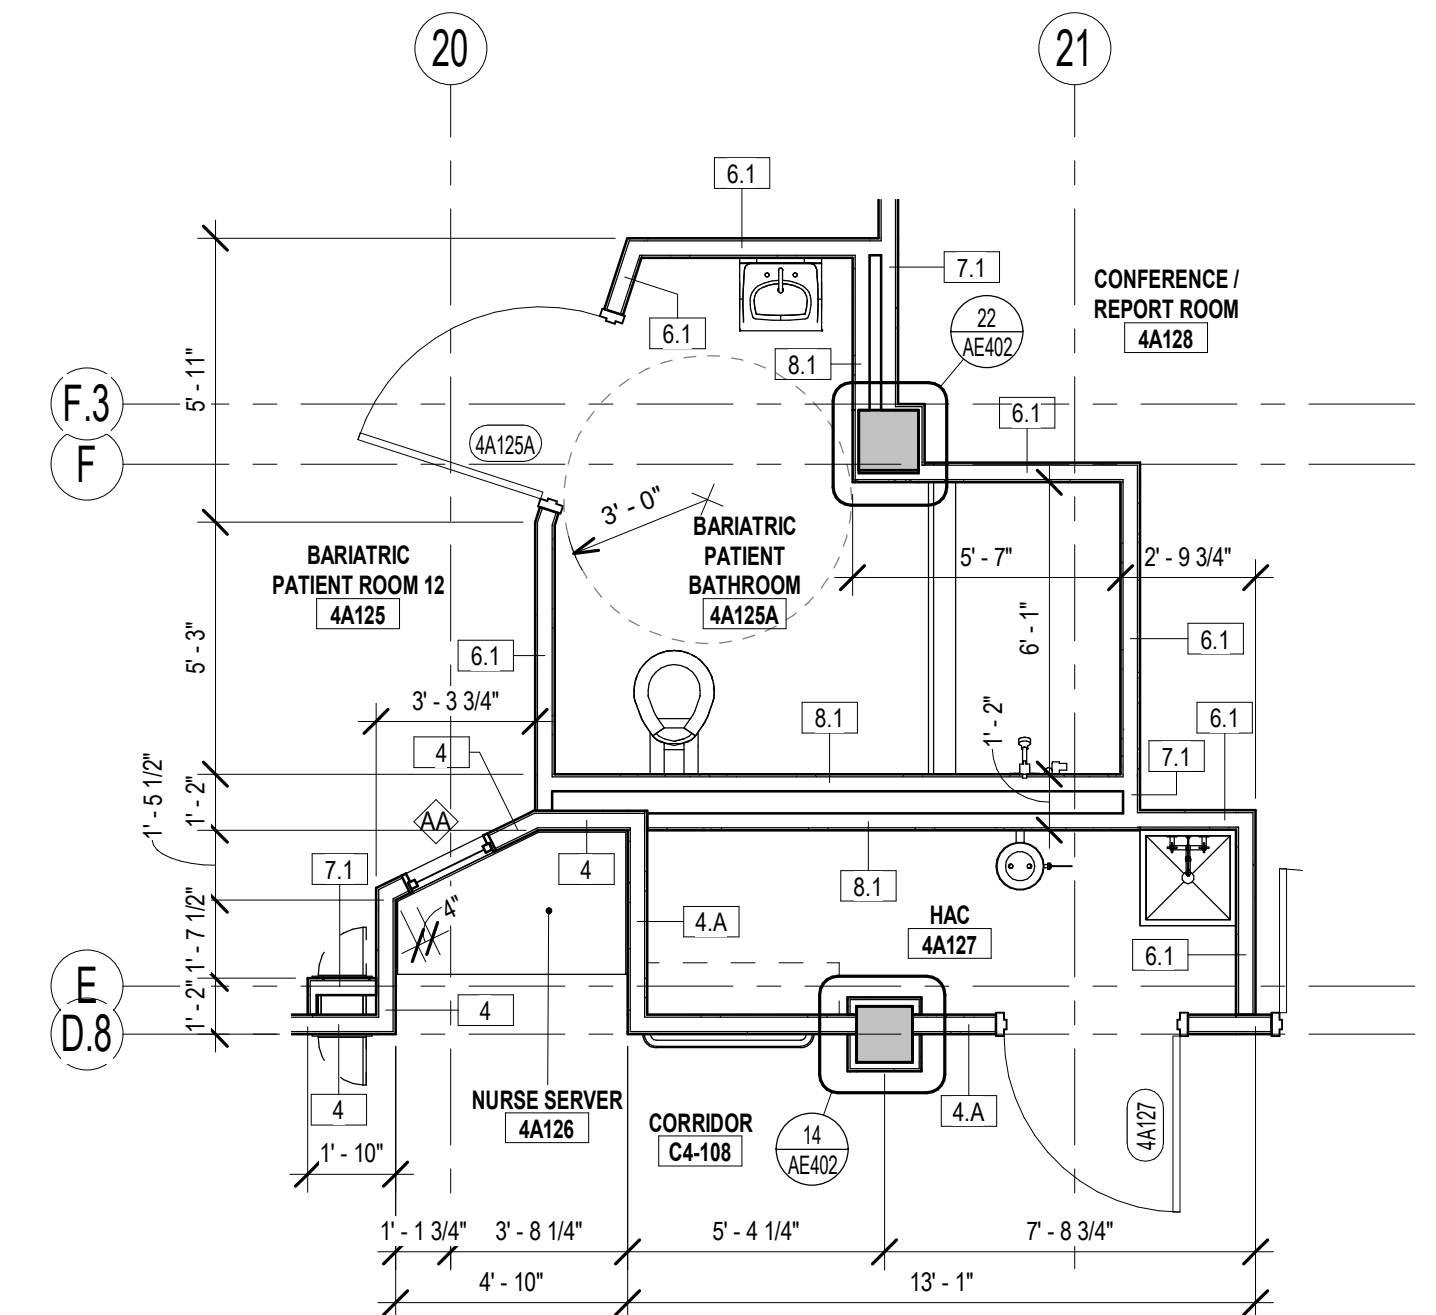


6 ENLARGED DIMENSION PLAN - 4A125A
AE108.2 1/4" = 1'-0"

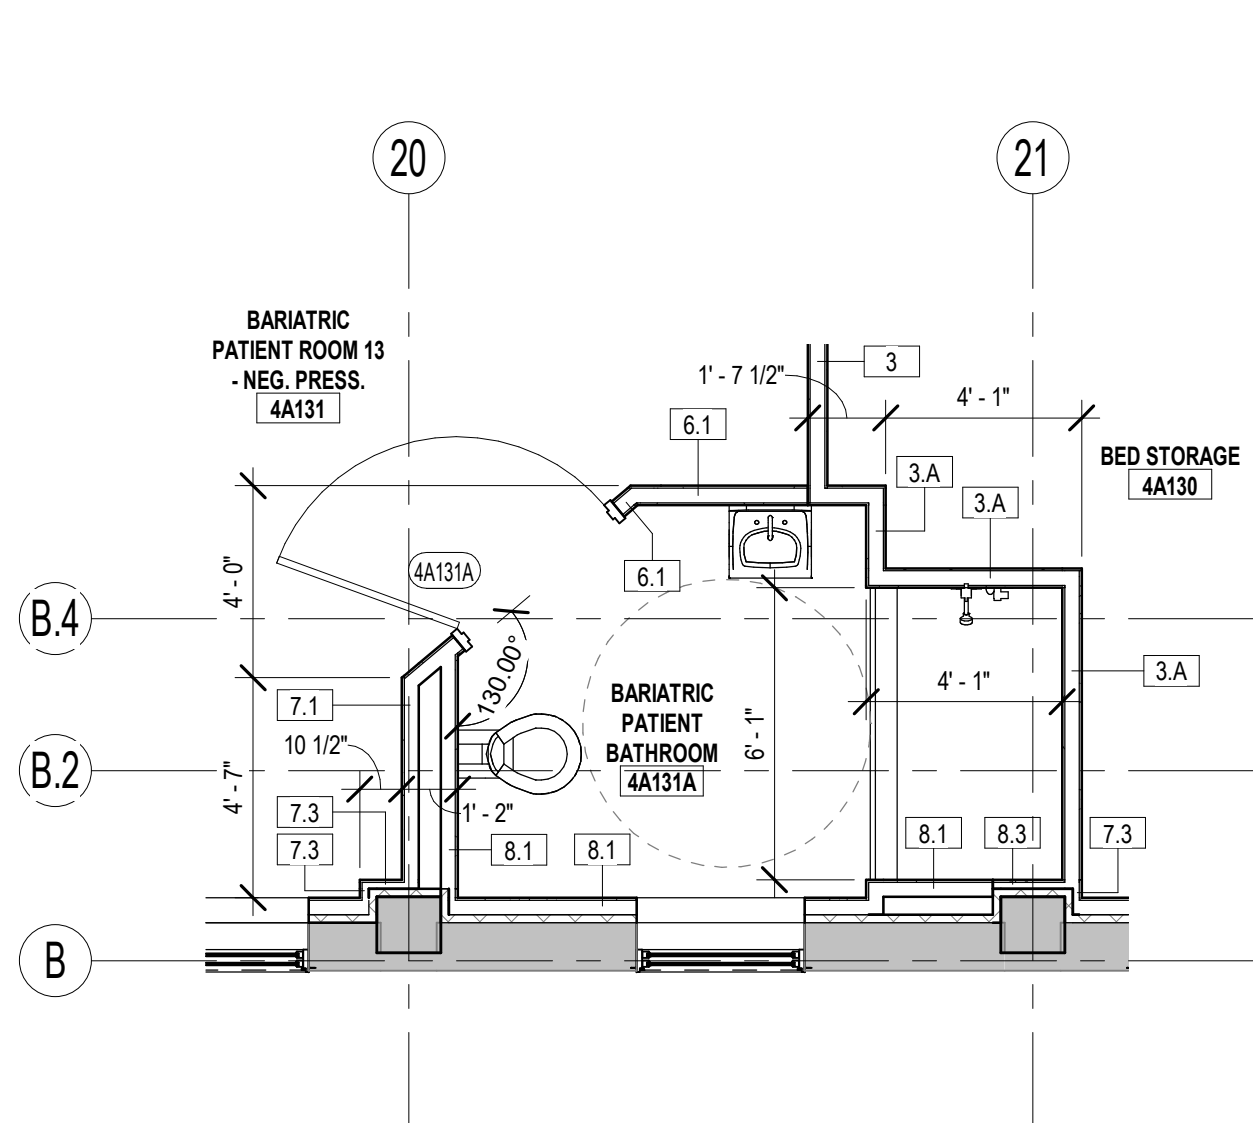


7 ENLARGED DIMENSION PLAN - 4A131A
AE108.2 1/4" = 1'-0"

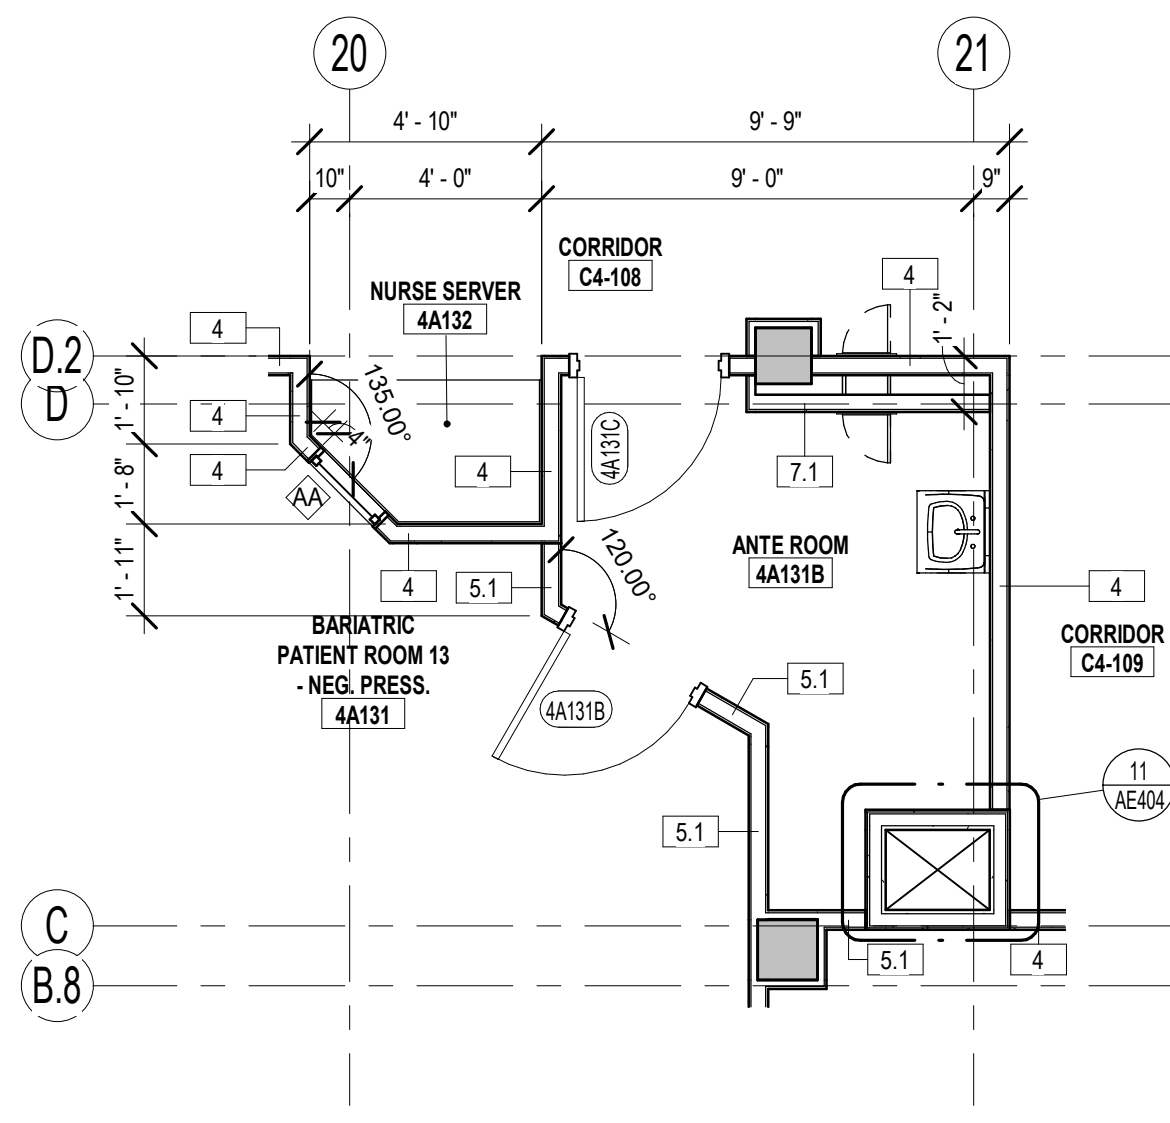

8 ENLARGED DIMENSION PLAN - 4A131B
AE108.2 1/4" = 1'-0"

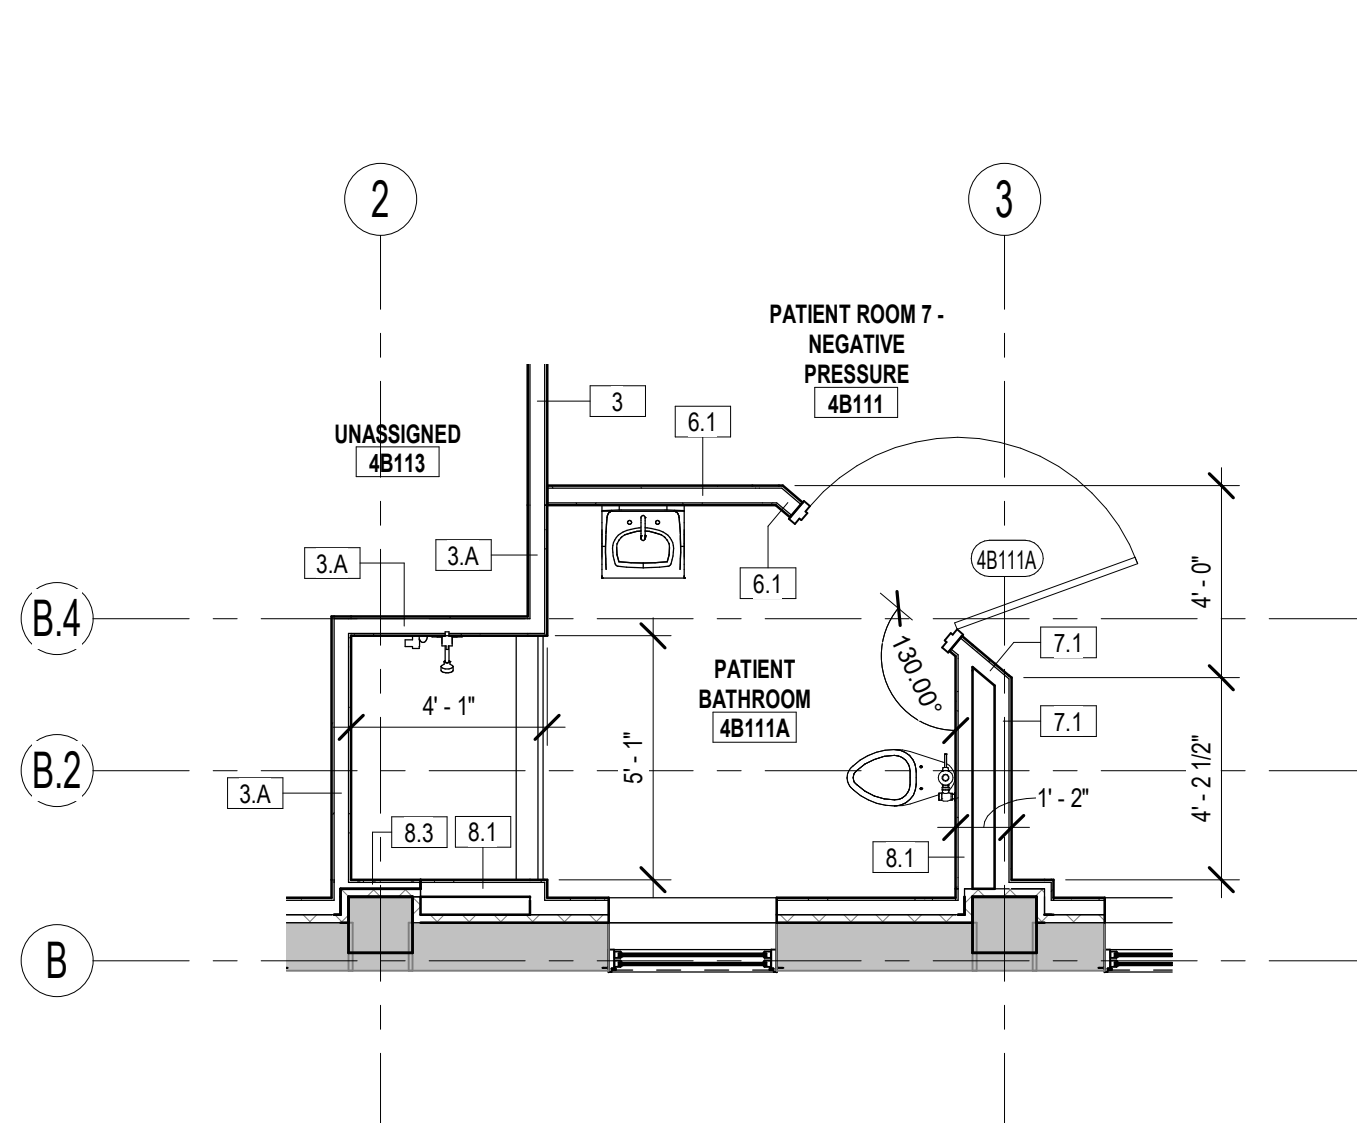

9 ENLARGED DIMENSION PLAN - 4B111A
AE108.2 1/4" = 1'-0"

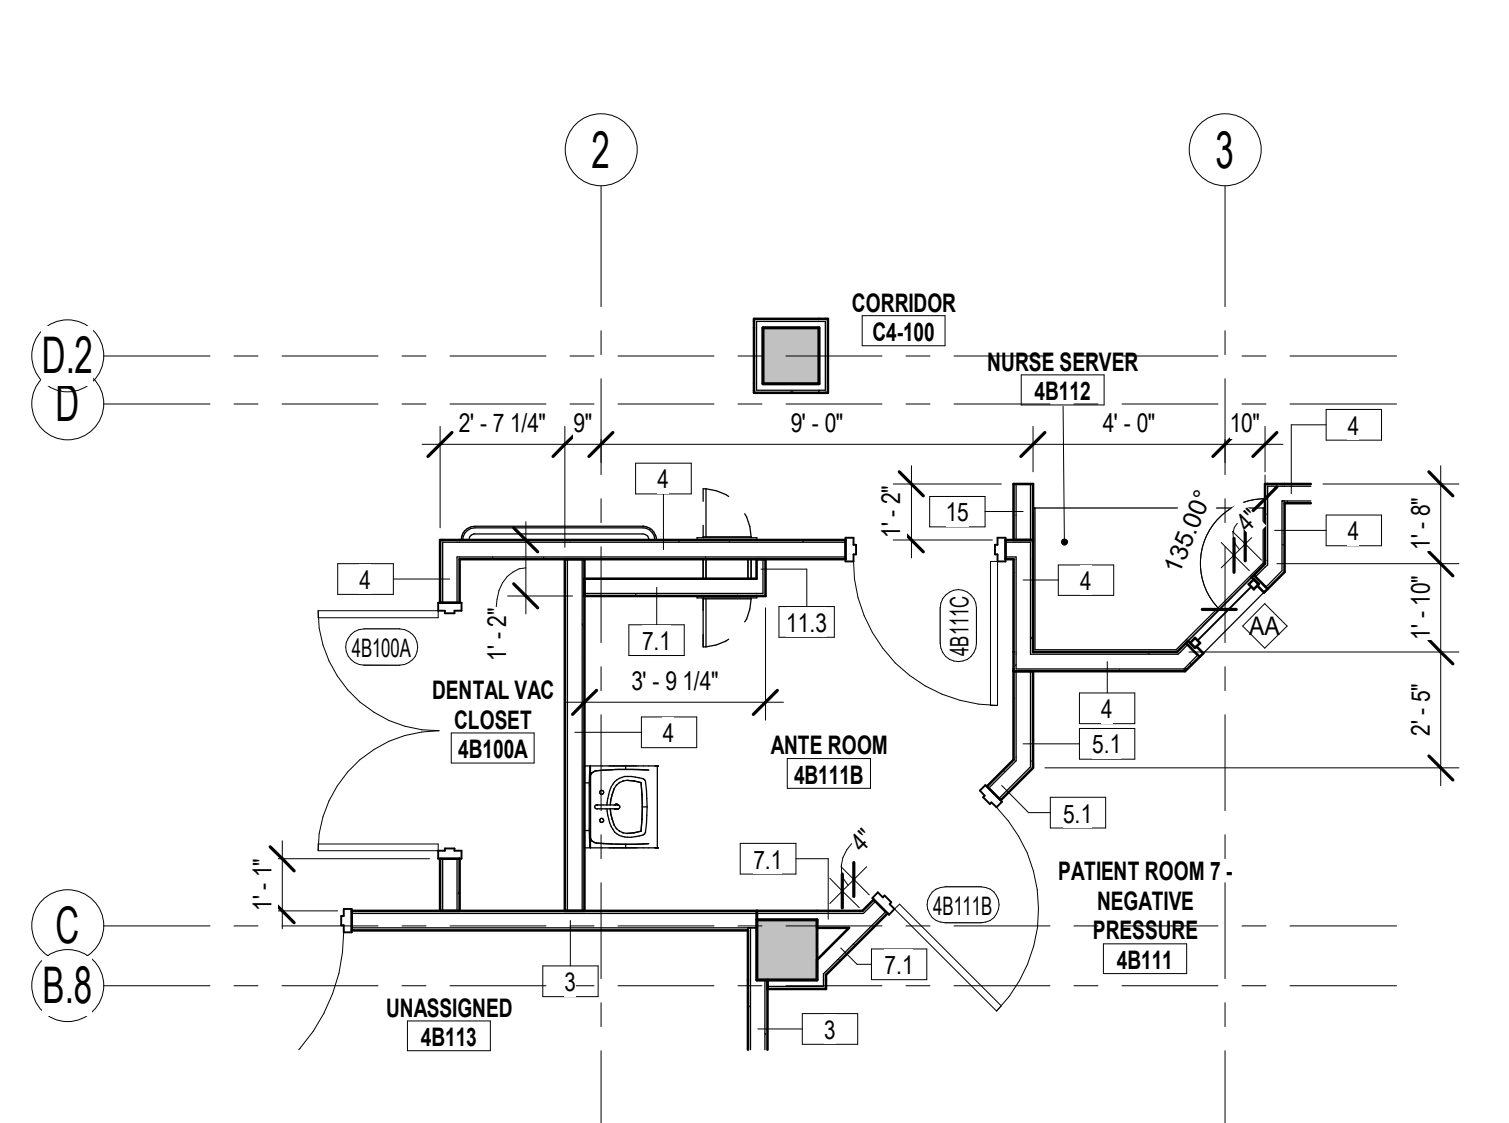

10 ENLARGED DIMENSION PLAN - 4B111B
AE108.2 1/4" = 1'-0"

NO.	REVISIONS	DATE

CONSULTANT

ARCHITECT/ENGINEER OF RECORD

THOMAS OLESAK, ARCHITECT
MS Lic # 5505

1050 HOYT AVE WEST ST PAUL, MN 55117
952-451-0460

STAMP



Office of
Construction
and Facilities
Management

VA

U.S. Department
of Veterans
Affairs

Drawing Title
4TH FLOOR ENLARGED DIMENSION
PLANS

Approved:

Phase
CONSTRUCTION
DOCUMENTS

FULLY SPRINKLERED

Project Title
RENOVATE BUILDING 1

Location
BILOXI, MISSISSIPPI

Issue Date
03/10/2023

Checked
Checker


Drawn
Author

Project Number
520-317X

Building Number
1

Drawing Number
AE108.2

Dwg. 70 of 238

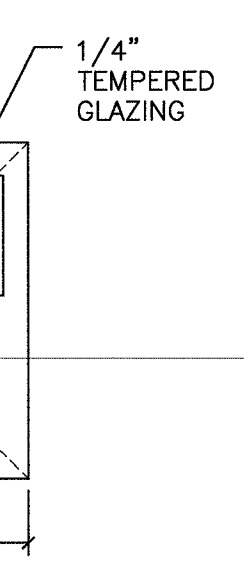


0"-0"

3'-0"


3
AE702

4
AE7

5
AE7

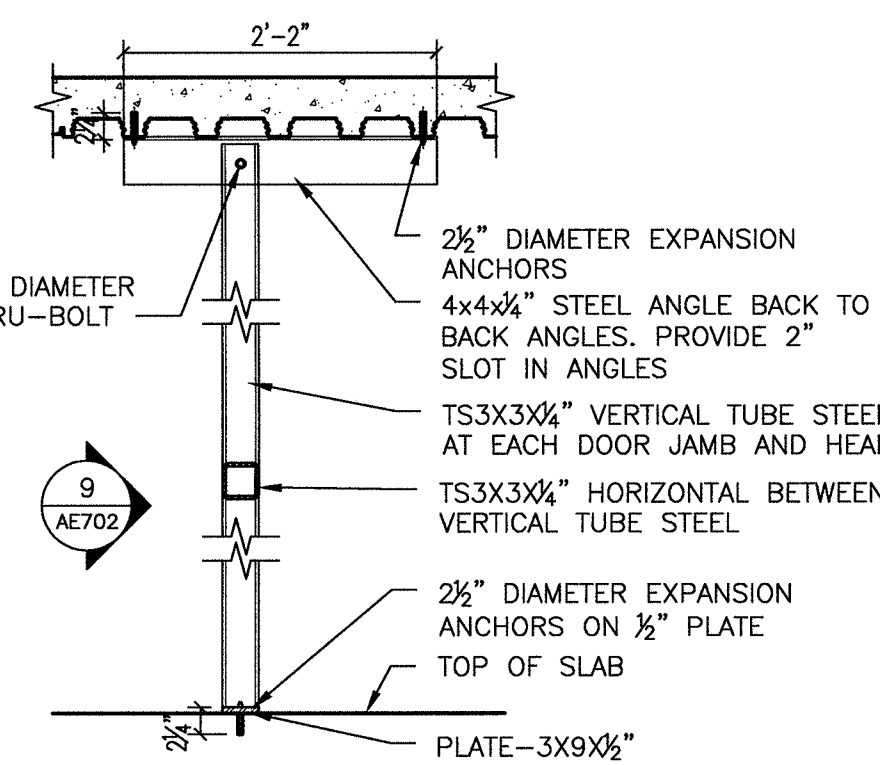

2 HOLLOW METAL DOOR JAMB DETAIL

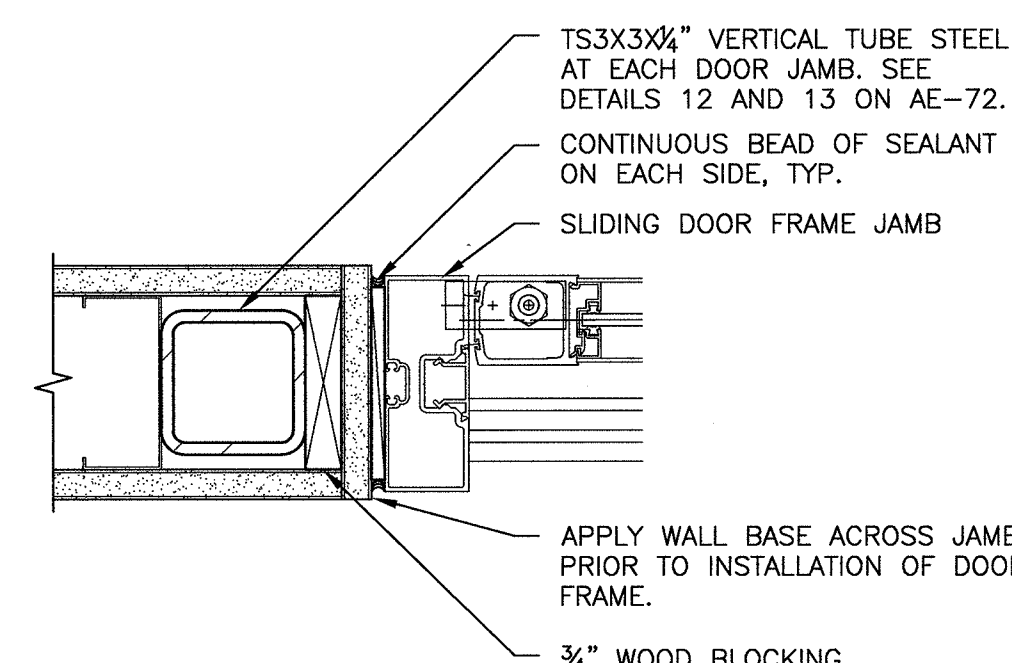

7 SLIDING DOOR JAMB DETAIL

5 HOLLOW METAL WINDOW SILL DETAIL

3 HOLLOW METAL WINDOW HEAD DETAIL
3" = 1'-0"

HOLLOW METAL DOOR HEAD DETAIL
3" = 1'-0"

A. ALL WOOD BLOCKING SHALL BE FIRE RETARDANT

AE702


FULLY SPRINKLERED


Approved: Project Director

VA U.S. Department
of Veterans Affairs


Architecture | Engineering | Design-Build
200 Envoy Circle, Suite 201, Louisville, KY 40299
www.paradigmusa.com

[illegible]

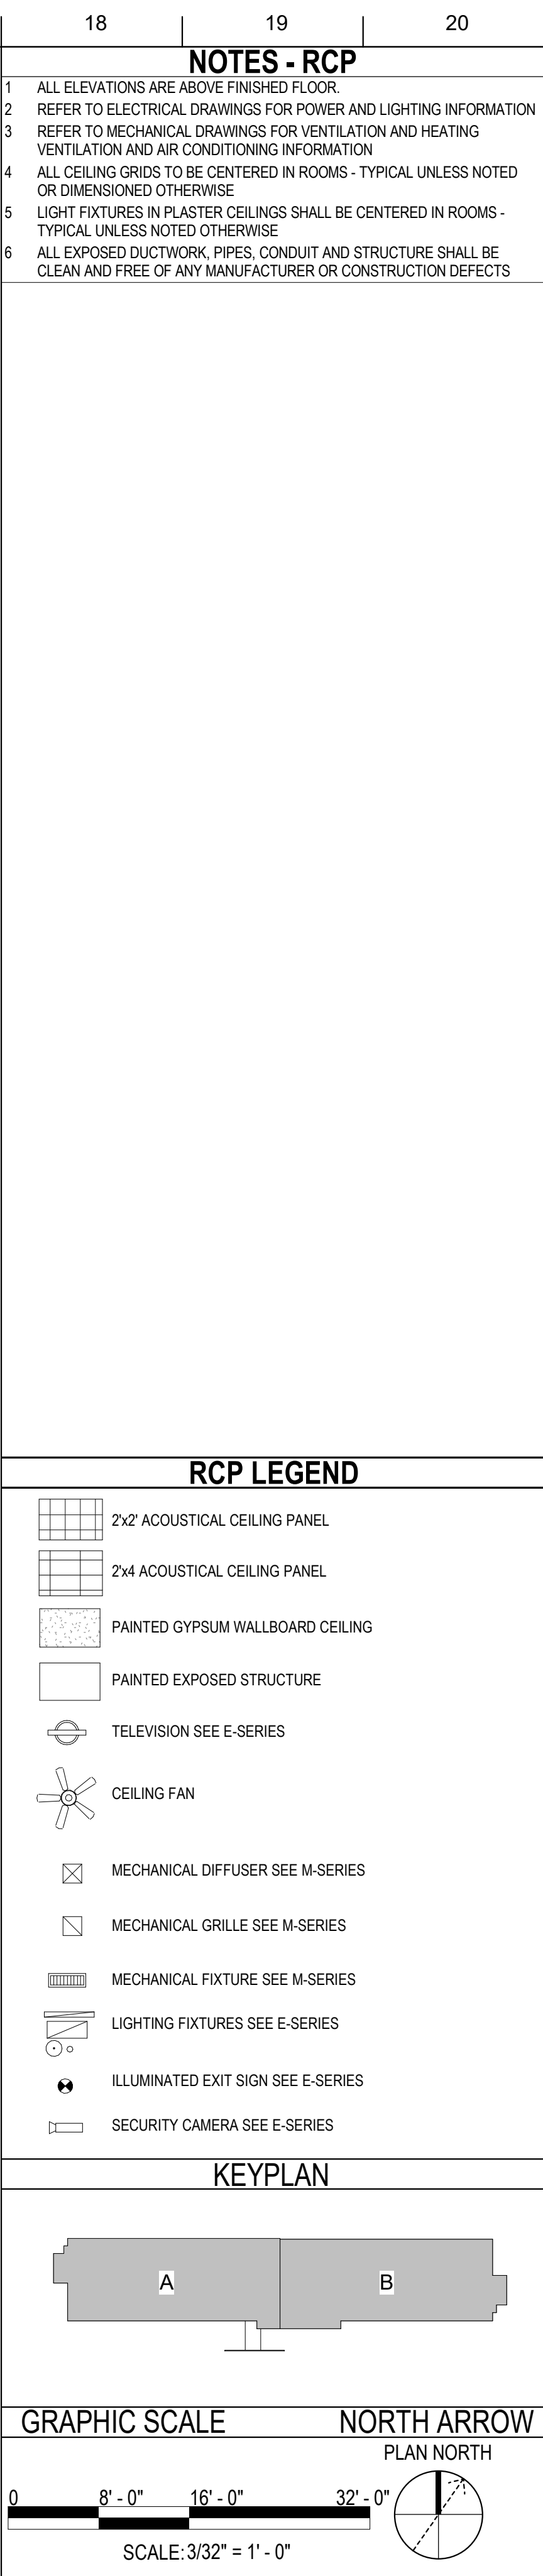
[illegible]

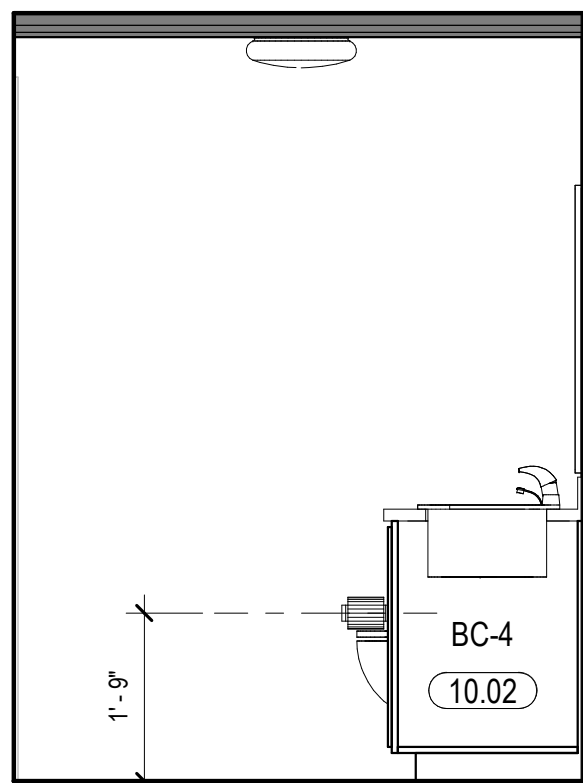


(K5) BATHROOM - RM 103 - INT EL 2
1/2" = 1'-0"

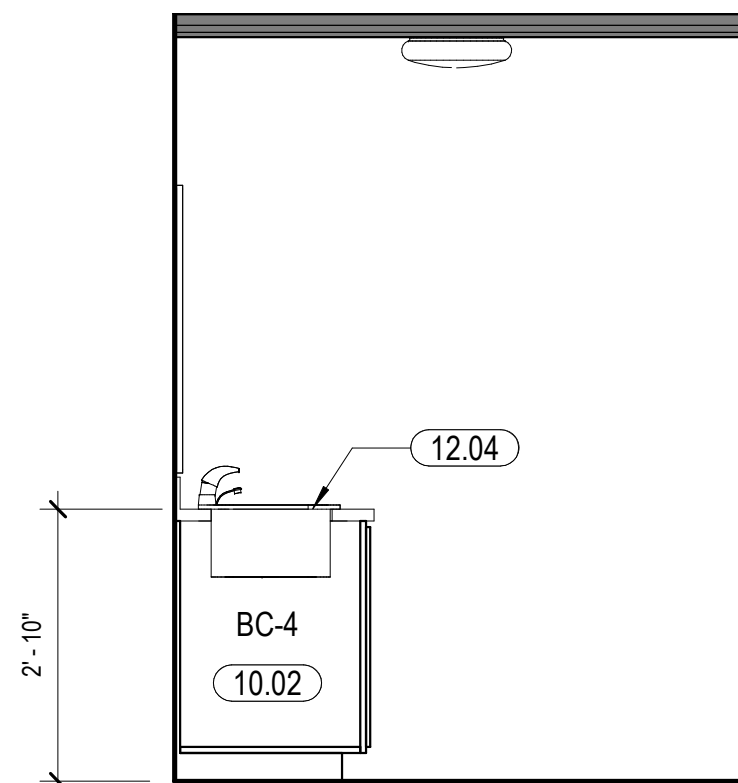

BATHROOM - RM 103 - INT EL 4
1/2" = 1'-0"

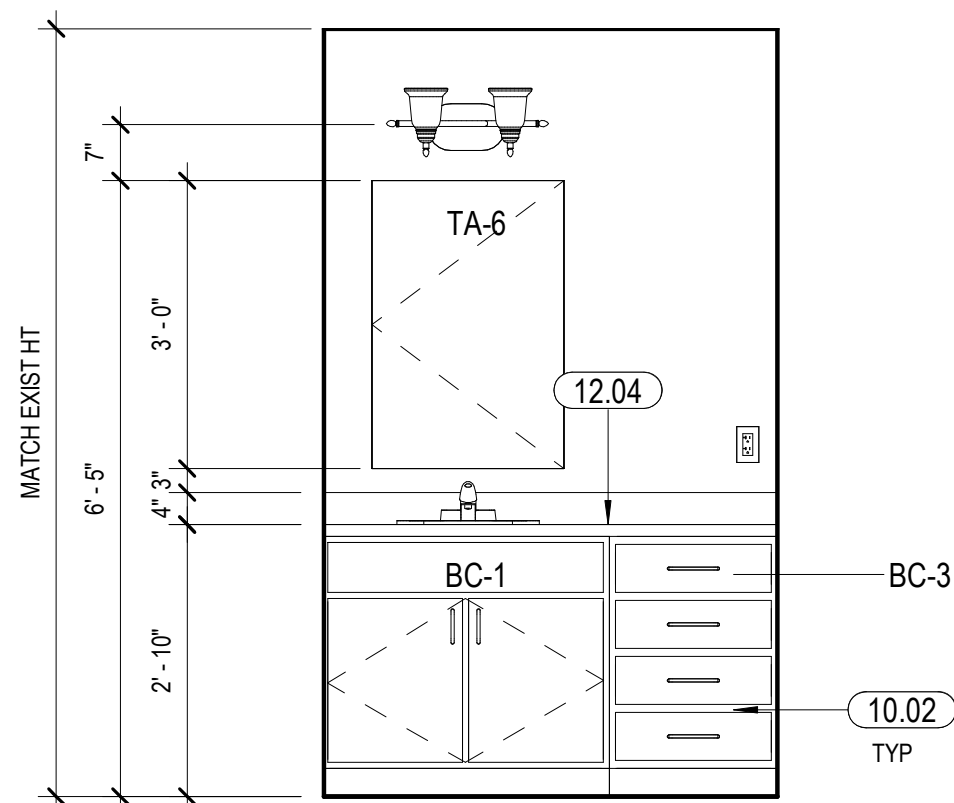

(E5) BEDROOM CASEWORK - INT EL 2
1/2" = 1'-0"

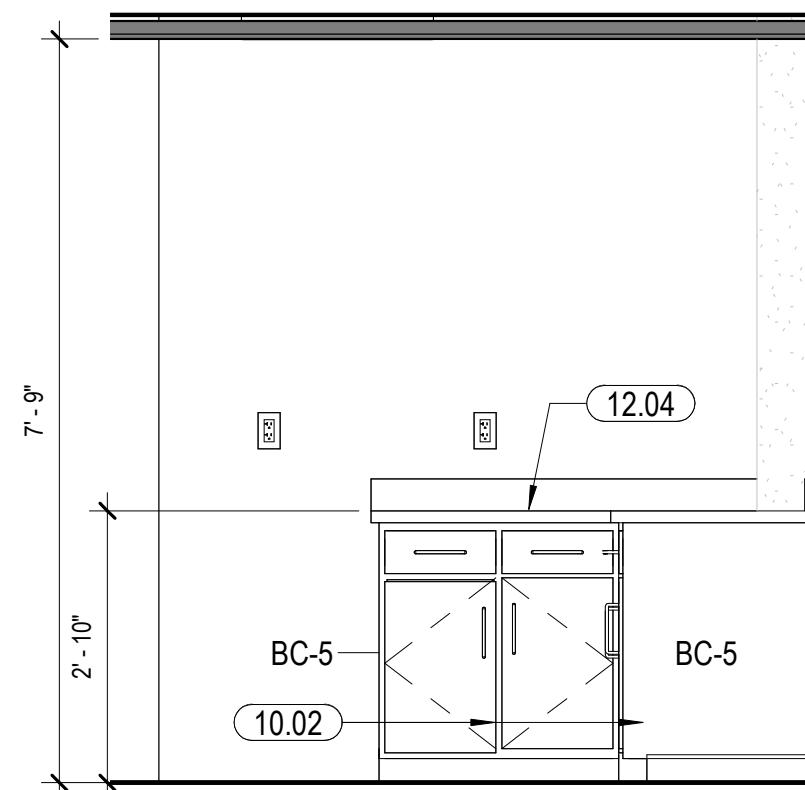


E13 LOUNGE/CAFE - INT EL 2
1/2" = 1'-0"




(A1) DAYROOM - INT EL 1
1/2" = 1'-0"

1. SEE INTERIORS FOR TILE PATTERN
2. REF SHEET A-002 FOR ACCESSORIES INSTALLATION HEIGHTS

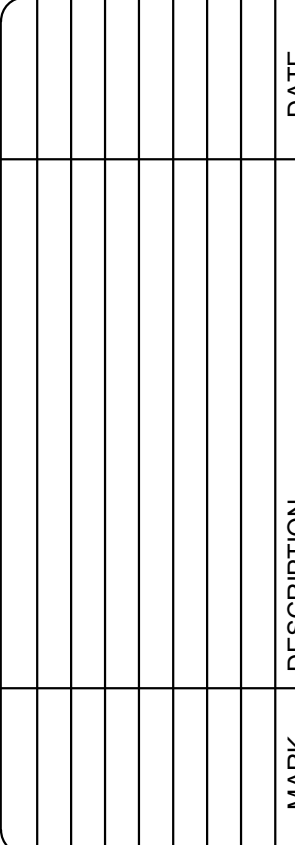

10.02	NEW PLASTIC LAMINATE CASEWORK, BASE AND WALL CABINETS. SEE INTERIORS
12.04	SOLID SURFACE COUNTER, SEE INTERIORS

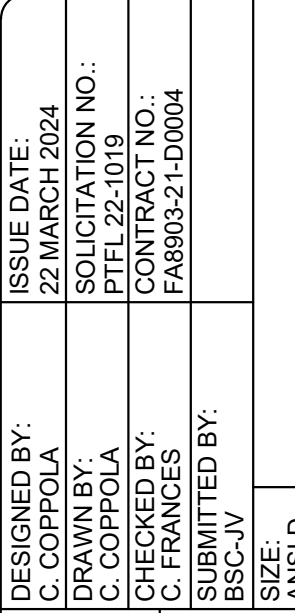

TA-1	SURFACE MOUNTED SINGLE ROLL TOILET TISSUE DISPENSER
TA-2	DOOR MOUNTED ROBE HOOK
TA-4	SURFACE MOUNTED CHANNEL FRAME MIRROR
TA-6	SURFACE MOUNTED MEDICINE CABINET WITH MIRROR

TA-1	SURFACE MOUNTED SINGLE ROLL TOILET TISSUE DISPENSER
TA-2	DOOR MOUNTED ROBE HOOK
TA-4	SURFACE MOUNTED CHANNEL FRAME MIRROR
TA-6	SURFACE MOUNTED MEDICINE CABINET WITH MIRROR

US AIR FORCE CIVIL ENGINEER CENTER
MCCUIRE AFB
LAKEHURST, NEW JERSEY

DESIGNED BY: C. COPPOLA
DRAWN BY: C. COPPOLA
CHECKED BY: C. FRANCES
SUBMITTED BY: BSC-JV
SIZE:

Baker • Stanley • Cardno • Joint Venture

VANDEBEEK
INTERNATIONAL


 **Cardno**
Strong Connections
Full Service Design & Construction


MC GUIRE AFB, NEW JERSEY
RENOVATION OF DORMITORY BUILDING 2619

INTERIOR ELEVATIONS

SHEET ID

A-411

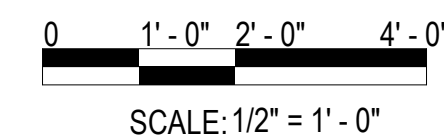

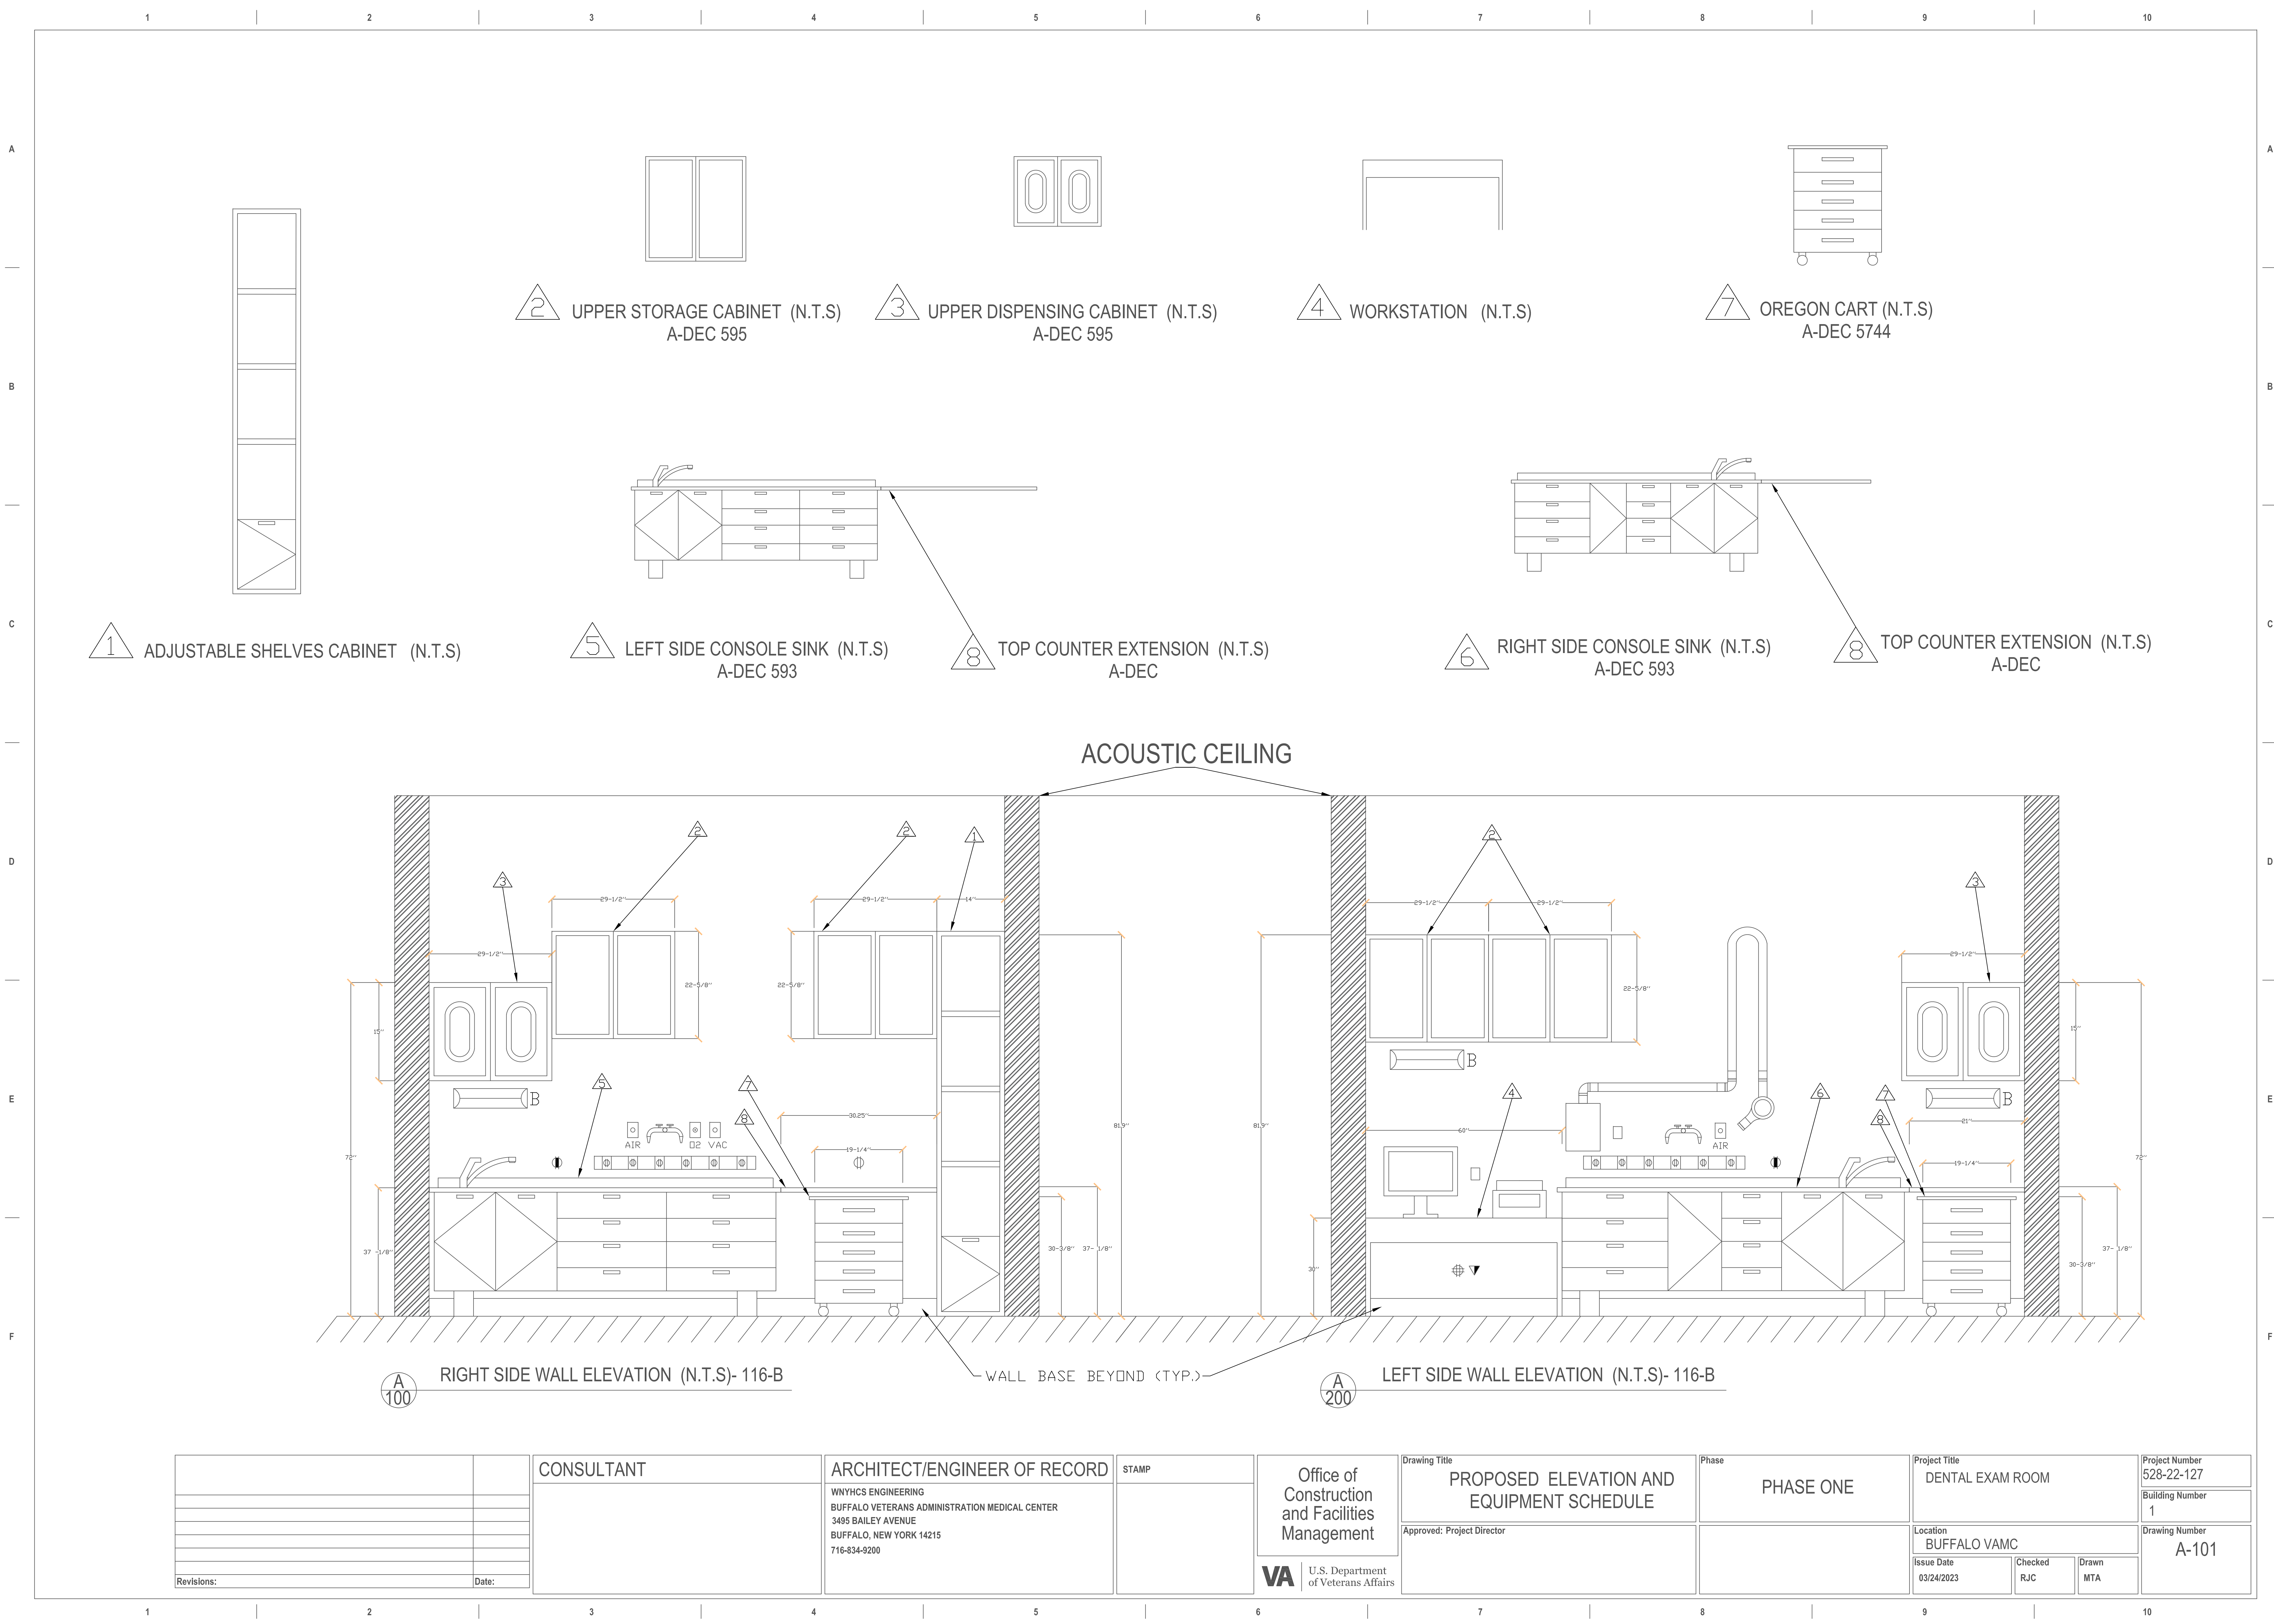

		CONSULTANT	ARCHITECT/ENGINEER OF RECORD	STAMP	Office of Construction and Facilities Management VA U.S. Department of Veterans Affairs	Drawing Title	Phase	Project Title	Project Number
						PROPOSED ELEVATION AND EQUIPMENT SCHEDULE	PHASE ONE	DENTAL EXAM ROOM	528-22-127
						Approved: Project Director		Location	Building Number
								BUFFALO VAMC	1
								Issue Date	Checked
						03/24/2023	RJC	MTA	Drawing Number
									A-101
Revisions:	Date:								

KEY NOTES:

- 1 FURNISH AND INSTALL NEW STAINLESS STEEL GAS OUTLETS COVER PLATE,WITH MANUFACTURED GAS LABEL REFER TO DETAIL P/M 400 AND THE EQUIPMENT SCHEDULE ON SHEET P/M-102 FOR MORE INFO.
- 2 FURNISH AND INSTALL DOUBLE NEEDLE VALVE, REFER TO DETAIL P/M 500 AND THE EQUIPMENT SCHEDULE ON SHEET P/M-102 FOR MORE INFO.
- 3 REINSTALL THE THERMOSTAT AND ALL ASSOCIATED PARTS, FURNISH AND INSTALL NEW WIRE MOLD MODEL LEGRAND 400 SERIES OF APPROVED EQUAL, CONTRACTOR IS RESPONSIBLE FOR FINAL CONNECTION AND TESTING, REFER TO DETAIL P/M 300 AND THE EQUIPMENT SCHEDULE ON SHEET P/M-102 FOR MORE INFO.
- 4 FURNISH AND INSTALL NEW SPRINKLER HEAD QUICK RESPONSE, CONTRACTOR IS RESPONSIBLE FOR FINAL TESTING, REFER TO DETAIL P/M 400 AND THE EQUIPMENT SCHEDULE ON SHEET P/M-102 FOR MORE INFO, ALSO THE CONTRACTOR SHALL COORDINATE WITH THE VA ENGINEER FOR ANY SHUTDOWN 30 DAYS IN ADVANCE.
- 5 FURNISH AND INSTALL NEW SUPPLY/RETURN DIRECTIONAL PATTERN DIFFUSER AND ALL ASSOCIATED PARTS AND INSULATION, REFER TO THE EQUIPMENT SCHEDULE ON SHEET P/M-102 FOR MORE INFO.
- 6 CONTRACTOR IS RESPONSIBLE FOR ALL THE PLUMBING WORK AND ALL ASSOCIATED PARTS FOR A COMPLETE AND OPERATIONAL SINK INSTALLATION, REFER TO DETAIL P/M 500 ON SHEET P/M-102 FOR MORE INFO, ALSO CONTRACTOR IS RESPONSIBLE TO COORDINATE PLUMBING SHUTDOWNS WITH VA ENGINEER 30 DAYS IN ADVANCE.
- 7 CONTRACTOR IS RESPONSIBLE TO INSTALL RADIATOR COVER SUPPLIED BY VA, ALSO CONTRACTOR IS RESPONSIBLE FOR ALL ASSOCIATED PARTS AND HARDWARE AND SHALL USE STAINLESS STEEL FASTENERS FOR FULL INSTALLATION, REFER TO DETAIL P/M 600 AND THE EQUIPMENT SCHEDULE ON SHEET P/M-102 FOR ADDITIONAL INFO.
- 8 CONTRACTOR IS RESPONSIBLE EXTEND/REROUTE THE MED AIR LINE, VAC LINE, SEWER LINE AND ALL OTHER LINES AS NECESSARY TO EXACT LOCATION OF PATENT CHAIR, ALSO CONTRACTOR IS RESPONSIBLE FOR FINAL CONNECTION AND TESTING OF ALL THE LINES, LAST THE CONTRACTOR IS RESPONSIBLE TO COORDINATE WITH VA ENGINEER AND THE EQUIPMENT VENDOR PRIOR THE FINAL CONNECTION, REFER TO DETAIL P/M 600 ON P/M-102 FOR ADDITIONAL INFO.
- 9 FURNISH AND INSTALL TEMPERATURE/HUMIDITY MONITOR SYSTEM ENVIRO TECHNOLOGIES MODEL ENVIRO DPMS-LCD-ETH. CONTRACTOR IS RESPONSIBLE FOR ALL ASSOCIATED PARTS AND FINAL CONNECTION OF THE SYSTEM, REFER TO DETAIL P/M 700 ON SHEET P/M-102 FOR MORE INFO.

SPECIAL NOTE:

ANY PLUMBING/HVAC SHUTDOWN REQUIRED TO COMPLETE WORK SHALL BE COORDINATED WITH THE VA A MINIMUM OF 30 DAYS IN ADVANCE OF THE SHUTDOWN AND SHALL BE PERFORMED AFTER NORMAL WORKS HOURS "7:00AM-5:00PM".



THE CONTRACTOR SHALL BE RESPONSIBLE TO ADJUST THE HVAC SYSTEM FOR EACH ROOM BASED ON THE DATA SHEET ON THIS DRAWING, ALSO THE CONTRACTOR IS RESPONSIBLE TO SUBMIT A REPORT TO THE VA ENGINEER FOR REVIEW AND APPROVAL AFTER THE HVAC IS FULLY ADJUSTED.

DENTAL CLINIC - ROOM DATA SHEET																				
ROOM NAME	INDOOR TEMPERATURE				INDOOR RELATIVE HUMIDITY				MIN TOTAL ACH	MIN OA ACH	ROOM AIR RETURN EXHAUST G		MAX NOISE LEVEL NC	ROOM AIR BALANCE	INDIVIDUAL ROOM CONTROL					
	COOLING		HEATING		% RH		% RH				EXHAUST S				TEMP	FLOW				
	F	C	F	C	MAX	MIN	MAX	MIN												
	Dental Suite																			
DNXS1: X-Ray Panoramic / Cephalometric	75	24	70	21	60	30	6	2	Return	35	(o)	Yes	VAV							
DNXC1: Cone Beam Computerized Tomography	75	24	70	21	60	30	6	2	Return	35	(o)	Yes	VAV							
DNXC2: Cone Beam Computerized Tomography Control Room	75	24	70	21	60	30	6	2	Return	35	(o)	Yes	VAV							
Note 1 - General Coordinate equipment heat gain with the manufacturer and evaluate resultant conditions. Remove heat by practical, available means. Adjust required temperature and humidity to match manufacturer's requirements.																				
DNFTG1: Multi-Functional Dental Treatment Room	75	24	70	21	60	30	6	2	Return	40	(+)	Yes	VAV							
DNFTG5: Special Needs Patient Dental Treatment Room	75	24	70	21	60	30	6	2	Return	40	(o)	Yes	VAV							
DNFTS1 Minor Procedure Room Oral Surgery	75	24	70	21	60	30	15	3	Return	35	(+)	Yes	CV							

PROPOSED HVAC FOR ROOM 116-B

DNSS3: Sterile Instrument Storage	66	19	72	22	55	30	4	4	Return	40	(+)	Yes	CV
MECH1 Dental Equipment Mechanical Room	80	27	65	18	N/A	N/A	N/A	N/A	Exhaust (o)	40	(-)	No	VAV/CO
Note 1 - General Coordinate equipment heat gain with the manufacturer and evaluate resultant conditions. Remove heat by practical, available means.													

PROPOSED HVAC FOR ROOM 136-B, 137-B

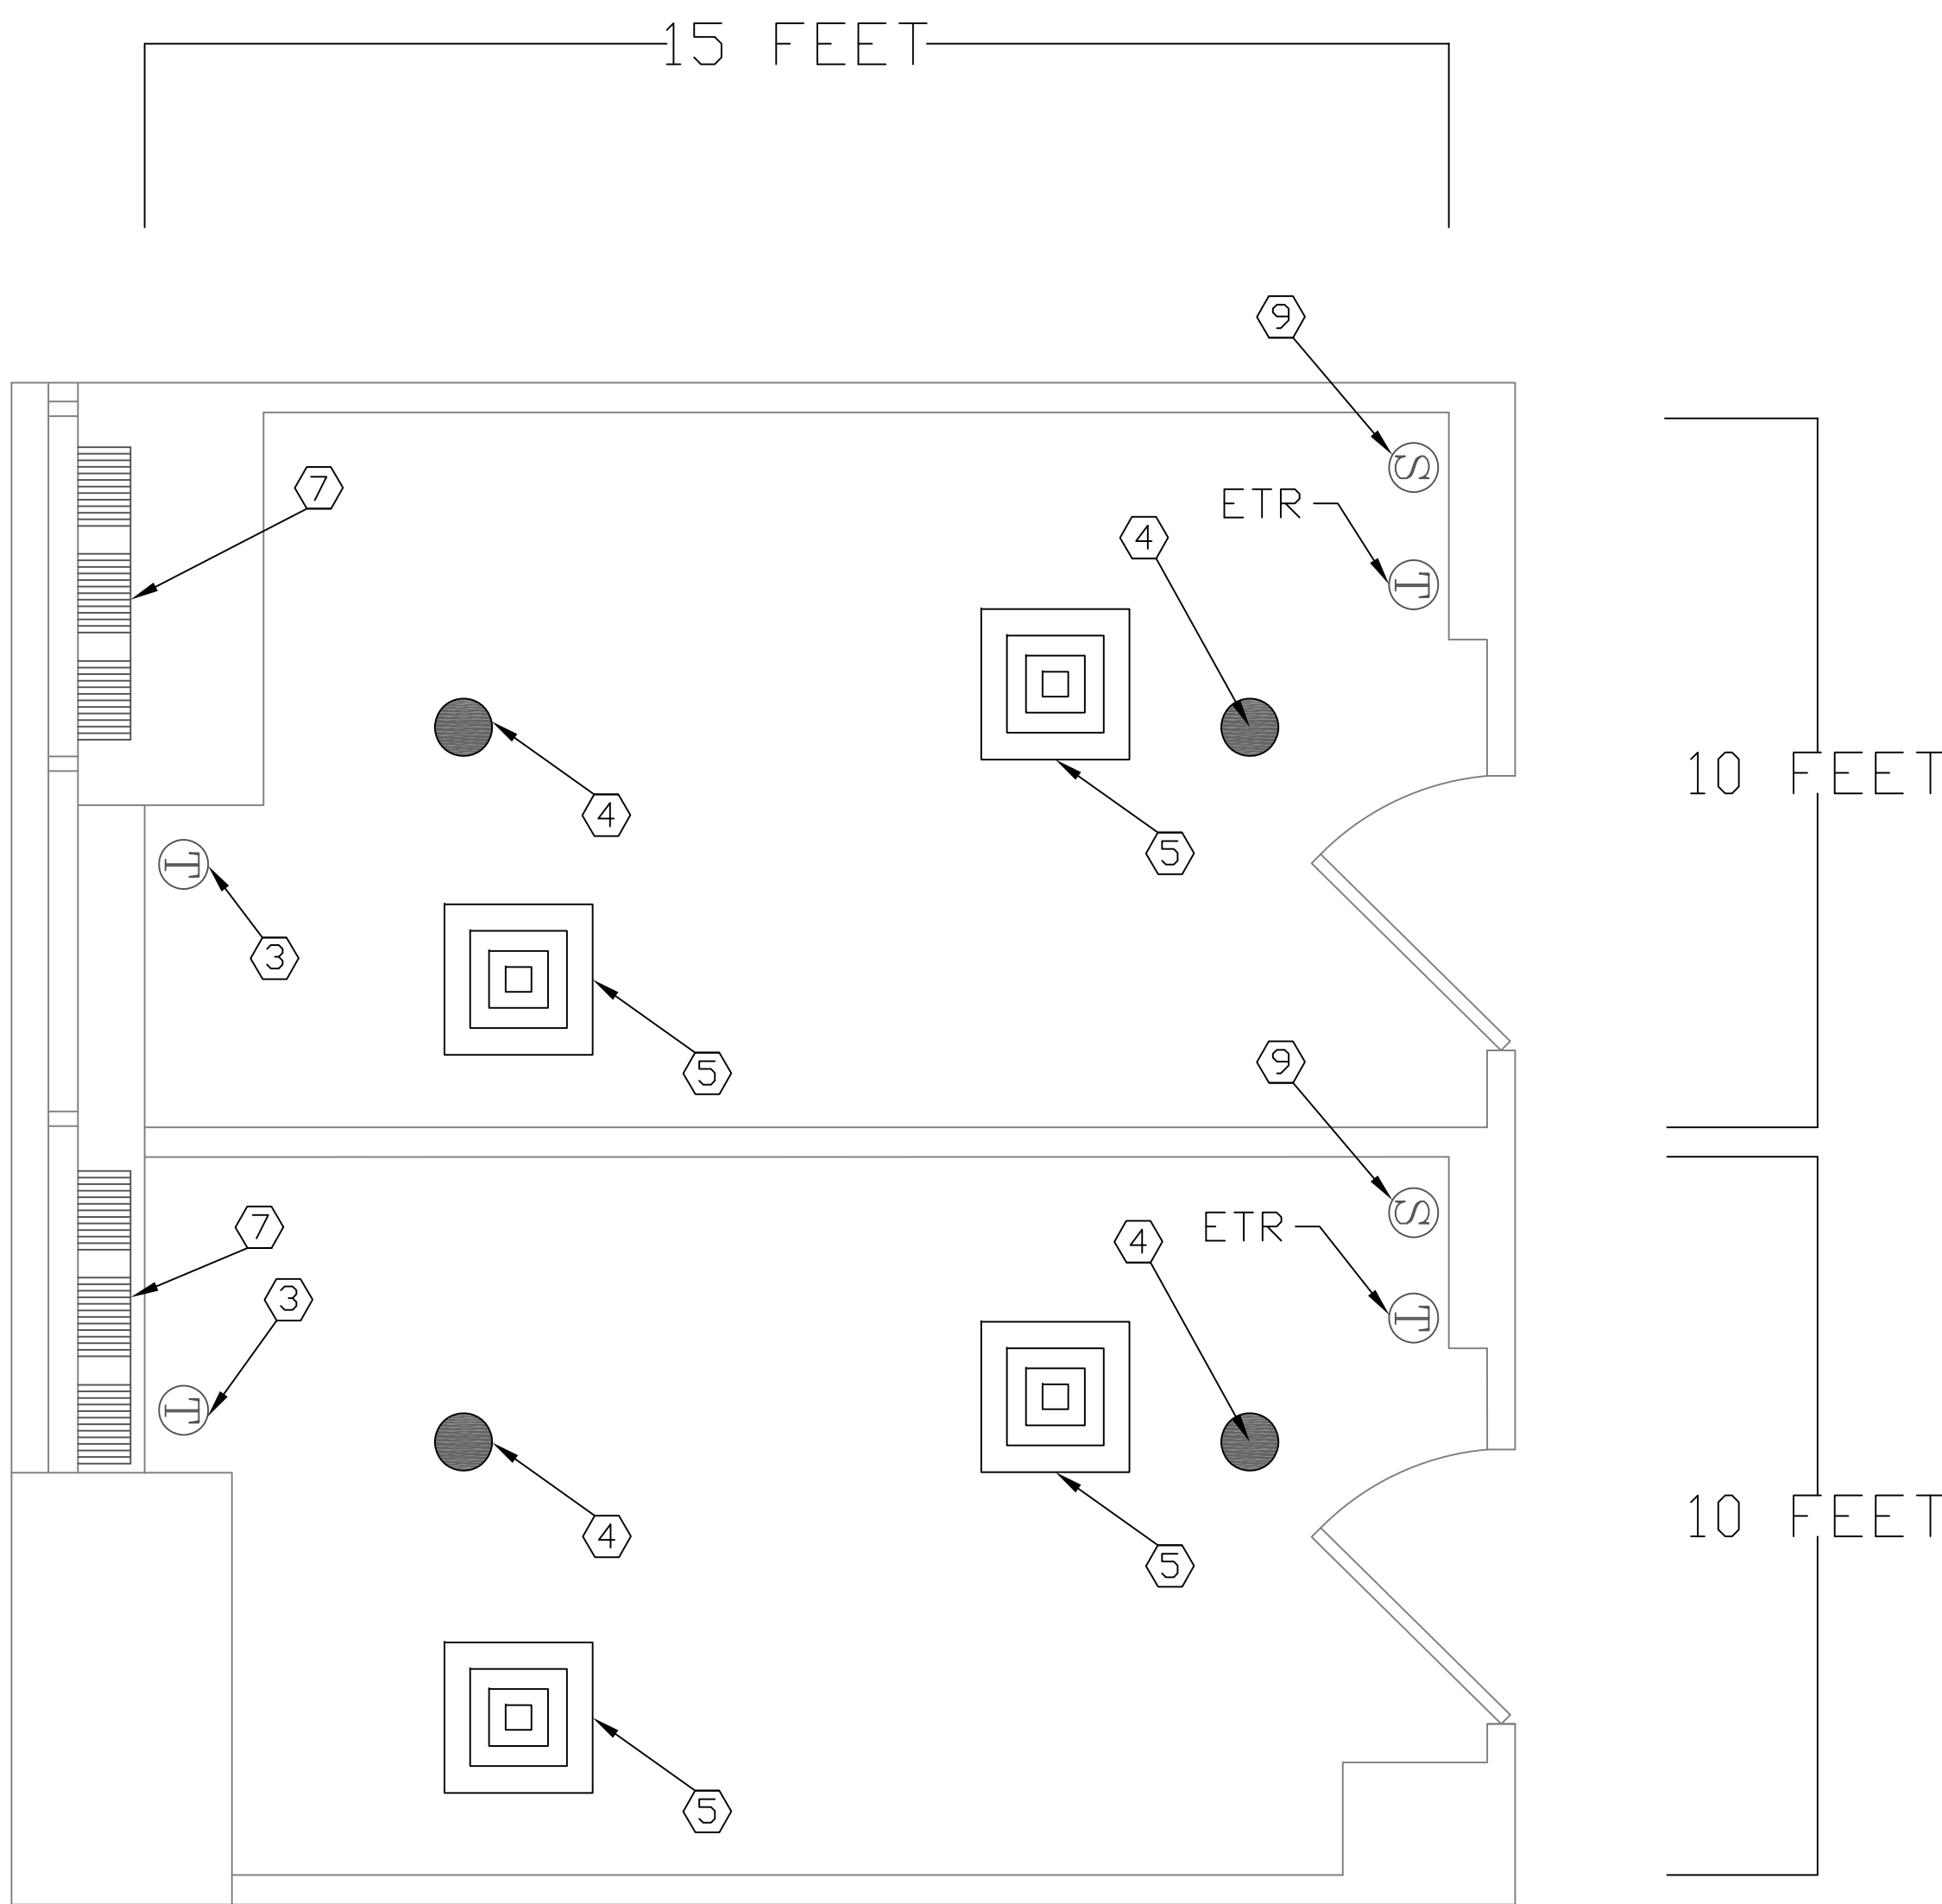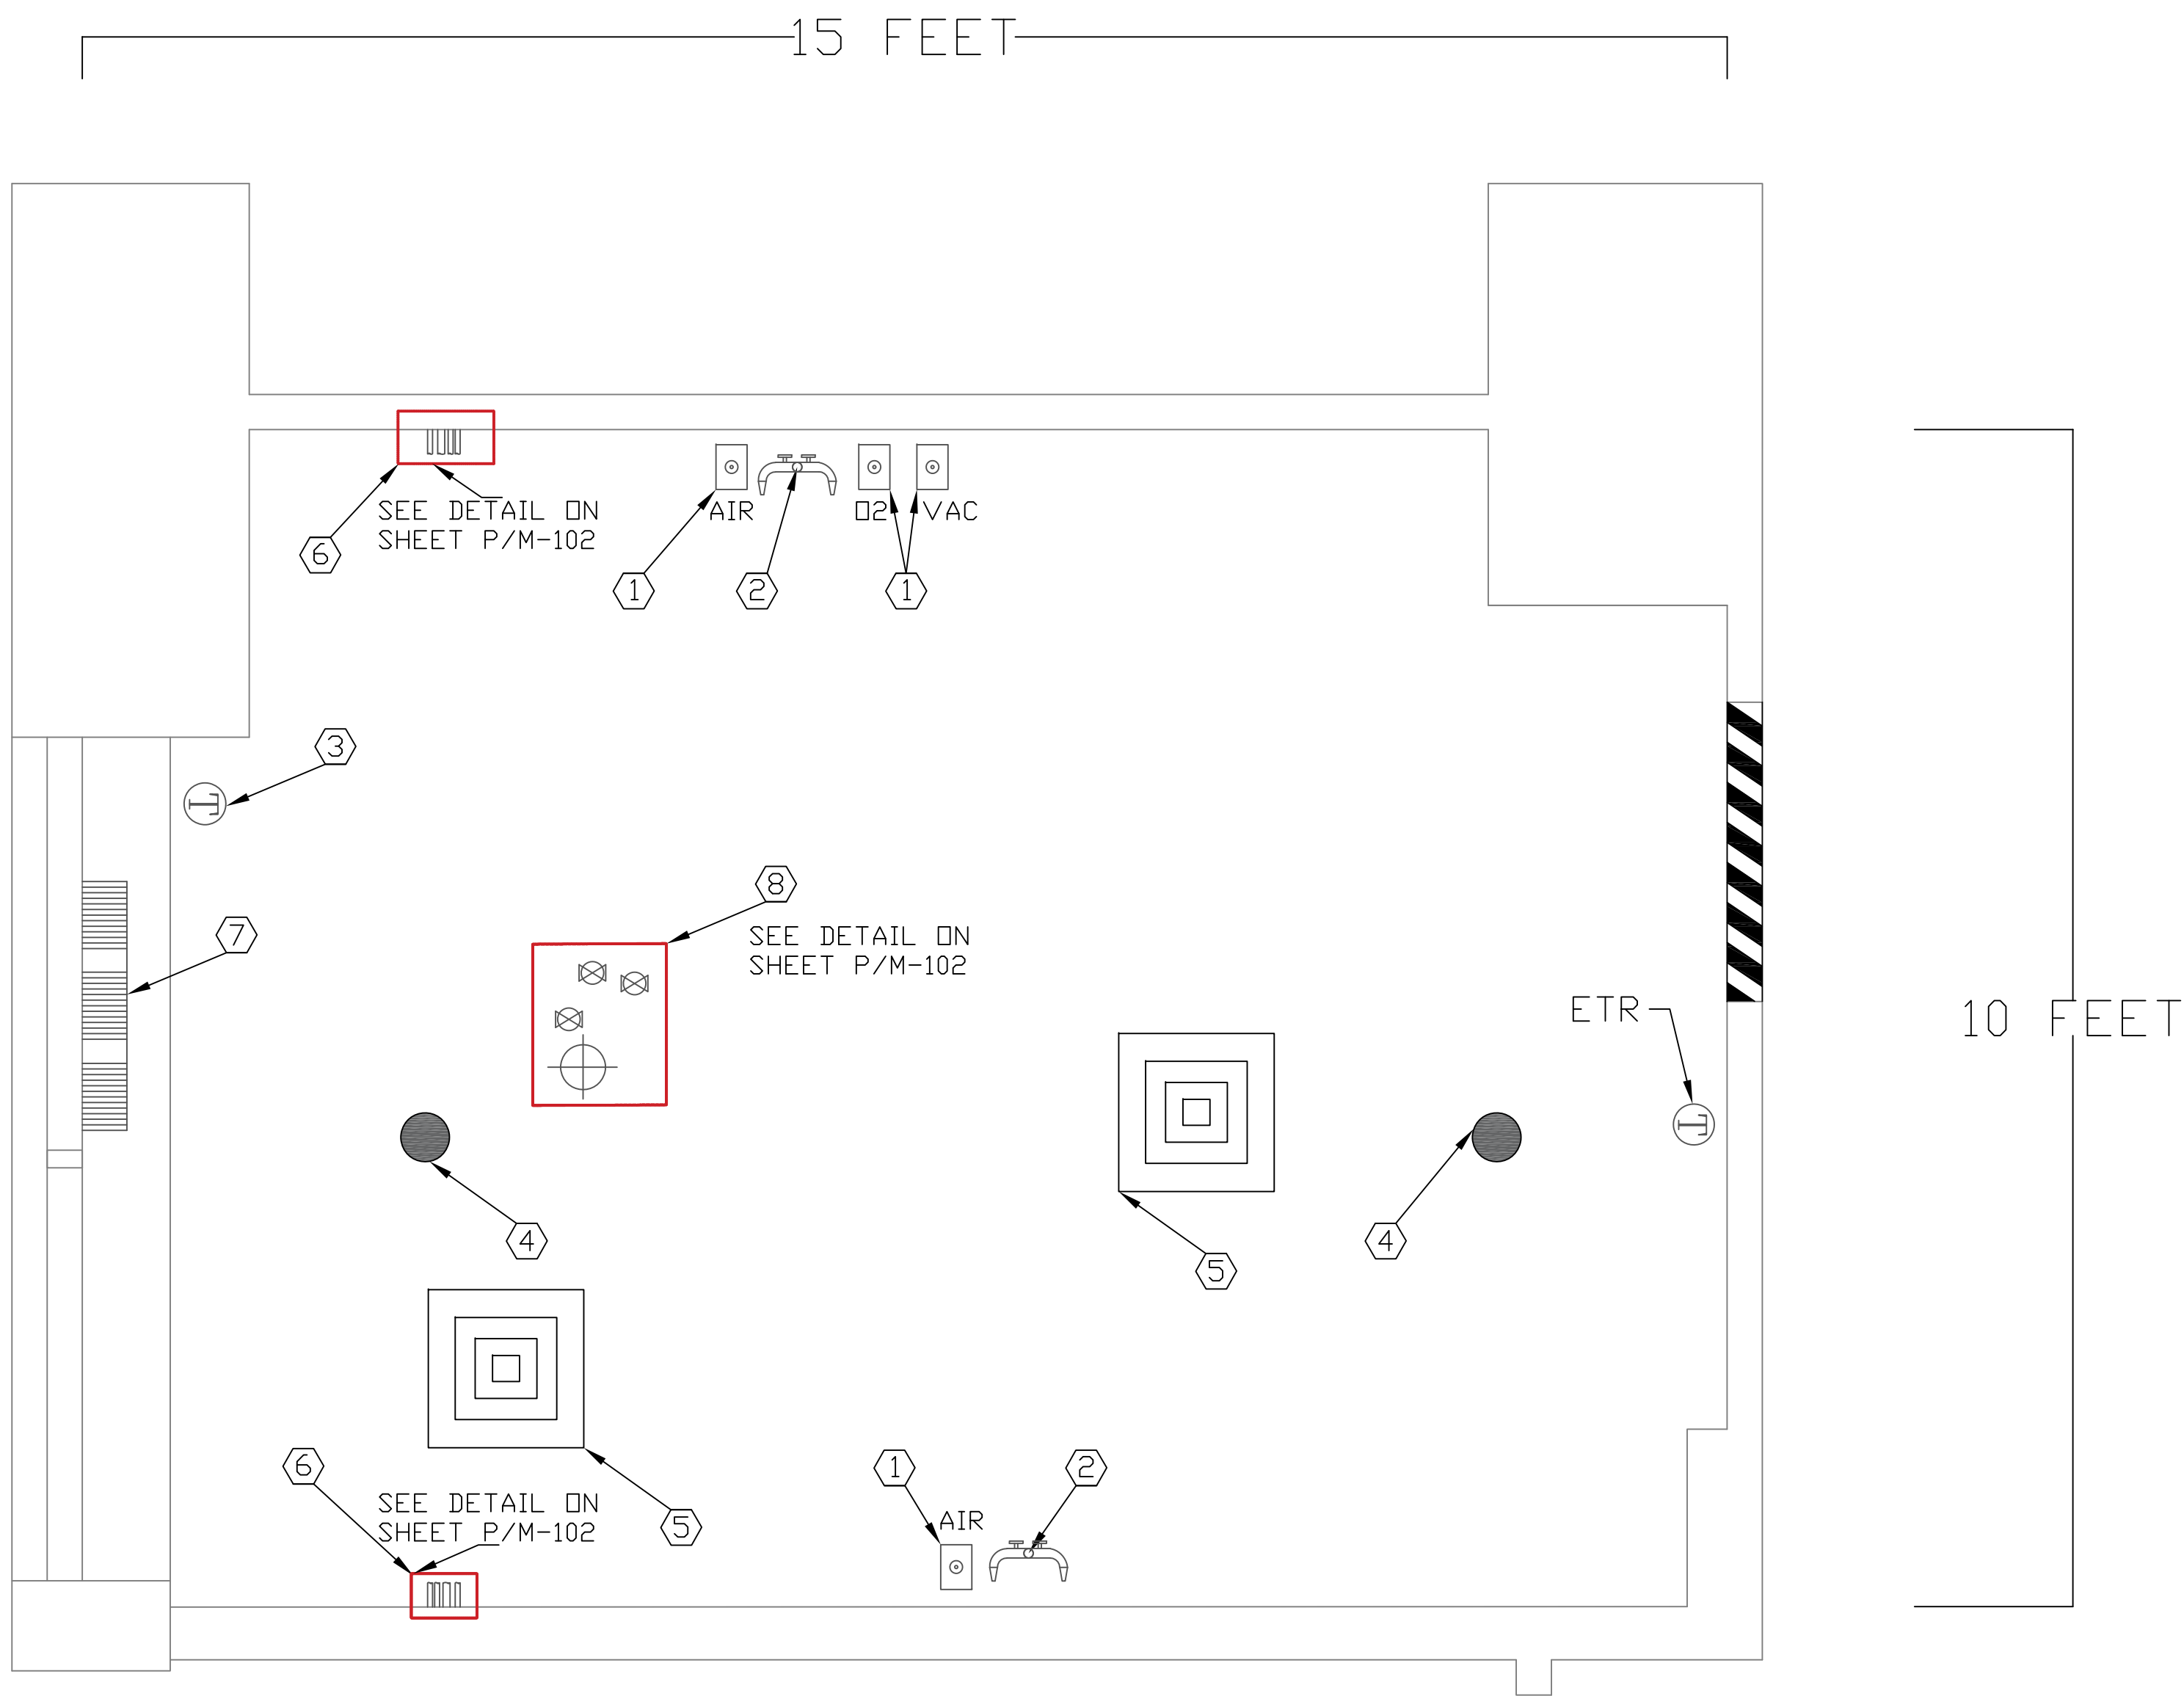

P/M
100

PROPOSED MECHANICAL/PLUMBING PLAN (N.T.S.)- 116-B-PHASE ONE

P/M
200

PROPOSED MECHANICAL/PLUMBING PLAN (N.T.S.)- 136-B, 137-B-PHASE TWO

		CONSULTANT	ARCHITECT/ENGINEER OF RECORD	STAMP	Office of Construction and Facilities Management	Drawing Title	Phase	Project Title	Project Number
			WNYHCS ENGINEERING BUFFALO VETERANS ADMINISTRATION MEDICAL CENTER 3495 BAILEY AVENUE BUFFALO, NEW YORK 14215 716-834-9200		U.S. Department of Veterans Affairs	PROPOSED MECHANICAL/PLUMBING PLAN	PHASE ONE AND TWO	DENTAL EXAM ROOM	528-22-127
						Approved: Project Director		Location	Building Number
								BUFFALO VAMC	1
								Issue Date	Drawing Number
								03/24/2023	P/M-101
								Checked	Drawn
								RJC	MTA