
MAGNETIC CLUTCH ADJUSTMENT [SKYACTIV-G 1.3, SKYACTIV-G 1.5]

id071100064l1

Warning
- **If A/C compressor operation is performed, do not start the engine. Otherwise, the drive belt could get caught and cause an accident.**


1. Remove the front under cover No.2. (See FRONT UNDER COVER No.2 REMOVAL/INSTALLATION.)
2. Measure the clearance around the entire circumference between the pressure plate and A/C compressor pulley using a thickness gauge.

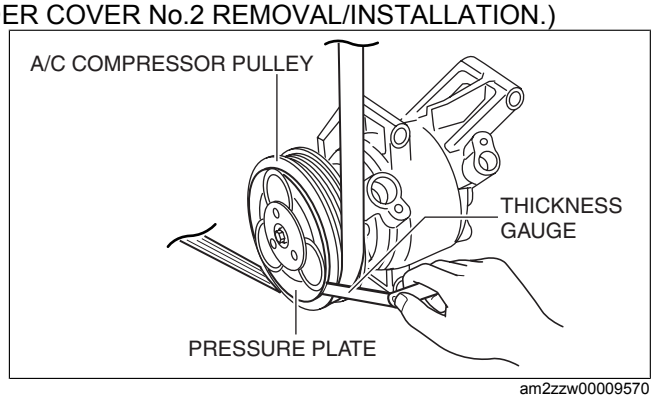

am2zzw00009570

3. Verify that the clearance is within the specification.
   - If the clearance is not within the specification, adjust the clearance by changing the type or number of the shim kit. (See MAGNETIC CLUTCH DISASSEMBLY/ASSEMBLY [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)

Magnetic clutch clearance
0.3—0.6 mm {0.012—0.023 in}

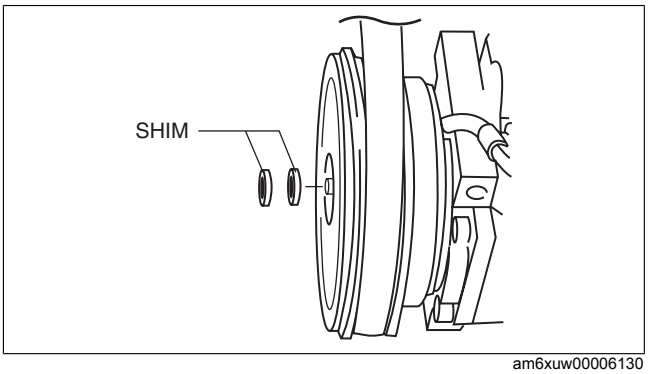

am6xuw00006130