ULTRA HIGH-TENSION STEEL [CONSTRUCTION]

id098007745600


Characteristics of Ultra High-Tensile Steel Plates

- Ultra high-tensile steel plates have enhanced tensile strength compared to previous high-tensile steel plates.
- Because the strength is maintained even though the plates are thin-walled, the ultra high-tensile steel plates are used for the frames and the main frame parts which form the cabin, reducing the weight of the vehicle.
- Enhanced shock absorption has improved the safety.

Range of Use and Cautions for Service

- Because the ultra high-tensile steel is hard and it may be difficult to reform, when extracting the damaged part using a frame repair machine, perform the work verifying that other parts are not affected.
- When drilling welded parts, use a well-ground drill bit.
- After welding, inspect the weld strength. If adhesion is poor, perform arc welding (plug welding).

4SD

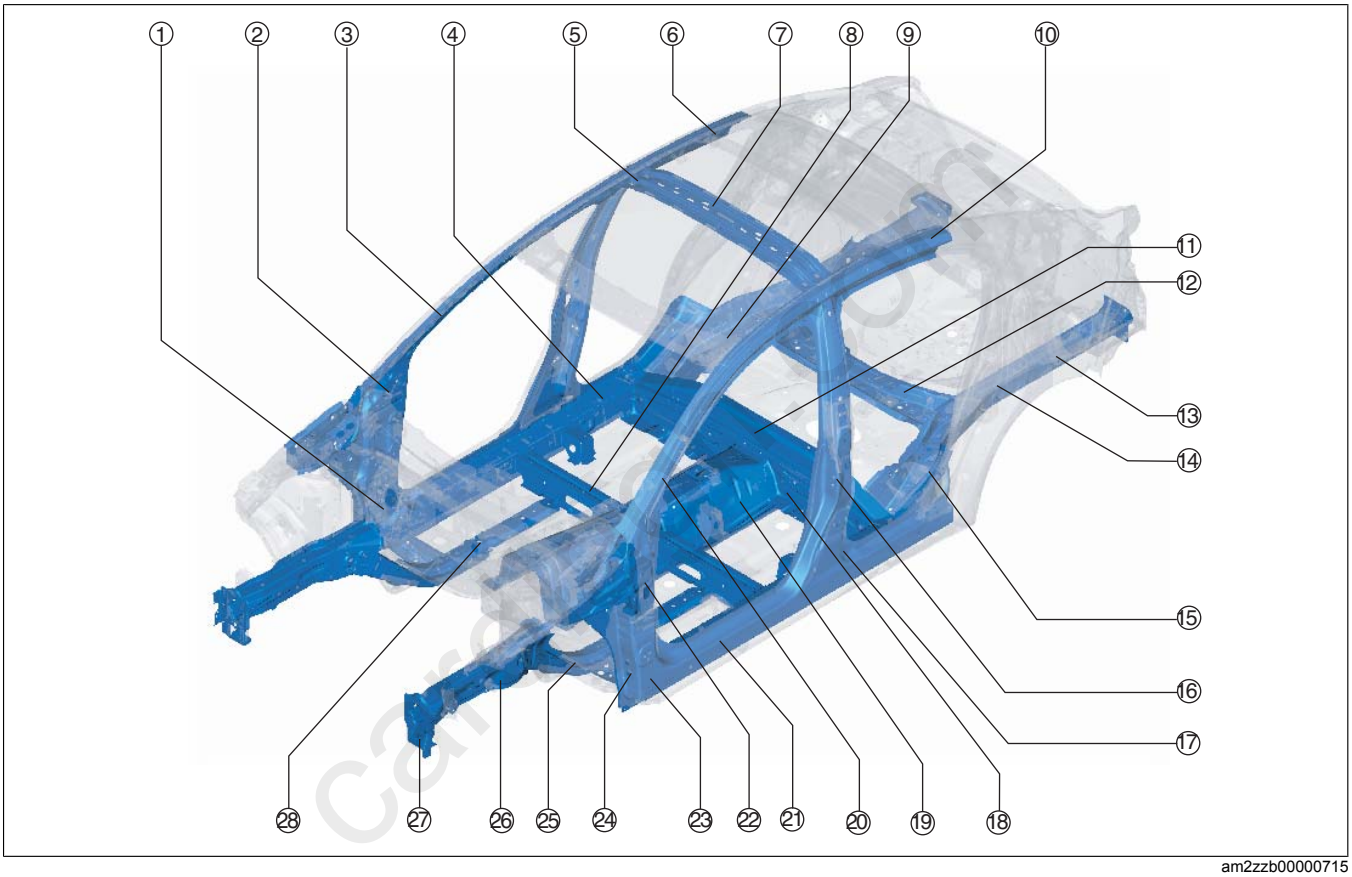


am2zzb00000715

No.	Part name	Strength (MPa) {kgf/cm^2, psi}
1	Side sill (front)	590 {6016, 85572}
2	Front pillar reinforcement (lower)	780 {7954, 113130}
3	Front pillar (inner)	1180 {12032, 171145}
4	Side sill reinforcement	980 {9993, 142137}
5	Roof corner gusset	590 {6016, 85572}
6	Roof rail (inner)	1180 {12032, 171145}
7	Roof reinforcement No.1	590 {6016, 85572}
8	Crossmember No.2	1180 {12032, 171145}
9	Floor side panel No.1	980 {9993, 142137}

No.	Part name	Strength (MPa) {kgf/cm^2, psi}
10	Roof rail reinforcement	980 {9993, 142137}
11	Crossmember No.3	980 {9993, 142137}
12	Crossmember No.4	780 {7954, 113130}
13	Rear side frame (center)	590 {6016, 85572}
14	Rear side frame (front)	590 {6016, 85572}
15	Side sill (inner)	590 {6016, 85572}
16	Center pillar reinforcement (upper)	980 {9993, 142137}
17	Center pillar reinforcement (lower)	590 {6016, 85572}
18	Crossmember No.3 (lower)	590 {6016, 85572}
19	Tunnel reinforcement	590 {6016, 85572}
20	Front pillar reinforcement (upper)	780 {7954, 113130}
21	Side sill reinforcement	980 {9993, 142137}
22	Cowl side reinforcement (upper)	590 {6016, 85572}
23	Hinge reinforcement	780 {7954, 113130}
24	Hinge reinforcement (inner, lower)	590 {6016, 85572}
25	Front frame (rear)	590 {6016, 85572}
26	Front side frame (outer)	590 {6016, 85572}
27	Bumper bracket	980 {9993, 142137}
28	Front B frame	780 {7954, 113130}

cardiagn.com

5HB

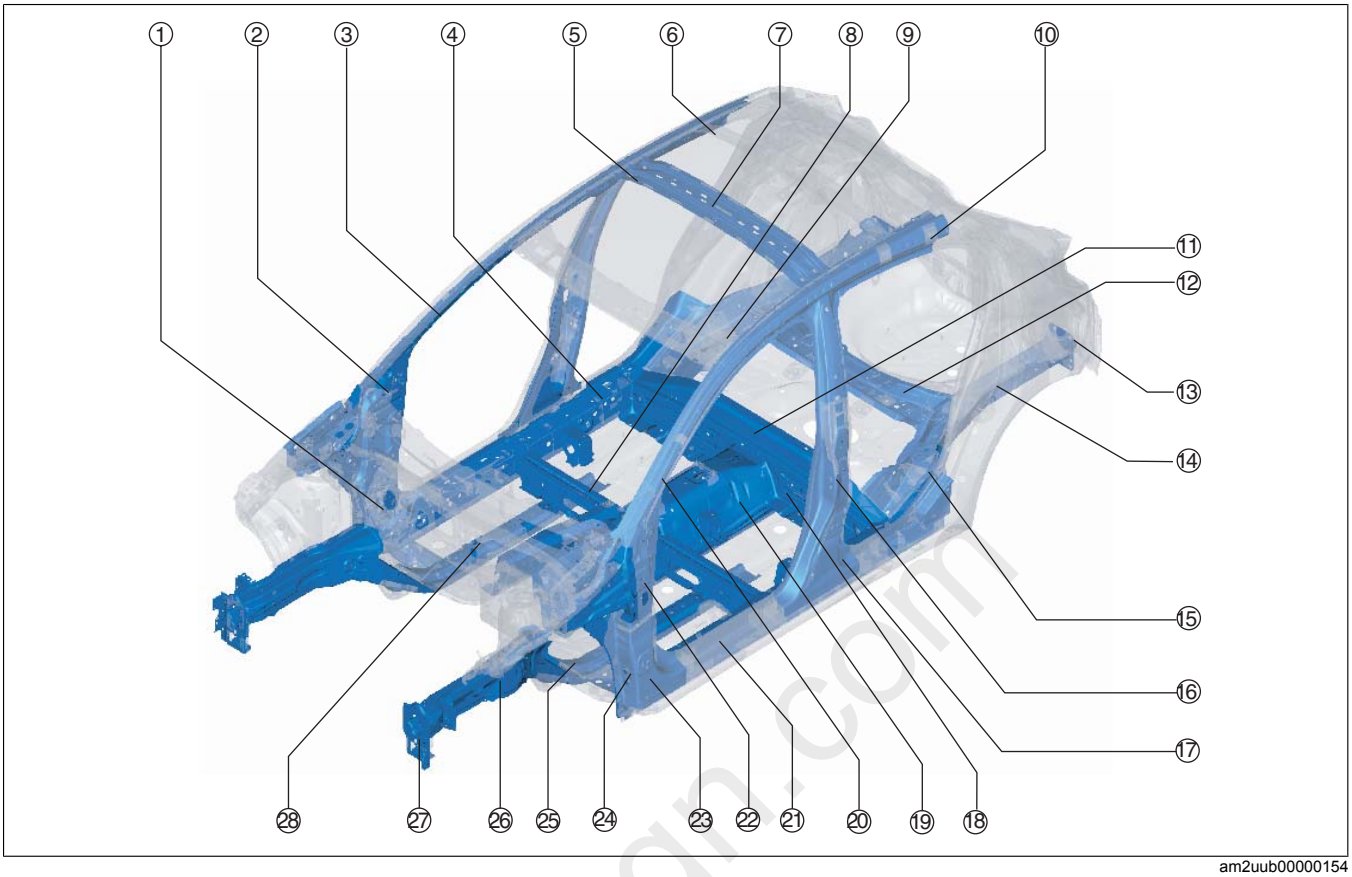

am2uub00000154

No.	Part name	Strength (MPa) {kgf/cm^2, psi}
1	Side sill (front)	590 {6016, 85572}
2	Front pillar reinforcement (lower)	780 {7954, 113130}
3	Front pillar (inner)	1180 {12032, 171145}
4	Side sill reinforcement	980 {9993, 142137}
5	Roof corner gusset	590 {6016, 85572}
6	Roof rail (inner)	1180 {12032, 171145}
7	Roof reinforcement No.1	590 {6016, 85572}
8	Crossmember No.2	1180 {12032, 171145}
9	Floor side panel No.1	980 {9993, 142137}
10	Roof rail reinforcement	980 {9993, 142137}
11	Crossmember No.3	980 {9993, 142137}
12	Crossmember No.4	780 {7954, 113130}
13	Rear side frame (rear)	780 {7954, 113130}
14	Rear side frame (front)	590 {6016, 85572}
15	Side sill (inner)	590 {6016, 85572}

cardiagn.com

No.	Part name	Strength (MPa) {kgf/cm^2, psi}
16	Center pillar reinforcement (upper)	980 {9993, 142137}
17	Center pillar reinforcement (lower)	590 {6016, 85572}
18	Crossmember No.3 (lower)	590 {6016, 85572}
19	Tunnel reinforcement	590 {6016, 85572}
20	Front pillar reinforcement (upper)	780 {7954, 113130}
21	Side sill reinforcement	980 {9993, 142137}
22	Cowl side reinforcement (upper)	590 {6016, 85572}
23	Hinge reinforcement	780 {7954, 113130}
24	Hinge reinforcement (inner, lower)	590 {6016, 85572}
25	Front frame (rear)	590 {6016, 85572}
26	Front side frame (outer)	590 {6016, 85572}
27	Bumper bracket	980 {9993, 142137}
28	Front B frame	780 {7954, 113130}

cardiagn.com