SIDE SILL PANEL REMOVAL [PANEL REPLACEMENT]

id098008615300


Symbol Marks

SYMBOL MARK	MEANING
●	SPOT WELDING
⎓	ROUGH CUT LOCATION

am2zzb00000511


Removal Procedure

1. Rough cut the 3 locations indicated by (A) shown in the figure.

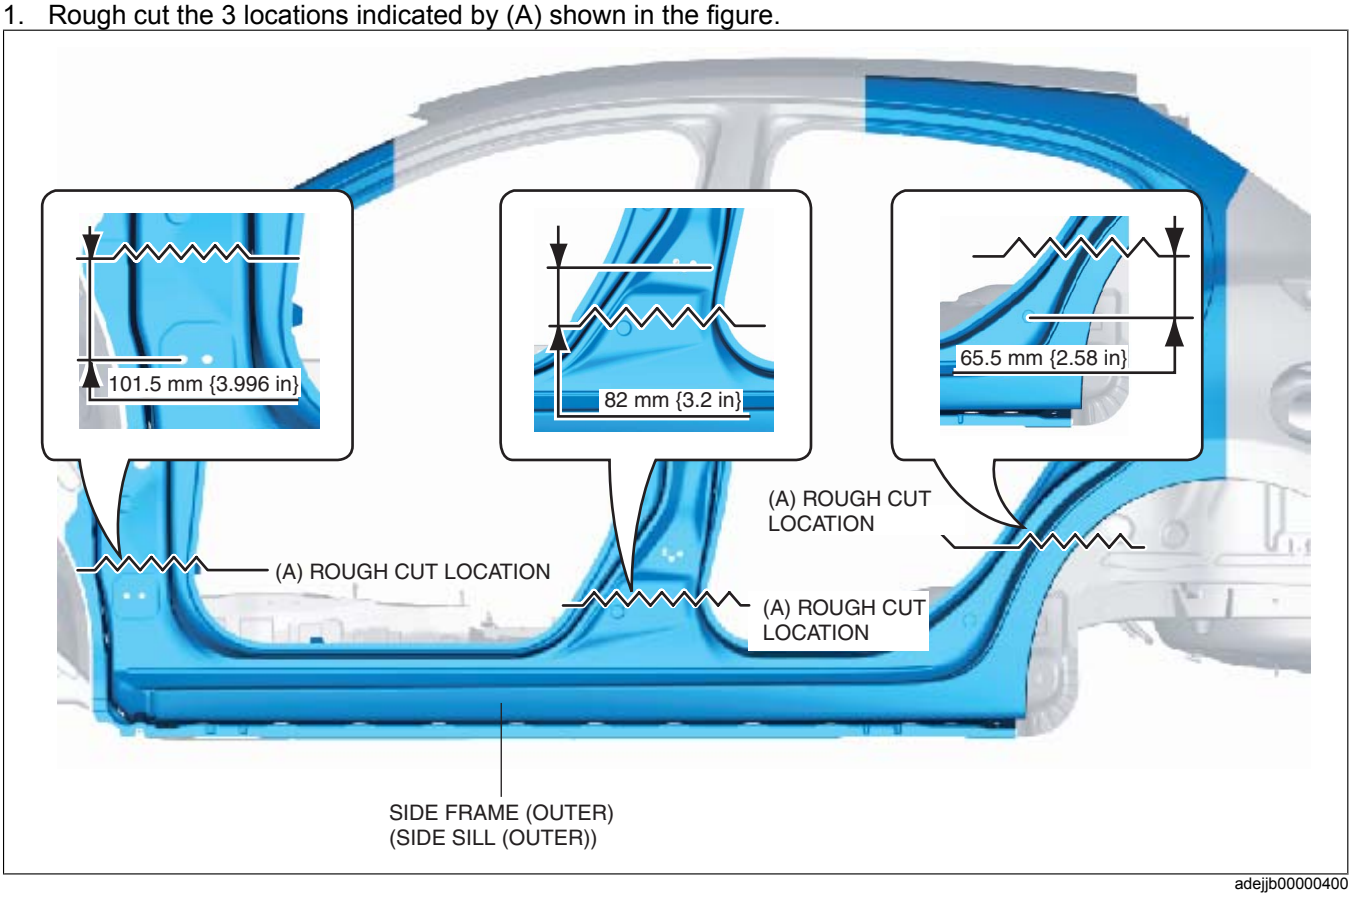


adejjb00000400

2. Drill the 107 locations indicated by (B) shown in the figure, then remove the side frame (outer) (side sill (outer)).

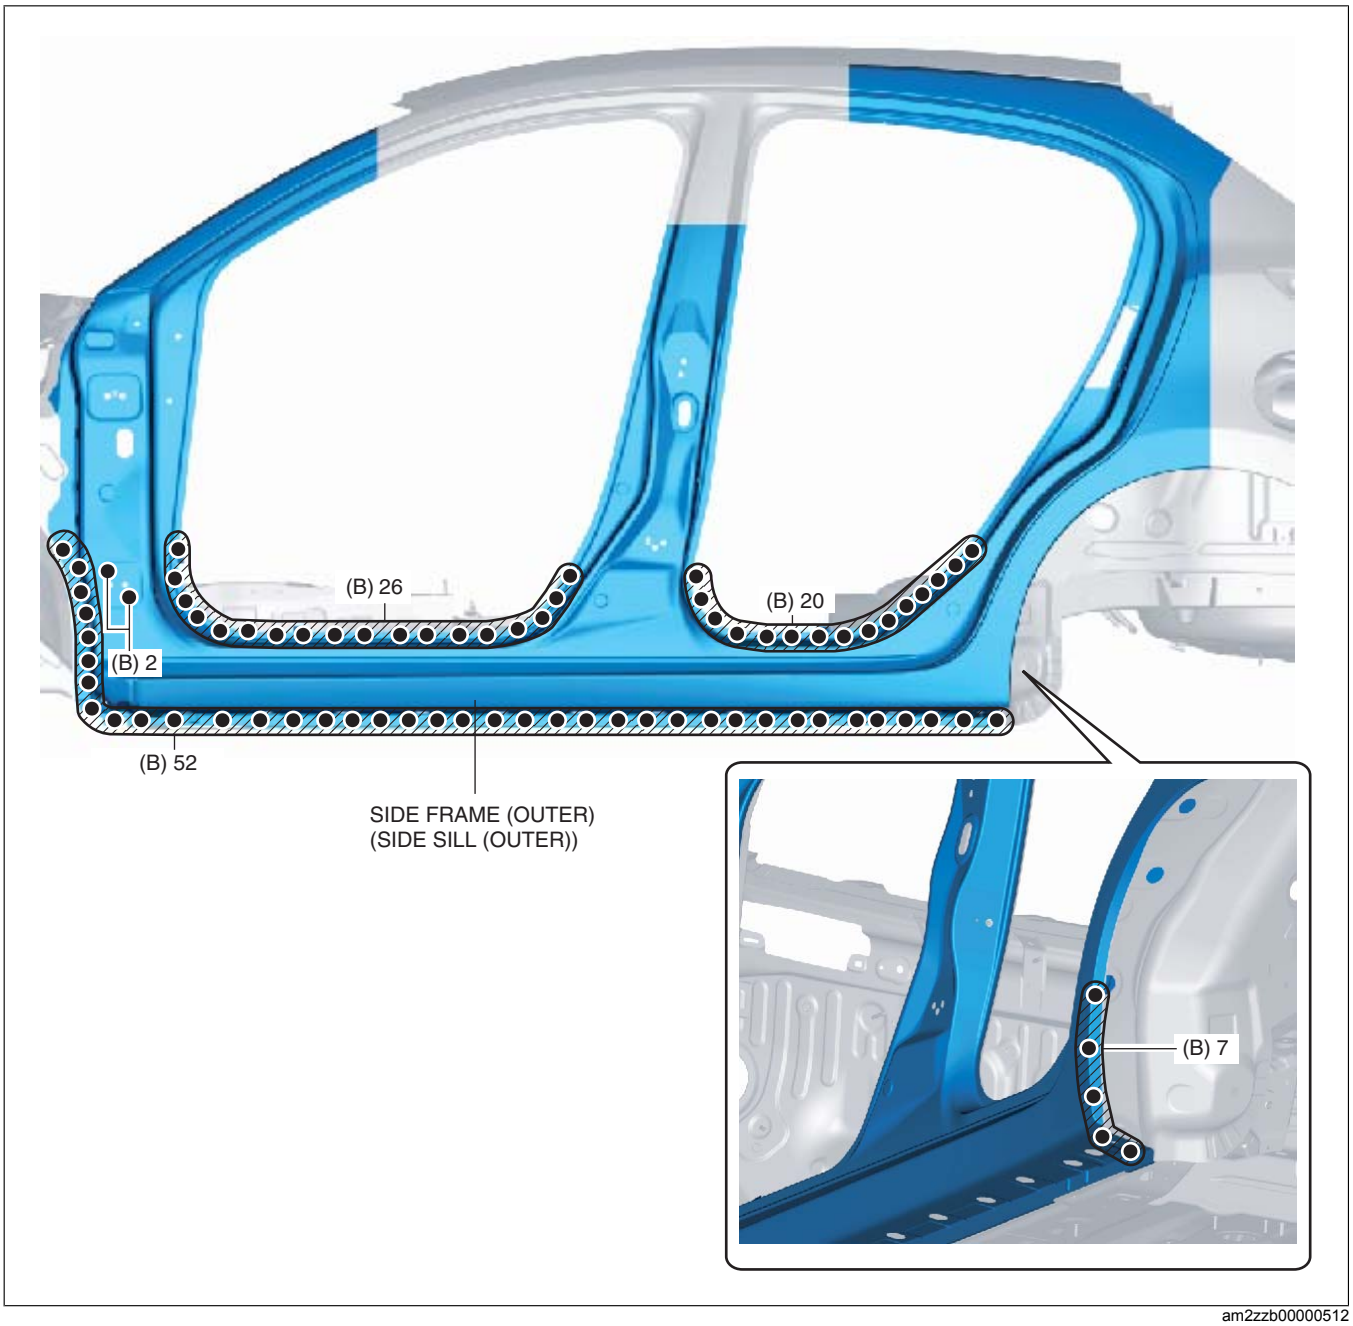


am2zzb00000512

3. Drill the 36 locations indicated by (C) shown in the figure.

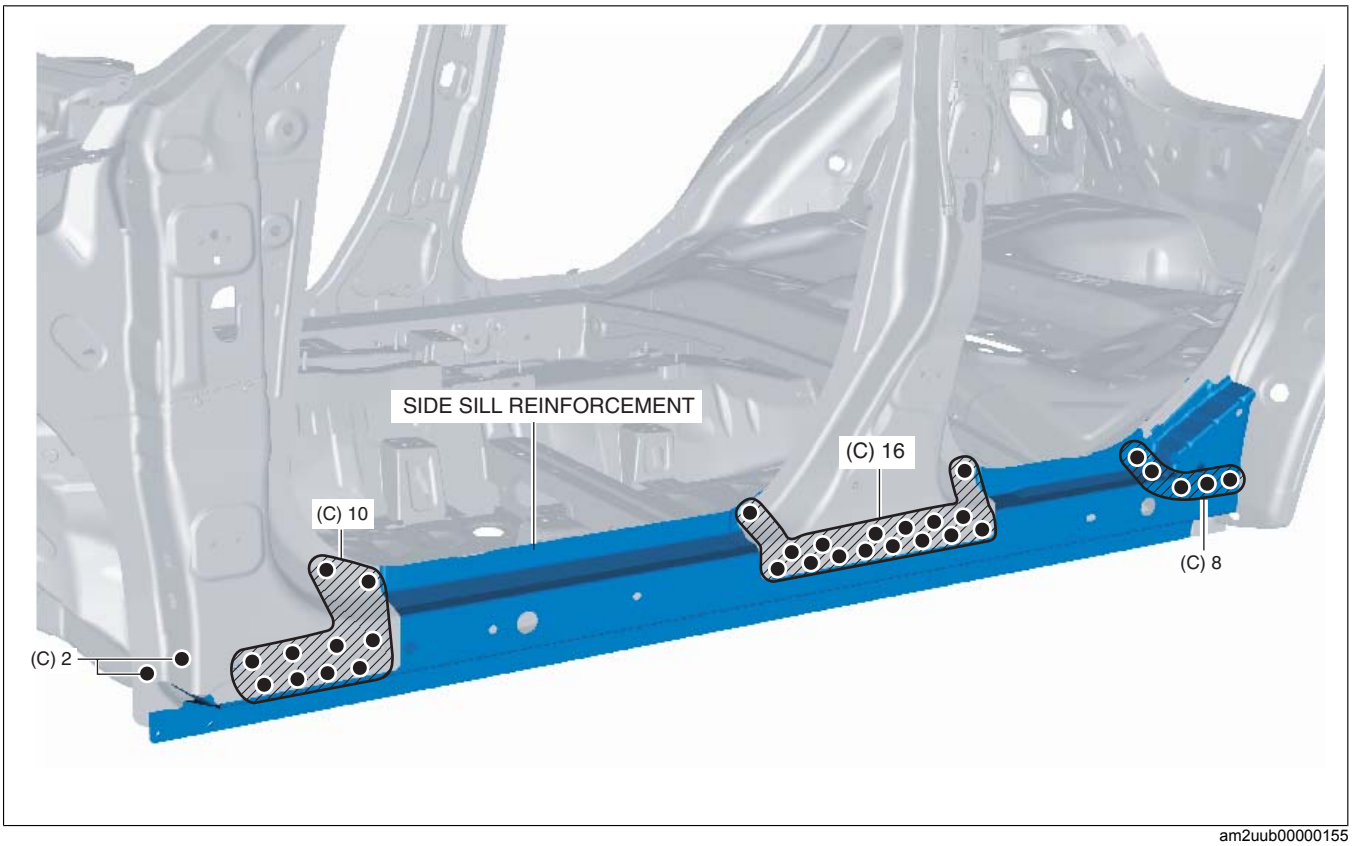


am2uub00000155

4. Drill the 5 locations indicated by (D) shown in the figure.

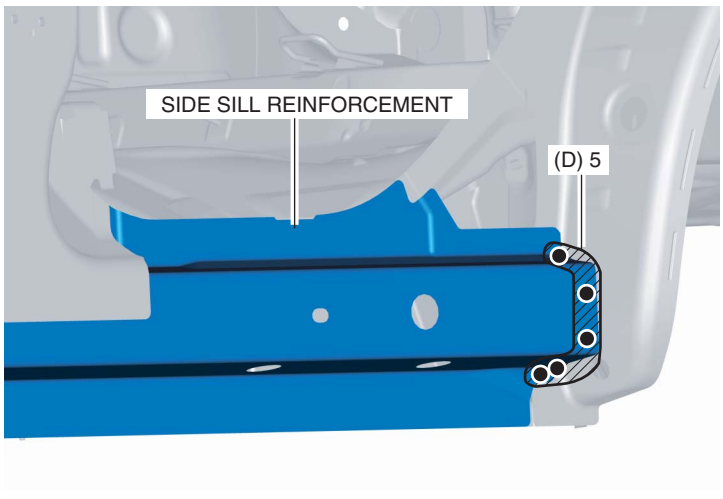

am2zzb00000716

5. Pull out the side sill reinforcement from the side sill (inner), hinge pillar reinforcement and center pillar reinforcement while rotating it.

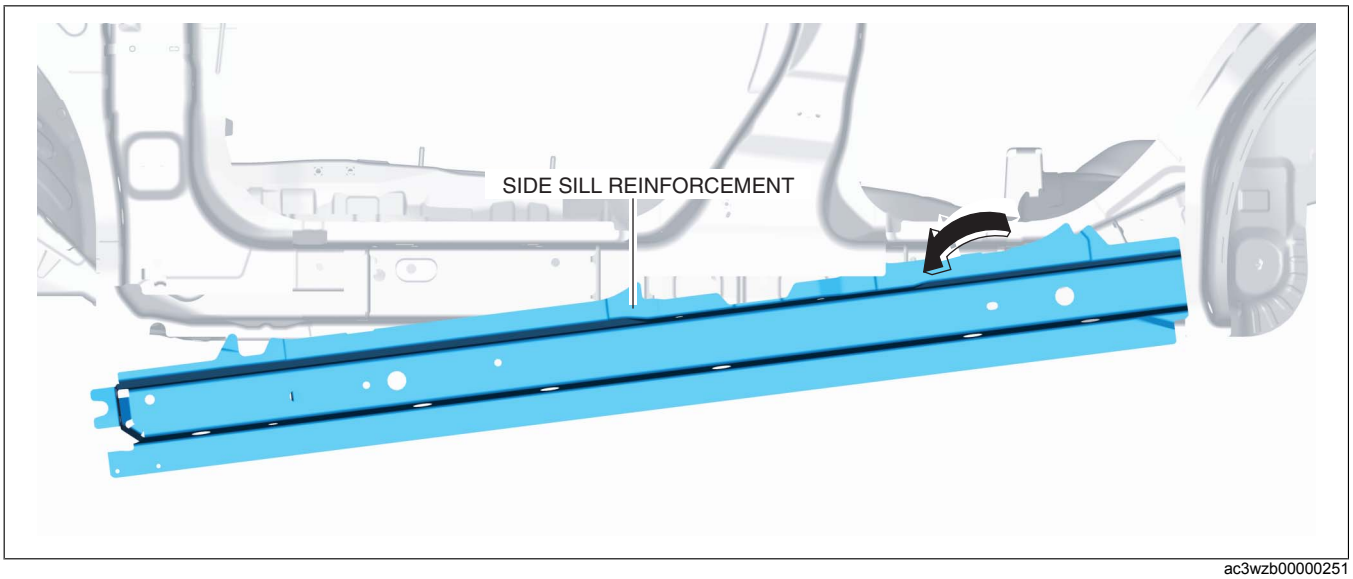

ac3wzb00000251